

1965 YELLOW BUG (CONUT)

WORK DONE, PART PROVIDED OR BROUGHT

- PROVIDE 4 LUGNUTS _____ N/C
- RECONFIGURE FRONT LIC. PLATE/RR PLATE - N/C
- TIGHTEN FRONT END
 - LINK PINS LOOSE - TIGHTEN 4 .5hr
 - DROP LINK LOOSE - TIGHTEN .5hr
 - DRIVERS OUTER TIE ROD V/BAD
REPLACE W/GOOD USED 15.00
 - * HEAT TIE ROD TO LOOSEN 1.5hr
 - * MIGHT NEED TOE ALIGNMENT
- GREASE FULL FRONT END (12 FITTINGS) 1.0hr
- TIGHTEN PASS. MIRROR REPLACE STRIPED
POST/NUT .5hr
- BRAKE LIGHTS NOT WORKING, BYPASS
BRAKE SWITCH - THEY WORK - NEEDS SWITCH ^{USED} 10.00
- TOP OFF BRAKE FLUID - GOOD PEDAL 3.00
- INSPECT ENTIRE BRAKE SYSTEM 1.0hr
ALL PARTS V/GOOD - NO NEW PART!
BRAKES ALL ADJUSTED WRONG!
 - ADJUST ALL BRAKES (LOWER E-BRAKE) .5hr
 - REPACK FRONT HUBS (NO GREASE) .5hr
 - ADJUST FRONT WHEEL BEARINGS .5hr
- PROVIDE 4 BRAKE BLEED CAPS 8.00
- PROVIDE 2 RR DRUM COTER PINS 2.00
- BLEED ALL BRAKES (2 TIMES) .5hr
- ADJUST CLUTCH (COUPLE TURNS) N/C

- OIL CHANGE - DRAIN .5hr
 CLEAN STRAINER
 STRAINER KIT 5.00
 CASTROL 20W50 3QTS 21.00
 OIL FILL CAP W NEW GASKET 7.00

- REPLACE L/R AXLE BOOTS (2) w/HARD WARE 40.00
 CLEAN AREA INSTALL 1.5
 ADD TRANS FLUID 2 QTS 90W 18.00
 - TIGHTEN AIR FILTER N/C
 - CHARGE BATTERY N/C

- REALIGN DOOR WINDOWS WITH N/C
 1/4 GLASS - NO TOO SUCCESSFUL

- REPLACE 2 WINDOW WINDERS (IVORY) 32.00
 PROVIDED 4 RUBBER BUFFERS 5.00
 PROVIDED 3 DOWELS .5hr
 ALL WINDOWS / DOOR HAVE HANDLES
 ESCUTCHEONS AND WORK

QUOTE FOR CORRECT SQUARE WEAVE
 CARPETS IS \$449, GRAY MATS \$150
 COULD BE MORE DUE TO NEED FOR
 EXTRA CARPET THAT STD. BUG DOESN'T HAVE

CONV. TO 12V - TIME PLUS COST OF PARTS \$166.00
 CONVERSION PARTS 650.00
 LABOR @ 6.00 \$816.00

NEW BATT. (INTERSTATE) FROM MIKE 90.00
FOUNDA

TESTED GENERATOR

VOLTAGE REGULATOR

DISCONNECT BATT WHILE RUNNING

- ENGINE STILL RAN! 5" FOR TALLER
EXTENDED GROUND STRAP
WITH ENGINE OFF - NO SPARK BATT.

AND THE GROUND TER. WHEN

REMOVE - APPARENTLY NO

DRAW ON BATTERY

60.00

\$150.00

1.5 hr TIE ROD (INSIDE) END (REPLACED) 40.00
- TIGHTEN UP WIPER ARMS N/C
CAR INSPECTION

HORN ✓
WIPERS ✓

NO BRAKES LIGHTS (DIRECT SHORT - HOT WIRES)
NO DRIVER TURN SIGNAL
VERY DIM REAR DRIVING LIGHTS
HIGH/LOWS ✓

2.5 hr GOT ALL INSPECTION ITEMS WORKING ^{20 EACH} 40.00
REPLACE TAIL LIGHT BULB HOLDERS WITH OEM
TIGHTEN DR. SIDE MIRROR (OUTSIDE)

NO ENGINE OIL LEAKS.

DR. SIDE COVER TO TRANSMISSION IS
LEAKING TRANS FLUID. NOT AN EASY
REPAIR CAUSE TRANS HAS TO COME OUT
TO SERVICE LEAK. JUST RUN IT FOR NOW

4 hr
@ 75.00

TIME	\$ 300.00
PARTS	<u>80.00</u>
TOTAL	\$ 380.00