



HABIBI MOTORSPORTS

11623 FAIRGROVE INDUSTRIAL BLVD
MARYLAND HEIGHTS, MO 63043

Phone # 314-600-0473

HabibiMotorSports@gmail.com
HABIBIRACING.COM

Date	Invoice #
8/18/2021	2696B

Bill To

VIN	YEAR	MAKE	MODEL & COLOR
SBM13FAA1JW003968	2018	MCLAREN	570S/BLK

Quantity	Item Code	Description	Price Each	Amount
1	DIAGNOSIS	MILEAGE IN:3857 MILEAGE OUT:3860 CUSTOMER STATES PASS.SIDE WINDOW GOES UP W/ DRIVER SIDE SWITCH - TOP ONLY GOES UP WITH DOORS OPEN - A/C BLOWING WARM - DRIVER SIDE POWER SEAT NOT MOVING- DRIVER WINDOW SWITCH IN-OP-WHEN OPENING DOOR THE WINDOWS GO ALL THE DOWN - CHECK & ADVISE (NOTE: ***(VEHICLE SAT ALL WINTER INSIDE ON A TRICKLE CHARGER & CHARGER FAILED & ALL ABOVE ISSUES STARTED.)	120.00	120.00
4	MCLAREN LABOR	TECH FOUND WINDOW & CONVERTIBLE TOP MODULE LOST THEIR LEARNED VARIABLES & HAD TO BE RETAUGHT . WORKING AS IT SHOULD NOW FROM FACTORY	179.00	716.00
0.5	MCLAREN LABOR	CLIMATE CONTROL UNIT NEEDED TO BE RELEARNED - A/C BLOWING COLD AT THIS TIME .	179.00	89.50
2.5	MCLAREN LABOR	TECH FOUND DRIVER SEAT MODULE BAD - SWAPPED OUT PASS. SIDE SEAT MODULE TO VERIY - LEFT PASS. SIDE INSTALLED ON DRIVER SEAT SO CUSTOMER CAN OPERATE SEAT FOR DRIVING. NEW SEAT MODULE NEEDS TO BE ORDERED FOR PASS. SIDE SEAT	179.00	447.50
1	PART	OEM PASSENGER SEAT MODULE PART # 13NA02BCP	772.92	772.92T
1.5	MCLAREN LABOR	INSTALLED PASS SEAT MAODULE Sales Tax	179.00 8.11%	268.50 62.68

Total	\$2,477.10
Payments/Credits	-\$2,208.60
Balance Due	\$268.50



White Glove Services
 10640 Gateway Blvd
 St Louis, MO 63132
 (314) 464-4001
 service@wgstl.com
 www.wgstl.com

Repair Order #8063

Created: 07/11/2025 at 12:50PM
 Payment Term: On Receipt
 Service Writer: Tony Pagano

2018 McLaren 570S Spider (Black)

VIN: SBM13FAA1JW003968
 Mileage In: 5,887 mi
 Mileage Out: 5,917 mi

Recommendations

Getting low voltage codes and missing communication recommend battery after charging battery outside the car and put back in the car the McLaren has no power still

Brake flush not completed as of 7/29/25 due to movie. will reschedule when settles in new shop

#	Services	Service Total
1	Diagnostic - Check Engine Light <i>Note: Cel is on due to low voltage codes Vehicle has newer battery from 8/2023 Cleared codes and test drove vehicle , battery tested good . Trouble codes did not come back on Recommend trickle charger for battery if vehicle sits for long periods of time .</i>	\$243.37
2	Complimentary Multi-Point Inspection <i>Note: Please let us know if you would like a copy of your Multi-Point Inspection.</i>	\$0.00
3	Wash & Vac - Complimentary <i>Note: Thank you for choosing White Glove Exotic Services for your automotive needs. Enjoy a hand wash & vacuum on us!</i>	\$0.00
4	McLaren AGM Battery Upgrade (570GT/570S)	\$1,827.81
5	Customer States Driver Door latch is damaged	\$271.06
6	Low Fuel	\$40.56

Estimates are an approximation of charges to you for the services requested. They are based on the anticipated details of the work to be done. It is possible for unexpected complications to cause some deviation from the quote. I hereby authorize the repair work or diagnostic hereinafter described in the estimate to be done along with the procurement of any necessary material, and I agree that I am to be held liable for the costs associated with labor hours and materials. I hold White Glove not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other unintentional cause or for any delays caused by unavailability of parts or delays in parts by the supplier or transporter. I understand that I have the right to know before authorizing my repairs for what costs I will be held liable. I understand that if my costs liability changes, I will be held responsible for reauthorizing the work before the work can proceed on my vehicle.

Totals only include authorized services

This shop charges a 3% credit card processing fee.

Subtotal	\$3,128.22
Discount	\$998.57
Shop Supplies	\$63.88
EPA	\$63.88
Tax	\$125.40
Grand Total	\$2,382.81
Paid to Date	(\$2,382.81)

REMAINING BALANCE \$0.00

I understand that I could be held liable for loss of potential income and/or costs accrued by White Glove that result from delays in my reauthorization of the work.
 Credit Cards may be subject to 3.5% processing fee.

Full Terms and Conditions

• Parties to this Agreement; Definitions. As used in this Agreement, the terms: (a) "White Glove Exotic Services" shall mean AD Services LLC, a Missouri



645 W. Randolph St. - Chicago IL 60661
 (312) 635-6482 Fax: (312) 635-6481

SERVICE DEPARTMENT HOURS
 8:00 a.m. to 5:00 p.m.
 Monday - Friday
 9:00 a.m. to 3:00 p.m. Saturday

R/O Open Date	R/O Number
5/27/20	6001886/1
R/O Close Date	Status
8/24/20	Final
Mileage In	Mileage Out
2827	2832

Service Advisor / Tag #	
Gretchen Barbar/*W*	
Vehicle Identification Number	
SBM13FAA1JW003968	
Delivery Date	In-Service Date
Color	License Number

			Work Phone	
			Home Phone	
Year	Make	Model	Body	
2018	MCLAREN	570S	SPIDER	

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
Cell: 314-422-7708	
#1 - 13N006: PASSENGER AIRBAG RECALL 13N006 Tech: JONATHAN ROMERO (61) Installed 1211NA010CP :AIRBAG-PASS-LHD-NON-AN CAMP Qty: 1 Installed 1211N2398CP :SOP-NUT-WURTH-M6-SELF SEC-0 Qty: 4 Installed 1213N2631CP :SOP-CLIP-ITW M18-0850-17 Qty: 3 Installed 1211N2355CP :LANTERN CLIP-A RAYMOND 0185 Qty: 3 Performed Airbag Recall as outlined in 11 N 006 campaign bulletin. Replaced the passenger side airbag per SIS instructions. New airbag module serial number is, 11NA010CP010000701832002629. Checked function of all interior functions and cleared any set faults, all systems are operating as designed at this time. See attached form N-015 Airbag Module Record form.	Warranty Warranty Warranty Warranty Warranty
#2 - 002: PERFORM 2ND YEAR SERVICE AS PER MCLAREN CHECKLIST. Check service book to see which services, if any, have been performed. Tech: JONATHAN ROMERO (61) Installed 1211F0107CP :OIL-FILTER 1@37.99 Installed 1211F0799CP :ENGINE-BED PLATE PLUG-INCL 1@38.65 Installed 1200RC042 :WASHER 1@4.98 Installed 1211F2806CP :ORING-SEAL-16X2 2@10.92 Installed 1211A4152CP :HVAC CABIN FILTER 1@120.05 Installed 1211F0217CP :AIR FILTER 2@95.57	1365.00 37.99 38.65 4.98 21.84 120.05 191.14

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR	
PARTS	
DEDUCTIBLE	
SUBLET	
SHOP SUPPLIES	
HAZARDOUS MATERIALS	
SALES TAX OR TAX I.D.	
SPECIAL ORDER DEPOSIT	
DISCOUNTS	
TOTAL DUE	

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.
 X
 © 2016 DEALERTRACK TECHNOLOGIES - Dealership Application Group (800) 945-1028



645 W. Randolph St. - Chicago IL 60661
 (312) 635-6482 Fax: (312) 635-6481

SERVICE DEPARTMENT HOURS
 8:00 a.m. to 5:00 p.m.
 Monday - Friday
 9:00 a.m. to 3:00 p.m. Saturday

R/O Open Date	R/O Number
5/27/20	6001886/2
R/O Close Date	Status
8/24/20	Final
Mileage In	Mileage Out
2827	2832
Service Advisor / Tag #	
Gretchen Barbar/*W*	

Work Phone			Vehicle Identification Number		
Home Phone			SBM13FAA1JW003968		
Body			Delivery Date		In-Service Date
Color			License Number		
Year	Make	Model			
2018	MCLAREN	570S	SPIDER		

DESCRIPTION OF SERVICE AND PARTS		AMOUNT
Installed CR2032 :BATTERY CR2032	2@9.75	19.50
Installed 0W40 :0W40 MOBIL 1, FULL SYNTHETIC	8@24.99	199.92
Installed 1211Q0366CP :BRAKE FLUID-DOT 5.1-1LTR	2@51.73	103.46
Installed 1213A4036CP :WIPER BLADE-LHD-ROW-DRIVER	1@75.54	75.54
Installed 1213A4037CP :WIPER BLADE-LHD-ROW-PASSENG	1@75.54	75.54
Performed Second Year Service as per McLaren Service inspection checklist. Tire pressures set to 29psi in front tires, 32psi in rear tires. Tire tread depths measured at lowest tread point of all four tires (outer, center, inner) are at: Left Front at 6.2, 5.6, 6.2mm; Right Front at 6.2, 5.9, 6.2mm; Left Rear at 5.5, 5.2, 5.7mm; Right Rear 5.4, 5.4, 5.6mm. Replaced wiper blades. Replaced remote key fob battery in the one supplied key fob. Placed the second remote key fob battery in the center console. Checked fluid and replaced engine oil and oil filter per Service Checklist. Replaced HVAC cabin air filter, replaced both engine air filters. Performed brake fluid replacement. Tire weld kit expires 02 2022. Interrogated fault memory and cleared faults. Applied carboflo to convertible top seals per related SIB. Stamped service book.		
Sub Total:	2253.61	

#3 - TOW: VEHICLE WAS TOWED INTO OR FROM THE DEALERSHIP		

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR	
PARTS	
DEDUCTIBLE	
SUBLET	
SHOP SUPPLIES	
HAZARDOUS MATERIALS	
SALES TAX OR TAX I.D.	
SPECIAL ORDER DEPOSIT	
DISCOUNTS	
TOTAL DUE	

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

X



645 W. Randolph St. - Chicago IL 60661
 (312) 635-6482 Fax: (312) 635-6481

SERVICE DEPARTMENT HOURS
 8:00 a.m. to 5:00 p.m.
 Monday - Friday
 9:00 a.m. to 3:00 p.m. Saturday

R/O Open Date	R/O Number
5/27/20	6001886/3
R/O Close Date	Status
8/24/20	Final
Mileage In	Mileage Out
2827	2832
Service Advisor / Tag #	
Gretchen Barbar/*W*	

			Work Phone	Vehicle Identification Number	
			Home Phone	SBM13FAA1JW003968	
				Delivery Date	In-Service Date
Year	Make	Model	Body	Color	License Number
2018	MCLAREN	570S	SPIDER		

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
<p>#4 * 999: MISC CUSTOMER STATES TAIL LIGHT FLICKERS PERIODICALLY. Tech: JONATHAN ROMERO (61) Customer states tail light flickers. Interrogated fault memory, there were no related faults stored for this concern. Performed multiple attempts during this service visit to duplicate this concern, however we were not able to duplicate any abnormal flickering of the tail lights at this time. Escalated the concern to the service manager. Service manager was unable to duplicate this concern at this time. Recommend offering the client the opportunity to display and duplicate this concern with the service department.</p>	Warranty
<p>#6 * A/C: CUSTOMER REQUESTS TO CHECK THE A/C SYSTEM OPERATION Caused by Checked A/C operations, found that the A/C outlet air temperature is blowing warmer than usual, blowing at 65 degrees F max cold setting, eventually blowing at 75+ degrees F. Connected the MDS and scanned for faults, no related faults found. Checked actual values, found refrigerant pressures were too low at times and then would spike at times, monitored with line graph. Also found that the evaporator temperature would vary Tech: JONATHAN ROMERO (61)</p>	Warranty

TERMS STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR	
PARTS	
DEDUCTIBLE	
SUBLET	
SHOP SUPPLIES	
HAZARDOUS MATERIALS	
SALES TAX OR TAX I.D.	
SPECIAL ORDER DEPOSIT	
DISCOUNTS	
TOTAL DUE	

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

X



645 W. Randolph St. - Chicago IL 60661
 (312) 635-6482 Fax: (312) 635-6481

SERVICE DEPARTMENT HOURS
 8:00 a.m. to 5:00 p.m.
 Monday - Friday
 9:00 a.m. to 3:00 p.m. Saturday

R/O Open Date	R/O Number
5/27/20	6001886/4
R/O Close Date	Status
8/24/20	Final
Mileage In	Mileage Out
2827	2832
Service Advisor / Tag #	
Gretchen Barbar/*W*	

			Work Phone	Vehicle Identification Number		
			Home Phone	SBM13FAA1JW003968		
				Delivery Date	In-Service Date	
Year	Make	Model	Body	Color	License Number	
2018	MCLAREN	570S	SPIDER			

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
<p>Connected A/C machine and evacuated the refrigerant, it was within specifications. Charged the A/C system back to specifications and monitored the pressures. The pressures would slowly go all the way up and go past the specifications, would get past 20bar, and then slowly go all the way down. Performed the HVAC module reset as outlined in KA-01106 to ensure the system is properly reset. After the reset, the A/C system began to function properly, the A/C pressures were consistent now and were within spec. Indicating that the HVAC module and system was out of calibration causing the evaporator to ice over eventually causing a blockage which lead to excessive refrigerant pressures. A/C outlet air temperature is now blowing cold at 38 degrees F. System operating properly at this time.</p>	
<p>#7 * 999: MISC CUSTOMER REQUESTS TO CHECK TIRE PRESSURES. Also would like to know if it is recommended to fill the tires with nitrogen. Tech: JONATHAN ROMERO (61) Tire pressure set to 29psi in front tires, 32psi in rear tires. As per McLaren Owner's Manual (handbook), tire pressures should be checked at least every 14 days as noted in section 5 page</p>	Warranty

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR	
PARTS	
DEDUCTIBLE	
SUBLET	
SHOP SUPPLIES	
HAZARDOUS MATERIALS	
SALES TAX OR TAX I.D.	
SPECIAL ORDER DEPOSIT	
DISCOUNTS	
TOTAL DUE	

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

X
 © 2018 DEALERTRACK TECHNOLOGIES - Dealership Application Group (800) 945-1028



645 W. Randolph St. - Chicago IL 60661
 (312) 635-6482 Fax: (312) 635-6481

SERVICE DEPARTMENT HOURS
 8:00 a.m. to 5:00 p.m.
 Monday - Friday
 9:00 a.m. to 3:00 p.m. Saturday

R/O Open Date	R/O Number
5/27/20	6001886/5
R/O Close Date	Status
8/24/20	Final
Mileage In	Mileage Out
2827	2832
Service Advisor / Tag #	
Gretchen Barbar/*W*	

			Work Phone	Vehicle Identification Number		
			Home Phone	SBM13FAA1JW003968		
				Delivery Date	In-Service Date	
Year	Make	Model	Body	Color	License Number	
2018	MCLAREN	570S	SPIDER			

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
5.36 with Tire pressure amount noted in section 6 page 6.14	

#8 * 999: MISC Customer states that the vehicle gives a "Bonnet Open" message when the bonnet is closed half the time. Tech: JONATHAN ROMERO (61) Interrogated fault memory, there are no current or past faults stored for the bonnet latch assembly in any of the modules. Technician also has not been able to duplicate this warning message during this service visit. Escalated concern to service manager, fault was still unable to be duplicated. Recommend offering the client the opportunity to display and duplicate this concern with the service department.	Warranty

#9 * 999: MISC DURING AIRBAG RECALL FOUND THAT THERE IS AIRBAG LIGHT PRESENT. PER TR APPROVAL REPLACE DASH HARNESS. Caused by Upon completion of passenger side airbag replacement for recall 13 N 006, during the test drive, the airbag light came on. Interrogated faults and found multiple driver's side airbag	

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. *I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.*

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR	
PARTS	
DEDUCTIBLE	
SUBLET	
SHOP SUPPLIES	
HAZARDOUS MATERIALS	
SALES TAX OR TAX I.D.	
SPECIAL ORDER DEPOSIT	
DISCOUNTS	
TOTAL DUE	

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

X



645 W. Randolph St. - Chicago IL 60661
 (312) 635-6482 Fax: (312) 635-6481

SERVICE DEPARTMENT HOURS
 8:00 a.m. to 5:00 p.m.
 Monday - Friday
 9:00 a.m. to 3:00 p.m. Saturday

R/O Open Date	R/O Number
5/27/20	6001886/6
R/O Close Date	Status
8/24/20	Final
Mileage In	Mileage Out
2827	2832

Service Advisor / Tag #	
Gretchen Barbar/*W*	
Vehicle Identification Number	
SBM13FAA1JW003968	
Delivery Date	In-Service Date
Color	License Number

Year			Make			Model			Body		
2018			MCLAREN			570S			SPIDER		
Work Phone						Home Phone					

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
<p>faults in the ORC that were active: B1B021A, B1B0101 and B1B0201. Checked ORC actual values and found that the Driver airbag stage 1 squib resistance value 3.60, Driver airbag stage 1 squib status LINKED, Driver airbag stage 2 squib (61)</p> <p>Tech: JONATHAN ROMERO</p> <p>Installed 1213MA105CP :HARNES FACIA FED ELEC COLU Qty: 1</p> <p>Installed 1211N2249CP :SCREW-SKT-CSK-M16X25-PT 8.8 Qty: 1</p> <p>Installed 1211M3220CP :CLIP SERVICE KIT Qty: 2</p> <p>resistance value 0.80, and Driver airbag stage 2 squib status LINKED, indicating a potential open circuit. Checked IMBFC5 on SBC housing bracket: good. Checked IFCSC2 on the diver side above the steering column, visually it appeared to be connected, however with a slight pull without releasing the connector s lock, the connector came fully disconnected. Unsuccessfully attempted to reconnect IFCSC2L. Upon closer inspection of the connector, found that where the (yellow) locking tab is held down into place with the (white) sliding spring lock of the connector has become warped, causing the locking tab not to be held into place anymore. Created a TR case. Per TR s approval due to manufacturing error of connecting the connector, removed the facia and separated from the facia crossbeam and replaced the facia wire harness. Reinstalled facia.</p>	<p>Warranty</p> <p>Warranty</p> <p>Warranty</p> <p>Warranty</p>

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR	
PARTS	
DEDUCTIBLE	
SUBLET	
SHOP SUPPLIES	
HAZARDOUS MATERIALS	
SALES TAX OR TAX I.D.	
SPECIAL ORDER DEPOSIT	
DISCOUNTS	
TOTAL DUE	

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

X



645 W. Randolph St. - Chicago IL 60661
 (312) 635-6482 Fax: (312) 635-6481

SERVICE DEPARTMENT HOURS
 8:00 a.m. to 5:00 p.m.
 Monday - Friday
 9:00 a.m. to 3:00 p.m. Saturday

R/O Open Date	R/O Number
5/27/20	6001886/7
R/O Close Date	Status
8/24/20	Final
Mileage In	Mileage Out
2827	2832
Service Advisor / Tag #	
Gretchen Barbar/*W*	
Vehicle Identification Number	
SBM13FAA1JW003968	
Delivery Date	In-Service Date
Color	License Number

Year			Make			Model			Work Phone		
2018			MCLAREN			570S			SPIDER		
Home Phone			Body			Delivery Date			In-Service Date		
License Number			Color			Year			Make		

DESCRIPTION OF SERVICE AND PARTS	AMOUNT
<p>Cleared faults and performed test drive. No further airbag faults have returned at this time.</p> <p>*****</p> <p>* Ask us about protecting your car with a McLaren * * Extended Service Contract! * * *Vehicles left more than 48 hours after completion will * * incur a \$100/day storage fee.*</p> <p>*****</p>	

TERMS: STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. "I hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto."

DISCLAIMER OF WARRANTIES. Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

LABOR	1365.00
PARTS	888.61
DEDUCTIBLE	.00
SUBLET	.00
SHOP SUPPLIES	30.00
HAZARDOUS MATERIALS	.00
SALES TAX OR TAX I.D.	94.16
SPECIAL ORDER DEPOSIT	.00
DISCOUNTS	.00
TOTAL DUE	2377.77
AX/VI/MC/DV 024885	2377.77

NO RETURN ON ELECTRICAL OR SAFETY ITEMS OR SPECIAL ORDERS.

X



5758 W Fillmore Street Chicago IL US 60644 www.mclarenchicago.com
 +(312) 635 - 6482
 general@mclarenchicago.com

Customer Pay Invoice
\$10,215.63

RO# : 6003909 | Tag# : 245
 Check-in: Thu Nov 9, 2023 | 10:43 AM

Customer	Pickup-Customer Same as Customer	Vehicle 2018 McLaren 570S- Black	Service Advisor Chris Swist
	Billing-Customer Same as Customer	Spider: Convertible 3.8L V8 2DR Turbocharged GAS FI: RWD: DC: Convertible SBM13FAA1JW003968 License: Z971JB 5,049 Mi In / 5,055 Mi Out	

1.	5YS	PERFORM 5 YEAR MAINTENANCE SERVICE	Customer Pay	\$3,204.38
-----------	------------	---	---------------------	-------------------

Job added by Chris Swist on Thu Nov 9, 2023 | 10:43 AM

5YS -PERFORM 5 YEAR MAINTENANCE SERVICE	Labor	\$2,517.50
---	--------------	-------------------

1. COMPLETED 5 YEAR MAINTENANCE SERVICE AS REQUIRED

Parts

- 1200RB206 - CLMP-SPRGBAND-LO PRO-47X12-STL-ZFB 2 - \$33.42
- 1211F0107CP - OIL-FILTER 1 - \$37.99
- 1211F0799CP - ENGINE-BED PLATE PLUG-INCL WASHER 1 - \$38.65
- 1223FA328CP - WASHER-CRUSH-AL 14X18X1.35 DIN 7603-A 1 - \$4.98
- 1211F2806CP - ORING-SEAL-16X2 2 - \$21.84
- 1213A4036CP - WIPER BLADE-LHD-ROW-DRIVER 1 - \$75.54
- 1213A4037CP - WIPER BLADE-LHD-ROW-PASSENGER 1 - \$75.54
- 1211A4152CP - HVAC CABIN FILTER 1 - \$120.05
- 1211M1213CP - SOP-KEY FOB BATTERY-CR2032 2 - \$29.00
- G48 - ZEREX G48 COOLANT 1 - \$49.95
- OW40 - OW40 MOBIL 1, FULL SYNTHETIC 8 - \$199.92

\$686.88

2.	BATT	PERFORM MCLAREN BATTERY REPLACEMNT SERVICE - GEN III BATTERY W/ PARTS	Customer Pay	\$4,608.38
-----------	-------------	--	---------------------	-------------------

Job added by Chris Swist on Thu Nov 9, 2023 | 10:43 AM

BATT -PERFORM BATTERY TEST, PROVIDE PRINT OUT AND ADVISE.	Labor	\$1,060.00
---	--------------	-------------------

1. replaced battery and installed upgraded battery box and replated hardware





Customer Pay Invoice

\$10,215.63

RO# : 6003909 | Tag# : 245

Check-in: Thu Nov 9, 2023 | 10:43 AM

5758 W Fillmore Street Chicago IL US 60644 www.mclarenchicago.com
+1(312) 635 - 6482
general@mclarenchicago.com

Customer	Billing-Customer	Vehicle	Service Advisor
	Same as Customer	2018 McLaren 570S- Black SBM13FAA1JW003968	Chris Swist

Parts	\$3,548.38
1222MA137CP - LV BATTERY 60AH 1 - \$2,418.09	
1222MA274GP - CLAMP BATTERY SIDE-RH 1 - \$74.50	
1222MA404GP - ASSY - CABLE BATTERY NEGATIVE 1 - \$657.34	
1222MA347GP - PRE FUSE BOX 1 - \$328.64	
1211MA038CP - BATTERY GEN_3 LIN HARNESS 1 - \$69.81	

4. QC	PERFORM QUALITY CONTROL INSPECTION	Customer Pay	\$0.00
--------------	---	---------------------	---------------

Job added by Chris Swist on Thu Nov 9, 2023 | 10:43 AM

QC -PERFORM QUALITY CONTROL INSPECTION	Labor	\$0.00
--	--------------	---------------

1. COMPLETED QC INSPECTION POST SERVICE

5. DETAIL	VEHICLE DETAIL	Customer Pay	\$0.00
------------------	-----------------------	---------------------	---------------

Job added by Chris Swist on Thu Nov 9, 2023 | 10:43 AM

DETAIL -VEHICLE DETAIL	Labor	\$0.00
------------------------	--------------	---------------

1. CLEANED VEHICLE AS REQUIRED

6. TOW	VEHICLE TRANSPORTED TO/FROM DEALER	Customer Pay	\$0.00
---------------	---	---------------------	---------------

Job added by Chris Swist on Thu Nov 9, 2023 | 10:43 AM

TOW -VEHICLE TRANSPORTED TO/FROM DEALER	Labor	\$0.00
---	--------------	---------------

1. VEHICLE TRANSPORTED TO/FROM DEALERSHIP

7. RECOMMENDATI ON	REPLACE FRONT LOWER FLOOR - CRACKED IN FRONT	Customer Pay	\$890.05
-------------------------------	---	---------------------	-----------------

Job added by Chris Swist on Wed Nov 15, 2023 | 8:35 AM





5758 W Fillmore Street Chicago IL US 60644 www.mclarenchicago.com
 +1(312) 635 - 6482
 general@mclarenchicago.com

Customer Pay Invoice
\$10,215.63

RO# : 6003909 | Tag# : 245
 Check-in: Thu Nov 9, 2023 | 10:43 AM

Customer	Billing-Customer	Vehicle	Service Advisor
	Same as Customer	2018 McLaren 570S- Black SBM13FAA1JW003968	Chris Swist

RECOMMENDATION -RECOMMENDATION Labor \$265.00

1. drove vehicle into shop. placed vehicle securely on to lift and raised. removed damaged floor. while removing the front floor found 3 clips that were damaged. replaced clips with new parts. installed new front floor on to vehicle.

Parts \$625.05
 1213A6500CP - FRONT FLOOR 1 - \$607.23
 1200RB006 - SPIER CLIP-4.2X7 2.5X5.0 8MM 3 - \$17.82

8. RECOMMENDATI **INSTALL FRONT SCRAPE ARMOUR** Customer Pay \$914.95
 ON

Job added by Chris Swist on Wed Nov 15, 2023 | 8:35 AM

RECOMMENDATION -RECOMMENDATION Labor \$265.00

1. drove vehicle into shop. placed vehicle securely onto lift and raised. began installing scrap amour skid plate kit. loosely installed skid plate utilizing tape. next drilled new mounting holes for the skid plate and installed mounting hardware. once skid plate kit was installed used the supplied black silicone and sealed skid plate edges.

Parts \$649.95
 MCL570S - SKID PLATE 570S 1 - \$649.95

Additional Fees Sale Amount
 SS - Shop Supplies \$30.00





5758 W Fillmore Street Chicago IL US 60644 www.mclarenchicago.com
 +1(312) 635 - 6482
 general@mclarenchicago.com

Customer Pay Invoice
\$10,215.63

RO# : 6003909 | Tag# : 245
 Check-in: Thu Nov 9, 2023 | 10:43 AM

Customer	Billing-Customer	Vehicle	Service Advisor
	Same as Customer	2018 McLaren 570S- Black SBM13FAA1JW003968	Chris Swist

Labor	\$4,107.50
Parts	\$5,510.26
Sublet Labor	\$0.00
Sublet Parts	\$0.00
Fees	\$30.00
Discounts	\$0.00
Tax	\$567.87
Deductible	\$0.00
Insurance/Warranty	\$0.00
Invoice Total	\$10,215.63

Original Estimate
 Thu Nov 9, 2023 | 10:43 AM \$8,719.60

Original Estimate (Parts & Labor)	Total Additional Cost Authorized	Approved By	Date & Time	Authorization Obtained By
--------------------------------------	-------------------------------------	-------------	-------------	---------------------------

\$ \$

- Telephone
- Text
- Fax (See Attached)
- E-mail (See Attached)

Revised Estimate \$ \$

- Telephone
- Text
- Fax (See Attached)
- E-mail (See Attached)

SA Notes

Chris Swist approved recommendations on behalf of Steve Lieber.





5758 W Fillmore Street Chicago IL US 60644 www.mclarenchicago.com
+1(312) 635 - 6482
general@mclarenchicago.com

Customer Pay Invoice
\$10,215.63

RO# : 6003909 | Tag# : 245
Check-in: Thu Nov 9, 2023 | 10:43 AM

Customer

Steve Lieber
(314) 422 - 7708

Billing-Customer

Same as Customer

Vehicle

2018 McLaren 570S-
Black
SBM13FAA1JW003968

Service Advisor

Chris Swist

Mode Of Communication

Call

Previous Estimate

\$7,812.76

Revised Estimate

\$9,864.94

Date and Time

Wed Nov 15, 2023 at 08:35 AM

Note

client left voice mail - 11/14/2023 - 5:44pm - approval for front lower floor and scrape armour

X
Customer Signature

Date

STRICTLY CASH UNLESS ARRANGEMENTS ARE MADE. * hereby authorize the repair work hereinafter to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in the vehicle in case of fire, theft, or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you or your employees permission to operate the vehicle herein described on streets, highways, or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.*

Any warranties on the products sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

