

V-12 Motorsports of Indian Trail, Inc.

301 Unionville-Indian Trail Rd
 Indian Trail, NC 28079
 Phone 704-821-7757 - Fax 704-821-7062


12/20/2024

**** R.O. Preview of Estimate #30739 ****


Page 1 of 2

Customer:
 Address:

 Home Phone:
 Work Phone:
 Cellular Phone:
 Email:
 Service Writer: AR

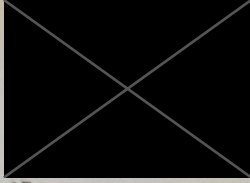

Vehicle: 2000 Jaguar Vanden Plas -
 License: KBM-6324
 Current Mileage: 125325
 V.I.N.: SAJDA24C7YLF1
 Engine: 4.0L V8 (C)
 Prod. Date: 07/00
 Color: GREEN
 Next Service: 5/17/2025, Mileage

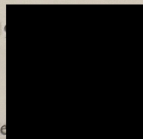

LABOR COMPLETED

TITLE	HOURS BILLED	TECH.	TOTAL \$
BONNET C/S THE RIGHT SIDE LATCH IS STUCK AND CANNOT FULLY OPEN THE BONNET. GAINED ACCESS TO FENDER WELL. FOUND RIGHT HAND LATCH FAILED CAUSING THE CABLE TO BREAK. INSTALL US (NOT AVAILABLE), INSTALL NEW CABLE ASSEMBLY AND RELEASE LEVER.	1.50	JC	17.50
DRIVER SEAT MOTION C/S IT REGULARLY TRIPS THE FUSE IN THE DRIVER SIDE REAR HEEL BOARD; REPLACE FUSE AND IT WORKS FOR ABOUT A DAY THEN DOES IT AGAIN. ALSO STATES THE HEIGHT AND TILT ADJUSTMENTS ARE INOP. FOUND SEAT SWITCH PLUG GROUNDING OUT ON SEAT FRAME DUE TO BROKEN SEAT BOTTOM CUSHION RETAINER TABS. ADDED INSULATION AND SECURED COMPONENTS. CONFIRMED ALL SEAT FUNCTIONS ARE OPERATIONAL. ADVISED CUSTOMER THAT IF THE PROBLEM RETURNS IN THE FUTURE TO HAVE THE SEAT BOTTOM CUSHION REPAIRED BY AN UPHOLSTERY SHOP.	1.50	JC	27.50
LOW COOLANT PRESSURE TEST COOLING SYSTEM AND FOUND REAR DISTRIBUTION HOSE LEAKING. REPLACE AS NEEDED. FILL AND BLEED COOLING SYSTEM; ROAD TEST AS NEEDED.	5.50	JC	79.50
RIGHT REAR DOOR LOCK C/S DOES NOT LOCK AND UNLOCK WITH THE OTHER DOORS. CONFIRMED FAILURE OF LOCK ACTUATOR / CUSTOMER DECLINED REPLACEMENT.	0.00	JC	0.00

PARTS ISSUED

QTY.	PART #	DESCRIPTION	TECH.	EACH \$	TOTAL \$
1	HNC2561AC	RELEASE LEVER		41.46	41.46
1	MNC6733AE	HEATER HOSE ASSEMBLY		286.02	286.02
1	HNC2541AD	BONNET CABLE SET		286.80	286.80

*** Continued on Next Page ***

Recommendations: REAR MAIN SEAL (\$1500) / LOWER OIL PAN GASKET (\$380) / TIMING COVER GASKET (\$1150) / OIL PRESSURE SENDER (\$120)

ALL SPECIAL ORDERS MUST BE PREPAID. NO RETURNS ON SPECIAL ORDER PARTS. ALL RETURNS ARE SUBJECT TO 25% RESTOCKING FEE. NO WARRANTY ON ALIGNMENTS.

Payment Type: _____
 Amount \$: _____
 Date: _____
 Employee: _____

TOTAL Labor	1232.50
TOTAL Parts	777.27
TOTAL Fluids	49.90
TOTAL Shop Supplies	45.00
TOTAL Hazardous Waste	3.74
TOTAL S&H	16.99
SUBTOTAL	2125.40
TAX	142.07
** TOTAL **	\$2,267.47

SIGNATURE ACKNOWLEDGES RECEIPT OF VEHICLE: X _____

LABOR & NEW PARTS WARRANTIED 12 MONTHS/12000 MILES. USED PARTS 30 DAYS
 jagnaround@gmail.com - www.V-12motorsports.com

V-12 Motorsports of Indian Trail, Inc.


301 Unionville-Indian Trail Rd
 Indian Trail, NC 28079
 Phone 704-821-7757 - Fax 704-821-7062

5/4/2023


**** R.O. Preview of Estimate #29179 ****

Customer:
 Address:

 Home Phone:
 Work Phone:
 Cellular Phone:
 Email:
 Service Writer: AR

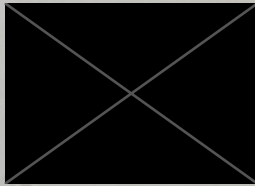

Vehicle: 2000 Jaguar Vanden Plas -
 License: KBM-6324
 Current Mileage: 121039
 V.I.N.: SAJDA24C7YLF19771
 Engine: 4.0L V8 (C)
 Prod. Date: 07/00
 Color: GREEN
 Next Service: 6/29/2023, Mileage: 124

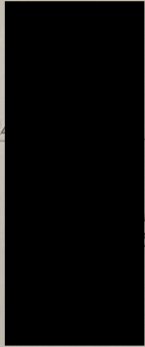

LABOR COMPLETED

TITLE	HOURS BILLED	TECH.	PLS
WARNING MESSAGES / GEARBOX FAULT C/S ABOUT TWO MONTHS AGO, HE BEGAN RECEIVING MESSAGES FOR ABS & TRAC UNAVAILABLE AND FAIL SAFE MODE. HE PULLED CODE P1121 FOR THE THROTTLE POSITION SENSOR. CUSTOMER REMOVED THE AIR INTAKE HOSE AND CLEANED THE BUTTERFLY VALVE AND SENSOR CONNECTIONS. THE CAR THEN RAN WELL FOR A COUPLE OF WEEKS. THE CAR THEN RANDOMLY LIT UP LIKE A CHRISTMAS TREE WITH ALL OF THE SAME ABOVE WARNINGS, BUT THIS TIME ALSO DISPLAYED A GEARBOX FAULT. TRIED TO LIMP IT HOME, BUT HAD TO HAVE IT TOWED OUT. PERFORM DIAGNOSTIC INSPECTION OF COMPUTER SYSTEM AND FOUND STORED FAULTS P1632 AND P1121 / CONFIRMED FAILURE OF THROTTLE POSITION SENSOR. REPLACE THROTTLE BODY WITH REMAN UNIT AND RELEARN TO CAR. CLEAR FAULTS AND ROAD TEST VEHICLE.	3.00	CG	5.00
BURNING SMELL FROM ENGINE CUSTOMER IS NOTICING A BURNING SMELL WHEN DRIVING AGGRESSIVELY AND SEEING SMOKE RISE FROM THE REAR OF THE ENGINE NEAR THE FIREWALL. FOUND OIL LEAKS AT REAR MAIN SEAL, LOWER OIL PAN GASKET, OIL PRESSURE SENDER AND FRONT TIMING COVER GASKET. CUSTOMER DECLINED REPAIR.	0.00	CG	0.00
DRIVER SEAT CONTROL / STEERING WHEEL C/S SEAT MOVES ACCORDING TO THE PRESETS BUT WILL NOT ADJUST MANUALLY WITH THE SEAT CONTROL SWITCH / SAME THING WITH THE STEERING WHEEL. VERIFIED PRIOR REPAIRS TO WIRING AND MODULE, CONFIRMED CABLES ARE INTACT. TRACE POWER LOSS TO BLOWN FUSE.	0.50	CG	62.50

Recommendations: REAR MAIN SEAL (\$1500) / LOWER OIL PAN GASKET (\$380) / TIMING COVER GASKET (\$1150) / OIL PRESSURE SENDER (\$120)

ALL SPECIAL ORDERS MUST BE PREPAID. NO RETURNS ON SPECIAL ORDER PARTS. ALL RETURNS ARE SUBJECT TO 25% RESTOCKING FEE. NO WARRANTY ON ALIGNMENTS.	Payment Type: _____ Amount \$: _____ Date: _____ Employee _____	TOTAL Labor -562.50 TOTAL Parts 1018.55 TOTAL Shop Supplies 25.00 TOTAL S&H 19.49 SUBTOTAL 500.54 TAX 99.97 ** TOTAL ** 600.51
--	--	---

SIGNATURE ACKNOWLEDGES RECEIPT OF VEHICLE: X _____

LABOR & NEW PARTS WARRANTIED 12 MONTHS/12000 MILES. USED PARTS 30 DAYS
 jagnaround@gmail.com - www.V-12motorsports.com

Inv#: 00000004
15:12:16
Appr Code: 888637
Total: USD*

V-12 Motorsports of Indian Trail, Inc.

301 Unionville-Indian Trail Rd
Indian Trail, NC 28079
Phone 704-821-7757 - Fax 704-821-7062


5/4/2023

**** R.O. Preview of Estimate #29179 ****

Page 2 of 1

Customer:
Address:

Home Phone:
Work Phone:
Cellular Phone
Email:
Service Writer:

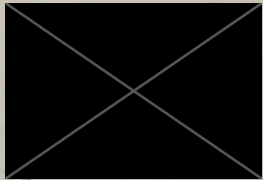

Vehicle: 2000 Jaguar Vanden Plas -
License: KBM-6324
Current Mileage: 121039
V.I.N.: SAJDA24C7
Engine: 4.0L V8 (C)
Prod. Date: 07/00
Color: GREEN
Next Service: 6/29/2023, M



DEPOSIT 1.00 -1000.00
RECEIVED FOR SPECIAL ORDER THROTTLE BODY

PARTS ISSUED			H \$ TOTAL \$	
QTY.	PART #	DESCRIPTION		
1	C2A1444R	THROTTLE BODY	5.95	995.95
1	NNE3021AC	THROTTLE BODY GASKET	2.60	22.60

MISC. SHOP SUPPLIES USED

TITLE	TOTAL \$
SHOP SUPPLIES	25.00

LABOR & NEW PARTS WARRANTIED 12 MONTHS/12000 MILES. USED PARTS 30 DAYS
jagnaround@gmail.com - www.V-12motorsports.com

V-12 Motorsports of Indian Trail, Inc.

301 Unionville-Indian Trail Rd
Indian Trail, NC 28079
Phone 704-821-7757 - Fax 704-821-7062


Page 2 of 2

12/20/2024

**** R.O. Preview of Estimate #30739 ****

Customer:
Address:

Home Phone:
Work Phone:
Cellular Phone
Email:
Service Writer: AR

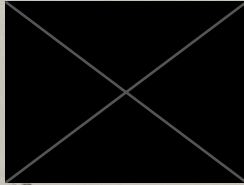

Vehicle: 2000 Jaguar Vanden Plas -
License: KBM-6324
Current Mileage: 125325
V.I.N.: SAJDA24C7YLF19771
Engine: 4.0L V8 (C)
Prod. Date: 07/00
Color: GREEN
Next Service: 5/17/2025, Mileage

1	HNC2400AC/U	USED HOOD LATCH		50.00
1	NNE3944BAJAG	HEATER HOSE JUNCTION		12.99
FLUIDS ADDED				
QTY.	FLUIDS		TECH	TAL \$
2.00	ANTIFREEZE			49.90
MISC. SHOP SUPPLIES USED				
TITLE				TAL \$
SHOP SUPPLIES 4				45.00

LABOR & NEW PARTS WARRANTIED 12 MONTHS/12000 MILES. USED PARTS 30 DAYS
jagnaround@gmail.com - www.V-12motorsports.com


06/30/22 OnLine Print Read
 Invt: 00000004 Batch#: 0000002
 Total: USD\$ 15:12:16
 Appr Code: 888827
 I agree to be according to card (Merchant agreement if ca
 X
 Custor

V-12 Motorsports of Indian Trail, Inc.
 301 Unionville-Indian Trail Rd
 Indian Trail, NC 28079
 Phone 704-821-7757 - Fax 704-821-7062

**** R.O. Preview of Estimate #28280 ****

6/30/2022

Customer:
 Address:

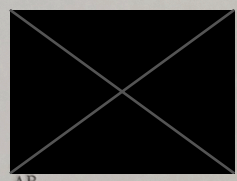

Home Phone:
 Work Phone:
 Cellular Phone
 Email:
 Service Writer: AR

Vehicle: 2000 Jaguar Vanden Plas -
 License: NONE
 Current Mileage: 119215
 V.I.N.: SAJDA [REDACTED]
 Engine: 4.0L V8
 Prod. Date: 07/00
 Color: GREEN
 Next Service: 11/29/2022 24215

LABOR COMPLETED

TITLE	HOURS BILLED		TOTAL \$
SEAT ADJUSTMENT C/S SEATS NOT OPERATING CORRECTLY FOR FORWARD AND BACK, DRIVERS SEAT MAINLY. VERIFIED OPERATION OF MOTORS AND REMOVED SEATS FOR INSPECTION. REPAIRED DRIVER SEAT MODULE, WHICH FELL AND BOUND SEAT MOTION. REPAIR FORWARD CABLE, FURTHER TRACE WIRING ISSUE AND REPAIR WIRING HARNESS. REMOVE PASSENGER SEAT AND REPAIR TWO CABLES.	5.00	[REDACTED]	575.00
PASSENGER HEAD REST C/S PASSENGER HEAD REST ADJUSTMENT SEEMS TO NOT WORK. COULD NOT DUPLICATE CONCERN. HEAD REST IS OPERATING NORMALLY AT THIS TIME.	0.00	JC	0.00
TRANSMISSION SERVICE DRAIN AND REFILL WITH SYNTHETIC FLUID.	1.00	JC	115.00
CHECK TIMING CHAINS R&R VALVE COVERS FOR INSPECTION. FOUND TIMING CHAIN UPDATE HAS BEEN PERFORMED. INSTALL NEW VALVE COVER GASKETS AND REPLACE SPARK PLUGS.	6.00	JC	690.00
CHECK BRAKES C/S FEELS SOFT. REPLACE FRONT AND REAR BRAKE PADS AND ROTORS. RENEW FRONT BRAKE FLEX LINES AND BRAKE CALIPERS. FLUSH AND BLEED SYSTEM.	6.00	JC	690.00
ROUGH RUNNING C/S CAR IS RUNNING ROUGHER THAN WHEN HE FIRST OWNED IT. REPLACED	2.80	JC	322.00

ALL SPECIAL ORDERS MUST BE PREPAID. NO RETURNS ON SPECIAL ORDER PARTS. ALL RETURNS ARE SUBJECT TO 25% RESTOCKING FEE. NO WARRANTY ON ALIGNMENTS.

Payment Type: _____
 Amount \$: _____
 Date: _____
 Employee: _____

TOTAL Labor	387.00
TOTAL Parts	3672.22
TOTAL Sublet Labor	349.99
TOTAL Fluids	208.88
TOTAL Shop Supplies	80.00
TOTAL Hazardous Waste	15.67
TOTAL S&H	55.96
SUBTOTAL	4769.72
TAX	553.37
** TOTAL **	\$5,323.09

SIGNATURE ACKNOWLEDGES RECEIPT OF VEHICLE: X _____

8,8327.09
 spent

LABOR & NEW PARTS WARRANTIED 12 MONTHS/12000 MILES. USED PARTS 30 DAYS
 jagnaround@gmail.com - www.V-12motorsports.com


V-12 Motorsports of Indian Trail, Inc.

301 Unionville-Indian Trail Rd
 Indian Trail, NC 28079
 Phone 704-821-7757 - Fax 704-821-7062

6/30/2022

**** R.O. Preview of Estimate #28280 ****

Customer:
 Address:
 Home Phone:
 Work Phone:
 Cellular Phone
 Email:
 Service Writer: AR

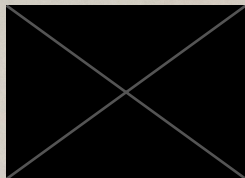

Vehicle: 2000 Jaguar Vanden Plas -
 License: NONE
 Current Mileage: 119215
 V.I.N.: SAJDA24C7YLF19771
 Engine: 4.0L V8 (C)
 Prod. Date: 07/00
 Color: GREEN
 Next Service: 11/29/2022, Mileage

FUEL FILTER AND AIR FILTER. AFTER ROAD TEST, CHECK ENGINE LIGHT AND RESTRICTED PERFORMANCE MESSAGES ARE ON. TRACE FAILED KNOCK SENSORS AND REPLACE WITH NEW. CLEAR FAULTS AND ROAD TEST VEHICLE.	0.00	J	0.00
FLOOR MATS			
FLOOR MATS ARE DISCONTINUED AND OBSOLETE / COULD NOT SOURCE.			
DRIVERS DOOR HANDLE LOOSE	1.50	J	172.50
REMOVE DOOR PANEL AND SECURE DRIVER FRONT OUTER DOOR HANDLE.			
SYNTHETIC OIL SERVICE	0.00	J	0.00
CHANGE ENGINE OIL AND FILTER. SET TIRE PRESSURE AND TOP UP ALL FLUIDS.			
COOLANT LEAK	3.00	J	345.00
REPLACE THERMOSTAT HOUSING WITH UPRATED ALUMINUM PART / INSTALL NEW THERMOSTAT, BYPASS HOSE AND DISTRIBUTION PIPE.			
ABS LIGHT	2.00	JC	230.00
STORED FAULT C1095 FOR HYDRAULIC PUMP MOTOR. TRACE FAILED ABS CONTROL MODULE. R&R FOR REBUILD.			
REARVIEW MIRROR	1.00	JC	115.00
INSTALL NEW INTERIOR REARVIEW MIRROR			
FRONT SUSPENSION	5.50	JC	632.50
REPLACE FRONT SHOCKS AND UPPER MOUNTS / REPLACE SWAY BAR BUSHINGS AND END LINKS.			
DEPOSIT	1.00	AR	-3500.00

PARTS ISSUED

QTY.	PART #	DESCRIPTION	TECH.	EACH	\$ TOTAL \$
1	AJ88400	CAM COVER GASKET		62.15	62.15
8	AJ87206	SPARK PLUG SEAL		6.99	55.92
1	AJ88285	CAM COVER GASKET		62.15	62.15
2	AJ82856	VVT SEAL		19.99	39.98
8	7866	SPARK PLUG		19.99	159.92
2	C2C41249	BRAKE DISC		139.99	279.98
2	C2C41251	BRAKE ROTOR		104.99	209.98
1	EUR394A	FRONT BRAKE PADS		139.99	139.99
1	EUR688A	BRAKE PAD SET		99.99	99.99
2	24023740	SHOCK ABSORBER		199.99	399.98
1	MNC2169AF	SHOCK MOUNT		124.99	124.99
1	MNC2168AF	SHOCK MOUNT		124.99	124.99
2	270074882	SWAY BAR LINK		54.99	109.98
1	NJA3558AA	AIR FILTER		29.99	29.99
1	C2C35417	FUEL FILTER		29.99	29.99
1	AJ82217KIT	THERMOSTAT HOUSING		169.99	169.99

LABOR & NEW PARTS WARRANTIED 12 MONTHS/12000 MILES, USED PARTS 30 DAYS
 jagnaround@gmail.com - www.V-12motorsports.com

V-12 Motorsports of Indian Trail, Inc.


301 Unionville-Indian Trail Rd
 Indian Trail, NC 28079
 Phone 704-821-7757 - Fax 704-821-7062

6/30/2022

**** R.O. Preview of Estimate #28280 ****

Page 3 of 3

Customer:
 Address:

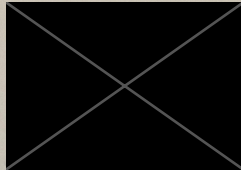

Home Phone:
 Work Phone:
 Cellular Phone
 Email:
 Service Writer: AR

Vehicle: 2000 Jaguar Vanden Plas -
 License: NONE
 Current Mileage: 119215
 V.I.N.: SAJDA24C7YLF19
 Engine: 4.0L V8 (C)
 Prod. Date: 07/00
 Color: GREEN
 Next Service: 11/29/2022, Mileage

1	NCA2213AC	BYPASS HOSE		9.99
1	AJ85885	WATER DISTRIBUTION PIPE		77.26
2	MNC2102AH	SWAY BAR BUSHING		29.98
2	MNC5670AC	BRAKE HOSE		123.15
1	HJD3134AC	INTERIOR MIRROR		674.48
1	140500427	BRAKE CALIPER		124.99
1	140500433	BRAKE CALIPER		124.99
2	LNE1692AA	KNOCK SENSOR		317.42
1	OIL SERVICE	CHANGE OIL & FILTER		89.99 89.99

SUBLET LABOR CHARGED

TOTAL \$
 349.99

TITLE

MODULE REPAIR

REPAIRED / REPLACED DAMAGED COMPONENTS TO SENSOR INPUT AMPLIFIER
 AND PUMP POWER CONTROL CIRCUIT

FLUIDS ADDED

QTY.	FLUIDS	TECH. EACH \$	TOTAL \$
2.00	ANTIFREEZE	24.95	49.90
1.00	BG SYNTHETIC BRAKE FLUID	18.99	18.99
1.00	BG TRANS FLUID (SYNTHETIC)	139.99	139.99

MISC. SHOP SUPPLIES USED

TOTAL \$
 80.00

TITLE

SHOP SUPPLIES

LABOR & NEW PARTS WARRANTIED 12 MONTHS/12000 MILES. USED PARTS 30 DAYS
 jagnaround@gmail.com - www.V-12motorsports.com