

REPAIR ORDER

LUBO'S BAVARIAN MOTORS

3450 ELVAS AVENUE

SACRAMENTO, CA 95819

TEL. 916-451-5826 OR 451-LUBO

BAR#AB 108018 CAL#000176262

ORIGINALLY TRAINED & CERTIFIED BY BMW FACTORY

R/O # : 27475

Name : 

Date : 06/30/22

License # : 2MOK235

Make : BMW

Model : M5/E28

Year : 1988

Mileage : 134949

Save Parts : NO

Unit # : 2875263

VIN : WBSDC9300J2875263

LABOR

AMOUNT

VEHICLE WAS TOWED TO SHOP. RUNS ROUGH. INSPECT AND REPORT.

180.00

INJECTORS 4 AND 5 BAD AS PER OTHER SHOP.

WE FOUND PROBLEM WITH IGNITION WIRES AND NUMBER 6 FUEL INJECTOR.

BEST IS TO DO CARBON CLEANING, REPLACE IGNITION WIRE SET, PULL OUT

NUMBER 6 FUEL INJECTOR AND CLEAN IT BEST AS POSSIBLE.

REPLACE LEFT BRAKE LIGHT AND TAIL LIGHT BULB SOCKETS AND BULBS.

180.00

CLEAN CORROSION OFF CONTACTS FOR BULB SOCKETS. CLEAN CONTACT

STRIPS, BULBS AND SOCKETS FOR MOST EXTERIOR LIGHTS.

SUNROOF IS NOT WORKING. REMOVED ACCESS COVER AND MANUALLY TILTED

216.00

UP SUNROOF. LUBRICATED MECHANISM FOR SUNROOF TILT. SUNROOF NOW OPENS

ELECTRICALLY AND LUBRICATED GUIDE RAILS FOR SUNROOF.

REAR WINDOWS NOT WORKING, CHECK AND REPORT. FOUND CHECK DRIVE

45.00

MOTORS FOR REAR WINDOWS, THE MOTORS ARE SEIZED AND NEED TO BE

REPLACED. ORDER MOTORS FROM GERMANY, WILL TAKE TIME TO GET THEM.

REPLACE IGNITION WIRE SET.

180.00

REPLACE LEFT REAR WINDOW MOTOR AND LUBRICATE REGULATOR AS NEEDED.

360.00

REPLACE RIGHT REAR WINDOW MOTOR AND LUBRICATE REGULATOR AS

450.00

NEEDED.

NOTE: EXTRA TIME TO RE-GLUE METAL BRACKET TO GLASS.

CARBON CLEAN ENGINE WITH CARBON CLEANING MACHINE, USE SPECIAL

360.00

CARBON CLEANING SOLUTION.

REPLACE RIGHT REAR SHOCK/LEVELLING DEVICE AND RE-FILL REAR

324.00

SUSPENSION RESERVOIR.

CHECK ENGINE COMPRESSION AND REPLACE SPARK PLUGS AFTER CARBON

180.00

CLEANING.

ENGINE COMPRESSION TEST:

1 cyl. 180

2 cyl. 185

3 cyl. 180

4 cyl. 175

5 cyl. 180

6 cyl. 185

REPAIR ORDER

LUBO'S BAVARIAN MOTORS

3450 ELVAS AVENUE

SACRAMENTO, CA 95819

TEL. 916-451-5826 OR 451-LUBO

BAR#AB 108018 CAL#000176262

ORIGINALLY TRAINED & CERTIFIED BY BMW FACTORY

R/O # : 27475

Page : 2

Date : 06/30/22

License # : 2MOK235

Make : BMW

Model : M5/E28

Year : 1988

Mileage : 134949

Save Parts : NO

Unit # : 2875263

VIN : WBSDC9300J2875263

REMOVE FUEL INJECTOR ON NUMBER 6 CYLINDER AND CLEAN BEST AS POSSIBLE, THE SCREEN WAS TOTALY PLUGED UP.

198.00

NOTE: IF SAME PROBLEM OCCURS, BEST IS TO PULL OUT ALL OTHER INJECTORS AND CLEAN THEM BEST AS POSSIBLE.

FUEL IN THE GAS TANK IS VERY OLD. DRAIN GAS TANK AND INSTALL NEW GAS.

45.00

FUEL FILTER IS INSTALLED WRONG WAY, REMOVE FUEL FILTER AND REPLACE WITH NEW ONE.

180.00

PARTS ALL LISTED PARTS ARE NEW UNLESS OTHERWISE STATED.

		PRICE	QTY	AMOUNT
63211369306	LIGHT BULB SOCKET	24.72	1	24.72
63211369270	SOCKET FOR REAR LIGHT BULB E28	13.00	1	13.00
63217160790	LIGHT BULB LONG LIFE 12V 21W 7506L	4.58	2	9.16
12121307171	IGNITION WIRE SET	729.60	1	729.60
51351375397	ELECTRIC DRIVE LEFT (WINDOW MOTOR)	459.90	1	459.90
51351375398	ELECTRIC DRIVE RIGHT (WINDOW MOTOR)	459.90	1	459.90
GX 301	CARBON CLEAN SOLUTION 354ML	20.00	1	20.00
37121126754	SHOCK ABSORBER/LEVELLING DEVICE	361.31	1	361.31
12129061882	SPARK PLUG BOSCH X5DC	19.99	6	119.94
51411870718	PLASTIC CLIP FOR INSIDE DOOR PANEL	1.60	1	1.60
13321268231	FUEL FILTER KL9	65.29	1	65.29
81221468879	PENTOSIN CHF-7.1/HYDRAULIC SYSTEM FLUID (1L)	32.95	1	32.95
07509063573	BULB 12V-5W/OSHRAM #5007	3.90	2	7.80

RECOMMENDATIONS AND TECHNICIANS NOTES

NOTES: REPLACE TIRES IMMEDIATELY, REAR SUSPENSION PITMAN ARMS WORN OUT, STEAM CLEAN VEHICLE TO REMOVE COBWEBS AND DEBRIS, A/C COMPRESSOR LEAKING IN FRONT AREA NEED TO REPLACE A/C COMPRESSOR AND RECEIVER/DRIER THEN CONVERT SYSTEM TO R134 GAS, OUTSIDE MIRRORS ARE NOT WORKING (LEFT HAS DAMAGED MOTOR, RIGHT WILL NOT ADJUST IN MAY ALSO NEED SWITCH.

Original Estimate : 180.00

Increases to Estimate					
Date	Time	OK'd By	Phone	Emp.	New Total
05/26/22	9:54AM	TOM	599-2811	RT	4,518.81
06/29/22	1:32PM	TOM	916-599-2811	LJ	5,437.37

LABOR	2,898.00
PARTS	2,305.17
SUBLETS	0.00
CHEVRON GAS	0.00
HAZARDOUS MATERIALS	0.50
SUB TOTAL	5,203.67
TAX	201.70
TOTAL	\$ 5,405.37

I hereby authorize the above named business to perform the repair work listed above along with necessary materials. You and your employees may operate the above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs. Thereto it is understood that this company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for storage, sale, repair, or while road testing. I acknowledge notice and oral approval of an increase in the original estimated price.

Authorized by : _____ Date : _____

REPAIR ORDER

LUBO'S BAVARIAN MOTORS

3450 ELVAS AVENUE

SACRAMENTO, CA 95819

TEL. 916-451-5826 OR 451-LUBO

BAR#AB 108018 CAL#000176262

ORIGINALLY TRAINED & CERTIFIED BY BMW FACTORY

R/O # : 29819

Date : 05/06/25

License # : 2MOK235

Make : BMW

Model : M5/E28

Year : 1988

Mileage : 134997

Save Parts : NO

Unit # : 2875263

VIN : WBSDC9300J2875263

LABOR

AMOUNT

VEHICLE TOWED IN FOR POWER STEERING FLUID LEAK. CHECK AND REPORT NEEDS TO CUSTOMER.

180.00

-RECOMMEND REPLACING 3 RETURN HOSES TO RESERVOIR: 1 FROM THE BRAKE BOOSTER, 1 FROM THE POWER STEERING COOLER, AND 1 FROM THE DS REGULATOR VALVE

REPLACE POWER STEERING RETURN HOSES FROM RESERVOIR TO BRAKE HYDRAULIC BOOSTER, DS REGULATOR VALVE AND P/S COOLER. CHECK CONDITION OF RESERVOIR. INSTALL NEW HOSE CLAMPS AND O-RINGS. INSTALL NEW P/S FLUID. CLEAN AREA AS BEST AS POSSIBLE. OIL WILL CONTINUE TO SEEP FROM FRAME RAIL.

360.00

REPLACE ALL BELTS: ALTERNATOR BELT, AIR CONDITIONING COMPRESSOR BELT, POWER STEERING BELT. ADJUST ALL BELTS TO PROPER TIGHTNESS.

180.00

A/C SYSTEM WAS CONVERTED TO R134 FROM R12. CHECK TO SEE IF A/C BLOWS COLD.

0.00

-CONFIRMED A/C SYSTEM BLOWING COLD AT THIS TIME.

PARTS	ALL LISTED PARTS ARE NEW UNLESS OTHERWISE STATED.	PRICE	QTY	AMOUNT
031526	ATF DEXRON III 1 QT.	12.95	1	12.95
ABA	HOSE CLAMP	3.95	6	23.70
34321119074	HOSE 8 X 14MM	31.14	1	31.14
34321119071	HOSE 6 X 12MM	37.07	1	37.07
32411131524	POWER STEERING HOSE RETURN 12 X 18MM	60.61	1	60.61
11221469245	ALTERNATOR V-BELT 13 X 1040	21.50	1	21.50
64521469249	V-BELT 13 X 800	18.73	1	18.73
32421469248	V-BELT 10 X 888	20.18	1	20.18

RECOMMENDATIONS AND TECHNICIANS NOTES

-HAIRLINE CRACK IN ENGINE OIL PAN. SEEPING VERY SLOWLY. NEW BMW OIL PAN AVAILABLE FROM GERMANY

PARTS: \$2755.02

LABOR: \$720

TOTAL W/ TAX: \$3716.08

REPAIR ORDER

LUBO'S BAVARIAN MOTORS

3450 ELVAS AVENUE

SACRAMENTO, CA 95819

TEL. 916-451-5826 OR 451-LUBO

BAR#AB 108018 CAL#000176262

ORIGINALLY TRAINED & CERTIFIED BY BMW FACTORY

R/O # : 29819

Page : 2

Date : 05/06/25

License # : 2MOK235

Make : BMW

Model : M5/E28

Year : 1988

Mileage : 134997

Save Parts : NO

Unit # : 2875263

VIN : WBSDC9300J2875263



Original Estimate : 0.00

Increases to Estimate					
Date	Time	OK'd By	Phone	Emp.	New Total
04/29/25	3:19PM	TOM	CELL	ADRI	965.94

LABOR	720.00
PARTS	225.88
SUBLETS	0.00
CHEVRON GAS	0.00
HAZARDOUS MATERIALS	0.30
SUB TOTAL	946.18
TAX	19.76
TOTAL	\$ 965.94

I hereby authorize the above named business to perform the repair work listed above along with necessary materials. You and your employees may operate the above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs. Thereto it is understood that this company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for storage, sale, repair, or while road testing. I acknowledge notice and oral approval of an increase in the original estimated price.

Authorized by : _____ Date : _____

Phaedrus Independent BMW, Inc.

Service Invoice: 87111

Name		
Addr.		
Phone	7	
B- Name		
B- Addr.		
B-Phone		
Prod Date	11/87 E28/S38/5SPD	
V.I.N. #	2875263	

Invt. Date	05/11/22	Year	1988
S.O. Date	04/30/22	Make	BMW
QC'd by	7	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	134946
		Lic #	2MOK235

Service Description

PREP TO RUN- VEHICLE CHECK
 REPLACE BATTERY. TEST COMPRESSION COLD- ALL CYLINDERS
 150-175 PSI. RUNNING ON 4/5 CYLINDERS, FUEL PRESSURE TOO
 HIGH. REPLACE FUEL PRESS REGULATOR- NEEDS CYL #4, 5 FUEL
 INJECTORS, IGNITION WIRES. SEE REC LIST FOR DETAILS.

Hrs. Lab\$

3.00 570.00

Qty	Part Number	Part Description	Price
1	13-53-1-711-541	FUEL PRESSURE REGULATOR	306.32
1	61-21-2-353-808	BATTERY 80AH 640CCA	229.28
1	FEE	BATTERY RECYCLING	3.00

Additional Items	Sublet or Add'l Services
Total Items	Total Sublets
	0.00

Notes	Totals
	Labor 570.00 Parts 538.60 Supplies 0.00 Sublets 0.00 Addl. Items 0.00 Subtotal 1108.60 Tax 45.53 Total 1154.13
Next service due on: ???	

(Page 1 of 1)

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service invoice: 87111

Service invoice: 87111

Inv. Date	05/11/22	Year	1988
S.O. Date	04/30/22	Make	BMW
QC'd by	7	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	134946
		Lic.#	2MOK235

Qty	Part Number	Part Description	Price
1	13-53-1-711-541	FUEL PRESSURE REGULATOR	306.32
1	61-21-2-353-808	BATTERY 80AH 640CCA	229.28
1	FEE	BATTERY RECYCLING	3.00

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1541 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 1480

Inv. Date	07/02/99	Year	1988
S.O. Date	07/02/99	Make	BMW
QC'd by	10	Model	M5
Salesman	SC	Color	SCHWARZ
Division	DS	Miles	116812
		Lic.#	ZMOK235

[illegible]

THE DETAIL SHOP IS OPEN TUESDAY THROUGH SATURDAY,
9:30 A.M. - 5:30 P.M. CALL (415) 567-8000 TO MAKE
YOUR NEXT APPOINTMENT.

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 1480

His Job

EXTERIOR DETAIL
SOLVENT WASH, CLAY POLISH AND WAX

1000 JOURNAL OF CLIMATE

 $\angle$

1000

11/87 E28/S38/5SPD

2875263

Year 1988

Make BMW

Model

Color

Miles

Lic.#

THE

Qty	Item Number	Part Description	Price
-----	-------------	------------------	-------

Additional Items

Sublet or Add'l Services

COMPLETE DETAIL
WASH & WAX
EXTERIOR
INTERIOR
WASH

Total Items

Total Sublets

00.0

Notes

Totals

Labor	300.00
-------	--------

0.00
Parts

Supplies	0.00
----------	------

Sublets 0.00

Addl. Items	0.00
-------------	------

Subtotal	300.00
----------	--------

Tax	0.00
-----	------

Total 300 00

Next service due on: ????

Tax 0.00

Total 300.00

(Page 1 of 1)

THE DETAIL SHOP IS OPEN TUESDAY THROUGH SATURDAY,
9:30 A.M. - 5:30 P.M. CALL (415) 567-8000 TO MAKE
YOUR NEXT APPOINTMENT.

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 1481

Inv. Date	07/02/99	Year	1988
S.O. Date	07/02/99	Make	BMW
QC'd by	10	Model	M5
Salesman	SC	Color	SCHWARZ
Division	DS	Miles	116812
		Lic #	2MOK235

Qty	Item Number	Part Description	Price

[illegible]

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 1481

Inv. Date	07/02/99	Year	1988
S.O. Date	07/02/99	Make	BMW
QC'd by	10	Model	M5
Salesman	SC	Color	SCHWARZ
Division	DS	Miles	116812
		Lic.#	2MOK235

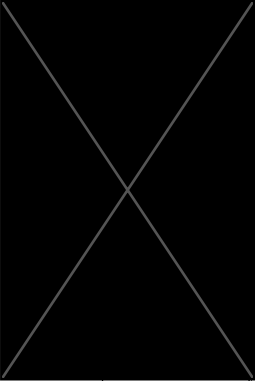
[illegible]

THE DETAIL SHOP IS OPEN TUESDAY THROUGH SATURDAY,
9:30 A.M. - 5:30 P.M. CALL (415) 567-8000 TO MAKE
YOUR NEXT APPOINTMENT.

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 9739

Name Addr:		
Phone		
B- Name B-Addr:		
B- Phone Prod Date V.I.N. #		
		11/87 E28/S38/5SPD 2875263

Inv. Date S.O. Date QC'd by Salesman Division	06/02/01 05/29/01 14 SC SS	Year Make Model Color Miles Lic #	1988 BMW M5 SCHWARZ 120123 2MOK235
---	--	--	---

Service Description	Hrs.	Lab\$
OIL CHANGE	0.25	23.50
BRAKE FLUID FLUSH	0.50	47.00
PRECHECK EMISSIONS, DELIVER FOR TEST	0.25	23.50
R/REAR TIRE SLOW LEAK, DROPS 10 LBS/MONTH- TIRE HAD SIDEWALL BUBBLE(SEPARATING) MOUNT AND BALANCE ONE TIRE	0.25	23.50
WHIFF OF GAS WHEN PULLING AWAY FROM STOP - CHECK FUEL LINES REPL ENG COMPARTMENT FUEL HOSES	1.50	141.00
CK POOR BRAKING-REPL CANNONBALL	1.00	94.00

Qty	Part Number	Part Description	Price
4	HYD FLUID	HYDRAULIC FLUID PINT	19.68
1	13-53-1-726-960	HOSE	7.92
1	WEIGHTS	WHEEL WEIGHTS	2.70
1	VALVE STEMS	VALVE STEMS	1.76
2	RL D4	TRANSMISSION FLUID	4.50
1	235/45/17 P7000	PIRELLI	189.95
6	OW-40 MOBIL 1	KENDALL BULK OIL	13.50
1	12X16	SEAL RING	0.27
1	11-42-9-063-138	OIL FILTER INSERT	4.68
6	16-12-1-180-237	SMALL HOSE CLAMP	8.10
2	13-53-1-469-783	NEW FUEL HOSE	57.34
1	34-33-1-162-054	HYDRO ACCUMULATOR	150.30
1	FEE	OIL RECYCLING	4.00
1	FEE	HYD FLUID RECYCLING	2.00

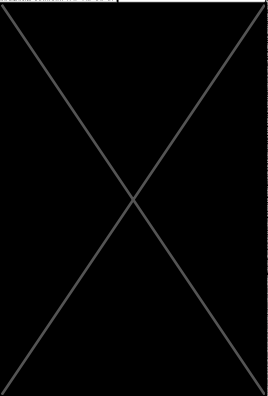
Additional Items	Sublet or Add'l Services																		
	SMOG TEST AND CERTIFICATE																		
Total Items	Total Sublets																		
	47.25																		
<table> <tr> <th colspan="2">Totals</th></tr> <tr> <td>Labor</td><td>352.50</td></tr> <tr> <td>Parts</td><td>466.70</td></tr> <tr> <td>Supplies</td><td>0.00</td></tr> <tr> <td>Sublets</td><td>47.25</td></tr> <tr> <td>Add'l Items</td><td>0.00</td></tr> <tr> <td>Subtotal</td><td>866.45</td></tr> <tr> <td>Tax</td><td>38.01</td></tr> <tr> <td>Total</td><td>904.46</td></tr> </table>		Totals		Labor	352.50	Parts	466.70	Supplies	0.00	Sublets	47.25	Add'l Items	0.00	Subtotal	866.45	Tax	38.01	Total	904.46
Totals																			
Labor	352.50																		
Parts	466.70																		
Supplies	0.00																		
Sublets	47.25																		
Add'l Items	0.00																		
Subtotal	866.45																		
Tax	38.01																		
Total	904.46																		
Next service due on: ???																			

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 9739

Name Addr.		
Phone		
B- Name B-Addr.		
B- Phone Prod Date V.I.N. #		
11/87 E28/S38/5SPD 2875263		

Inv. Date S.O. Date QC'd by Salesman Division	06/02/01 05/29/01 14 SC SS	Year Make Model Color Miles Lic #	1988 BMW M5 SCHWARZ 120123 2MOK235
---	--	--	---

Service Description	Hrs.	Lab\$
OIL CHANGE	0.25	23.50
BRAKE FLUID FLUSH	0.50	47.00
PRECHECK EMISSIONS, DELIVER FOR TEST	0.25	23.50
R/REAR TIRE SLOW LEAK, DROPS 10 LBS/MONTH- TIRE HAD SIDEWALL BUBBLE(SEPARATING) MOUNT AND BALANCE ONE TIRE	0.25	23.50
WHIFF OF GAS WHEN PULLING AWAY FROM STOP - CHECK FUEL LINES	1.50	141.00
REPL ENG COMPARTMENT FUEL HOSES	1.00	94.00
CK POOR BRAKING-REPL CANNONBALL		

Qty	Part Number	Part Description	Price
4	HYD FLUID	HYDRAULIC FLUID PINT	19.68
1	13-53-1-726-960	HOSE	7.92
1	WEIGHTS	WHEEL WEIGHTS	2.70
1	VALVE STEMS	VALVE STEMS	1.76
2	RL D4	TRANSMISSION FLUID	4.50
1	235/45/17 P7000	PIRELLI	189.95
6	OW-40 MOBIL 1	KENDALL BULK OIL	13.50
1	12X16	SEAL RING	0.27
1	11-42-9-063-138	OIL FILTER INSERT	4.68
6	16-12-1-180-237	SMALL HOSE CLAMP	8.10
2	13-53-1-469-783	NEW FUEL HOSE	57.34
1	34-33-1-162-054	HYDRO ACCUMULATOR	150.30
1	FEE	OIL RECYCLING	4.00
1	FEE	HYD FLUID RECYCLING	2.00

Additional Items	Sublet or Add'l Services
	SMOG TEST AND CERTIFICATE
Total Items	Total Sublets
	47.25

Totals	
Labor	352.50
Parts	466.70
Supplies	0.00
Sublets	47.25
Addl. Items	0.00
Subtotal	866.45
Tax	38.01
Total	904.46

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 10338

Inv. Date	08/16/01	Year	1988
S.O. Date	07/20/01	Make	BMW
QC'd by	7	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	120710
		Lic #	2MOK235

Qty	Part Number	Part Description	Price
1	65-81-1-375-461	ILLUM. PLATE *	23.64
1	21-21-2-226-428	CLUTCH KIT	401.40
25	BULB	MISC LIGHT BULB	45.00
1	21-51-1-204-229	FORK LEVER *	9.81
1	21-51-1-202-659	PIN *	0.77
1	11-21-1-468-742	BALL BEARING	5.49
1	11-14-2-245-364	OIL SEAL	18.23
6	07-12-9-964-672	NUT	1.98
6	07-12-9-900-047	12x1.5 LOCKING NUT	3.54
2	18-21-1-105-638	RUBBER RING *	5.58
8	11-22-1-717-840	HEX BOLT	11.20
3	23-71-1-130-250	55CREW M8	6.69
2	63-12-1-468-181	LENS LEFT	43.20

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1541 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 10338

Name		
Addr.		
Phone		
B- Name		
B-Addr.		
B-Phone		
Prod Date	11/87 E28/S38/5SPD	
V.I.N. #	2875263	

Inv. Date	08/16/01	Year	1988
S.O. Date	07/20/01	Make	BMW
QC'd by	7	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	120710
		Lic #	2MOK235

Service Description	Hrs.	Lab\$
EVALUATE CLUTCH/TRANS-NEEDS CLUTCH ASSY-WORN/T BRG NOISY	5.20	148.80
DIFFICULT GEAR ENGAGEMENT REV/1ST/2ND AT LOW SPEEDS		
REPL CLUTCH ASSY, PILOT BRG		
R AND I F/WHEEL TO RESURFACE		
COMPRESSION CK-EXCELLENT-WITHIN 5 PSI	1.00	94.00
REPL INST CLUSTER AND HTR PANEL BULBS, OBC LIGHT BAR	1.50	141.00
INST, DASH, CONTROL		
REPL FOGLIGHT LENSES	0.50	47.00

Qty	Part Number	Part Description	Price
1	65-81-1-375-461	ILLUM. PLATE *	23.64
1	21-21-2-226-428	CLUTCH KIT	401.40
25	BULB	MISC LIGHT BULB	45.00
1	21-51-1-204-229	FORK LEVER *	9.81
1	21-51-1-202-659	PIN	0.77
1	11-21-1-468-742	BALL BEARING	5.49
1	11-14-2-245-364	OIL SEAL	18.23
6	07-12-9-964-672	NUT	1.98
6	07-12-9-900-047	12x1.5 LOCKING NUT	3.54
2	18-21-1-105-638	RUBBER RING *	5.58
8	11-22-1-717-840	HEX BOLT	11.20
3	23-71-1-130-250	5SCREW M8	6.69
2	63-12-1-468-181	LENS LEFT	43.20

Additional Items	Sublet or Add'l Services
	RESURFACE F/WHEEL
Total Items	Total Sublets
	95.00

Notes	Totals
	Labor 770.80
	Parts 576.53
	Supplies 0.00
	Sublets 95.00
	Add'l Items 0.00
	Subtotal 1442.33
	Tax 47.56
	Total 1489.89

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 13418

Service Invoice: 13418

Inv. Date	04/06/02	Year	1988
S.O. Date	04/05/02	Make	BMW
QC'd by	7	Model	M5
Salesman	DT	Color	SCHWARZ
Division	SS	Miles	121991
		Lic #	2MOK235

Qty	Part Number	Part Description	Price
1	BULB	MISC LIGHT BULB	1.80
1	11-42-9-063-138	OIL FILTER INSERT	4.68
1	12X16	SEAL RING	0.27
1	SI1	FUEL ADDITIVE	4.46
1	505	OIL CONDITIONER	12.56
6	OW-40 MOBIL 1	KENDALL BULK OIL	13.50
1	34-33-1-162-054	HYDRO ACCUMULATOR	0.00
2	40-71-8	WIPER BLADE	20.70
1	FEE	OIL RECYCLING	3.00

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street San Francisco, CA. 94109 415-567-8000

Service Invoice: 13418

Service Invoice: 13418

Inv. Date	04/06/02	Year	1988
S.O. Date	04/05/02	Make	BMW
QC'd by	7	Model	M5
Salesman	DT	Color	SCHWARZ
Division	SS	Miles	121991
		Lic #	2MOK235

Qty	Part Number	Part Description	Price
1	BULB	MISC LIGHT BULB	1.80
1	11-42-9-063-138	OIL FILTER INSERT	4.68
1	12X16	SEAL RING	0.27
1	SI1	FUEL ADDITIVE	4.46
1	505	OIL CONDITIONER	12.56
6	OW-40 MOBIL 1	KENDALL BULK OIL	13.50
1	34-33-1-162-054	HYDRO ACCUMULATOR	0.00
2	40-71-8	WIPER BLADE	20.70
1	FEE	OIL RECYCLING	3.00

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 13504

Service Invoice: 13504

Inv. Date	04/13/02	Year	1988
S.O. Date	04/12/02	Make	BMW
QC'd by	11	Model	M5
Salesman	SC	Color	SCHWARZ
Division	SS	Miles	121998
		Lic #	2MOK235

Qty	Part Number	Part Description	Price
2	HYD FLUID	HYDRAULIC FLUID PINT	13.50
1	34-32-1-159-901	BRKE HOSE	113.40
2	13-64-1-273-272	SP INJECT VALVE	85.50
2	34-32-1-159-881	HOSE	43.20
1	34-32-1-159-878	BRAKE HOSE	48.16
	FEE	HYD FLUID RECYCLING	1.50

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 13504

It's a Lab

Inv. Date	04/13/02	Year	1988
S.O. Date	04/12/02	Make	BMW
QC'd by	11	Model	M5
Salesman	SC	Color	SCHWARZ
Division	SS	Miles	121998
		Lic #	2MOK235

Qty	Part Number	Part Description	Price
2	HYD FLUID	HYDRAULIC FLUID PINT	13.50
2	34-32-1-159-901	BRAKE HOSE	113.40
1	13-64-1-273-272	SP INJECT VALVE	85.50
2	34-32-1-159-881	HOSE	43.20
2	34-32-1-159-878	BRAKE HOSE	48.16
1	FEE	HYD FLUID RECYCLING	1.50

Notes		Totals	
		Labor	258.50
		Parts	305.26
		Supplies	0.00
		Sublets	0.00
		Addl. Items	0.00
		Subtotal	563.76
		Tax	25.82
		Total	589.58

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

(Page 1 of 1)

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 17857

Service Invoice: 17857

Inv. Date	04/25/03	Year	1988
S.O. Date	04/25/03	Make	BMW
QC'd by	7	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	124514
		Lic #	2MOK235

Qty	Part Number	Part Description	Price
6	OW-40 MOBIL 1	KENDALL BULK OIL	13.50
1	12X16	SEAL RING	0.27
1	11-42-9-063-138	OIL FILTER INSERT	4.68
3	HYD FLUID	HYDRAULIC FLUID PINT	13.50
8	82-14-1-467-704Q	COOLANT(QUARTS)	18.40
1	FEE	OIL RECYCLING	3.00
1	FEE	COOLANT RECYCLING	1.60
1	FEE	HYD FLUID RECYCLING	1.50

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

(Page 1 of 1)

Service Invoice: 17857

Inv. Date	04/25/03	Year	1988
S.O. Date	04/25/03	Make	BMW
QC'd by	7	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	124514
		Lic.#	2MOK235

Qty	Part Number	Part Description	Price
6	OW-40 MOBIL 1	KENDALL BULK OIL	13.50
1	12X16	SEAL RING	0.27
1	11-42-9-063-138	OIL FILTER INSERT	4.68
3	HYD FLUID	HYDRAULIC FLUID PINT	13.50
8	82-14-1-467-7040	COOLANT(QUARTS)	18.40
1	FEE	OIL RECYCLING	3.00
1	FEE	COOLANT RECYCLING	1.60
1	FEE	HYD FLUID RECYCLING	1.50

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 20624

Name		
Addr.		
Phone		
B- Name		
B-Addr.		
B-Phone		
Prod Date	11/87 E28/S38/5SPD	
V.I.N. #	2875263	

Inv. Date	01/06/04	Year	1988
S.O. Date	12/29/03	Make	BMW
QC'd by	3,1121	Model	M5
Salesman	OWNER	Color	SCHWARZ
Division	SS	Miles	124644
		Lic #	2MOK235

Service Description	Hrs.	Lab's
INSP II KEND	5.00	550.00
CK EMISSIONS UNDER LOAD, DELIVER FOR TEST	0.50	55.00
REPR STEERING SUPPORT BRACKET NOTE: L/F WHEEL LOCK WAS SEIZED -- HAD TO DESTROY TO REMOVE	3.00	330.00
REPL WORN TC BUSHINGS REPL ALL TIERODS ALIGN	4.50	495.00
INSPECT INSIDE OF L/F TIRE FOR DAMAGE APPEARS TO HAVE BEEN RUN FLAT SIGNS OF INSIDE WEAR BUT SERVICABLE FOR THE SHORT TERM REPLACE TIRES SOON 235/45-17	0.35	38.50

Qty	Part Number	Part Description	Price
6	OW-40 MOBIL 1	KENDALL BULK OIL	13.50
3	MTL	MANUAL TRANS FLUID	12.15
3	RL/DIFF	REDLINE DIF PINT	14.49
3	12X16	SEAL RING	0.81
1	SI1	FUEL ADDITIVE	4.46
6	12-12-9-061-882	X5DC SPARK PLUG	38.88
1	12-11-1-715-905	8-DIST CAP	71.64
1	12-11-1-715-905	IGNITION ROTOR	24.08
1	11-42-9-063-138	OIL FILTER INSERT	4.68
1	13-32-1-268-231	FILTER	19.58
1	13-72-1-307-134	7-AIR FILTER	33.75
1	11-12-1-312-172	GASKET	31.05
3	11-12-1-312-173	GASKET	12.84
6	VALVE SHIMS	VALVE SHIMS	30.78
1	32-21-1-129-014	5-TIE ROD	65.48
2	32-21-1-135-668	8-TIE ROD	81.00
2	31-12-1-136-607	8-SP BUSH HYDRO	81.00
2	31-12-1-092-107	7-NUT	1.64
1	SUBFRAME BRACKET	REINFORCEMENT	9.00
1	WEIGHTS	WHEEL WEIGHTS	2.70

Additional Items	Sublet or Add'l Services
	TEST
Total Items	
Total Sublets	91.00

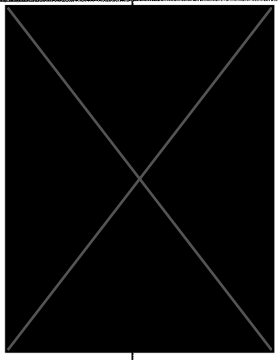
Notes	Totals
Next service due on: ???	Labor 1468.50
	Parts 559.51
	Supplies 0.00
	Sublets 91.00
	Add'l Items 0.00
	Subtotal 2119.01
	Tax 47.05
	Total 2166.06

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 20624

Name Addr.	
Phone	
B- Name B- Addr.	
B- Phone Prod Date V.I.N. #	
11/87 E28/S38/5SPD 2875263	

Inv. Date S.O. Date QC'd by Salesman Division	01/06/04 12/29/03 3,1121 OWNER SS	Year Make Model Color Miles Lic #	1988 BMW M5 SCHWARZ 124644 2MOK235
---	---	--	---

Service Description	Hrs.	Lab\$
INSP II KEND	5.00	550.00
CK EMISSIONS UNDER LOAD, DELIVER FOR TEST	0.50	55.00
REPR STEERING SUPPORT BRACKET NOTE: L/F WHEEL LOCK WAS SEIZED -- HAD TO DESTROY TO REMOVE	3.00	330.00
REPL WORN TC BUSHINGS REPL ALL TIERODS ALIGN	4.50	495.00
INSPECT INSIDE OF L/F TIRE FOR DAMAGE APPEARS TO HAVE BEEN RUN FLAT SIGNS OF INSIDE WEAR BUT SERVICABLE FOR THE SHORT TERM REPLACE TIRES SOON 235/45-17	0.35	38.50

Qty	Part Number	Part Description	Price
6	OW-40 MOBIL 1	KENDALL BULK OIL	13.50
3	MTL	MANUAL TRANS FLUID	12.15
3	RL/DIFF	REDLINE DIF PINT	14.49
3	12X16	SEAL RING	0.81
1	SI1	FUEL ADDITIVE	4.46
6	12-12-9-061-882	X5DC SPARK PLUG	38.88
1	12-11-1-715-905	8-DIST CAP	71.64
1	12-11-1-715-905	IGNITION ROTOR	24.08
1	11-42-9-063-138	OIL FILTER INSERT	4.68
1	13-32-1-268-231	FILTER *	19.58
1	13-72-1-307-134	7-AIR FILTER	33.75
1	11-12-1-312-172	GASKET	31.05
3	11-12-1-312-173	GASKET	12.84
6	VALVE SHIMS	VALVE SHIMS	30.78
1	32-21-1-129-014	5-TIE ROD	65.48
2	32-21-1-135-668	8-TIE ROD	81.00
2	31-1-2-1-136-607	8-SP BUSH HYDRO	81.00
1	31-1-2-1-092-107	7-NUT	1.64
1	SUBFRAME BRACKET	REINFORCEMENT	9.00
1	WEIGHTS	WHEEL WEIGHTS	2.70

Additional Items	Sublet or Add'l Services
	TEST
Total Items	
Notes	
Next service due on: ???	
Total Sublets	

Totals	
Labor	1468.50
Parts	559.51
Supplies	0.00
Sublets	91.00
Addl. Items	0.00
Subtotal	2119.01
Tax	47.05
Total	2166.06

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 20624

Inv. Date	01/06/04	Year	1988
S.O. Date	12/29/03	Make	BMW
QC'd by	3.1121	Model	M5
Salesman	OWNER	Color	SCHWARZ
Division	SS	Miles	124644
		Lic #	2MOK235

Qty	Part Number	Part Description	Price
1	FEE	OIL RECYCLING	3.00
1	FEE	PT OIL RECYCLING	1.50
1	FEE	FUEL FILTER RECYCLING	1.50

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD1593774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 20624

Name		
Addr.		
Phone		
B- Name		
B-Addr.		
B-Phone		
Prod Date	11/87 E28/S38/5SPD	
V.I.N. #	2875263	

Inv. Date	01/06/04	Year	1988
S.O. Date	12/29/03	Make	BMW
QC'd by	3,1121	Model	M5
Salesman	OWNER	Color	SCHWARZ
Division	SS	Miles	124644
		Lic #	2MOK235

Service Description	Hrs.	Lab\$

Qty	Part Number	Part Description	Price
1	FEE	OIL RECYCLING	3.00
1	FEE	PT OIL RECYCLING	1.50
1	FEE	FUEL FILTER RECYCLING	1.50

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

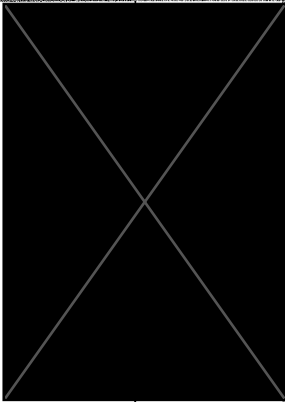
Additional Items	Sublet or Add'l Services
	TEST 91.00
Total Items	Total Sublets 91.00

Notes	Totals
Next service due on: ???	Labor 1468.50 Parts 559.51 Supplies 0.00 Sublets 91.00 Add'l Items 0.00 Subtotal 2119.01 Tax 47.05 Total 2166.06

1641 Jackson Street San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 21643

Name Add:		
Phone		
B- Name		
B-Addr		
B-Phone	11/87 E28/S38/5SPD	
Prod Date	2875263	
V.I.N. #		

Inv. Date	04/01/04	Year	1988
S.O. Date	03/31/04	Make	BMW
QC'd by	11	Model	M5
Salesman	SC	Color	SCHWARZ
Division	SS	Miles	125384
		Lic #	2MOK235

Service Description		Hrs.	Lab\$
REPR DRIVERS LOWER SEAT FRAME		5.00	550.00
CK SEAT TRIM-OUTER-REPAIR AS POSS, MAY NEED NEW IN FUTURE			
CK STARTER DRIVE-OWNER REPORT F/WHEELS SOMETIMES		1.50	165.00
REPL WORN STARTER			
SECURE L/R DEFROST WIRING CONNECTION			

Qty	Part Number	Part Description	Price
1	51-23-1-943-279	6-PLATE	0.57
1	12-41-1-466-093	RMFD START MOTR	135.23

Additional Items		Sublet or Add'l Services	
Total Items			0.00

Notes		Totals	
		Labor	715.00
		Parts	135.80
		Supplies	0.00
		Sublets	0.00
		Add. Items	0.00
		Subtotal	850.80
		Tax	11.54
Next service due on: ???		Total	862.34

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately, Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 21643

Hrs. Labs

Inv. Date	04/01/04	Year	1988
S.O. Date	03/31/04	Make	BMW
QC'd by	11	Model	M5
Salesman	SC	Color	SCHWARZ
Division	SS	Miles	125384
		Lic.#	2MOK235

Qty	Part Number	Part Description	Price
1	51-23-1-943-279	6-PLATE	0.57
1	12-41-1-466-093	RMFD START MOTR	135.23

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA 94109 415-567-8000

Service Invoice: 23135

Hrs. Lab\$

0.70	77.00
------	-------

Inv. Date	08/13/04	Year	1988
S.O. Date	08/13/04	Make	BMW
QC'd by	9	Model	M5
Salesman	SC	Color	SCHWARZ
Division	SS	Miles	0
		Lic #	2MOK235

Additional Items		Sublet or Add'l Services	
Total Items		Total Sublets	0.00
Notes			
Next service due on: ???			
		Totals Labor 77.00 Parts 8.92 Supplies 0.00 Sublets 0.00 Addl. Items 0.00 Subtotal 85.92 Tax 0.76 Total 86.68	

(Page 1 of 1)

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 23135

His Lies

0.70	77.0
------	------

Inv. Date	08/13/04	Year	1988
S.O. Date	08/13/04	Make	BMW
QC'd by	9	Model	M5
Salesman	SC	Color	SCHWARZ
Division	SS	Miles	0
		Lic #	2MOK235

Additional Items		Sublet or Add'l Services	
Total Items			
Notes		Totals	
		Labor	77.00
		Parts	8.92
		Supplies	0.00
		Sublets	0.00
		Add'l Items	0.00
		Subtotal	85.92
		Tax	0.76
Next service due on: ???		Total	86.68

(Page 1 of 1)

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 24783

Inv. Date	01/12/05	Year	1988
S.O. Date	01/12/05	Make	BMW
QC'd by	17	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	126372
		Lic.#	2MOK235

Qty	Part Number	Part Description	Price
1	11-42-9-063-138	OIL FILTER INSERT	5.85
1	12X16	SEAL RING	0.27
1	SI1	FUEL ADDITIVE	4.46
6	OW-40 MOBIL 1	CASTROL 20W50	13.50
1	51-21-1-809-735	BUFFER *	1.07
1	BULB	MISC LIGHT BULB	1.80
1	FEE	OIL RECYCLING	3.00

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA 94109 415-567-8000

Service Invoice: 24783

Inv. Date	01/12/05	Year	1988
S.O. Date	01/12/05	Make	BMW
QC'd by	17	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	126372
		Lic.#	2MOK235

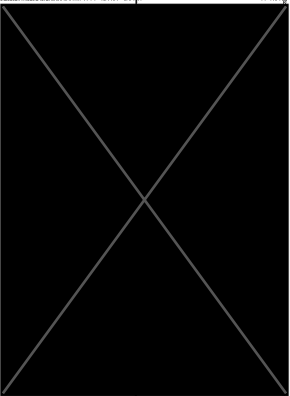
Qty	Part Number	Part Description	Price
1	11-42-9-063-138	OIL FILTER INSERT	5.85
1	12X16	SEAL RING	0.27
1	SI1	FUEL ADDITIVE	4.46
6	OW-40 MOBIL 1	CASTROL 20W50	13.50
1	51-21-1-809-735	BUFFER *	1.07
1	BULB	MISC LIGHT BULB	1.80
1	FEE	OIL RECYCLING	3.00

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 24895

Name Addr.		
Phone		
B- Name B-Addr.		
B-Phone Prod Date V.I.N. #		
		11/87 E28/S38/5SPD 2875263

Inv. Date S.O. Date QC'd by Salesman Division	01/21/05 01/21/05 17 JK SS	Year Make Model Color Miles Lic #	1988 BMW M5 SCHWARZ 126467 2MOK235
---	--	--	---

Service Description	Hrs.	Lab\$
REPL V BELTS	0.50	55.00
REPL BLOWER MOTOR	1.50	165.00
INSTALL S/O BULBS L HI, L FOG	0.25	27.50
REPL GRILLE FASTENERS	0.10	11.00
REPL HP PS HOSES	2.50	275.00
INSTALL OWNER'S TIRES	1.00	110.00

Qty	Part Number	Part Description	Price
1	32-41-1-132-526	7-PRES HOSE ASY	173.70
1	32-41-2-225-104	7-HOSE ASSY	189.52
1	63-21-7-160-779	H3-55W BULB	11.70
1	H4	HIGH BULB 100W	11.81
1	07509064401	H1 BULB	8.96
1	11-23-1-706-668	BELT	8.91
1	64-52-1-711-056	BELT	10.35
1	32-42-1-706-750	BELT	6.30
4	WEIGHTS	WHEEL WEIGHTS	10.80
4	VALVE STEMS	VALVE STEMS	7.04
1	64-11-1-354-618	BLOWER	191.70
1	RL D4	D4 ATF	7.20
10	51-13-1-885-399	CLAMP	3.40
1	32 41 6 851 217	FLUID CONTAINER	34.65
1	FEE	TIRE RECYCLING	10.00

Additional Items	Sublet or Add'l Services
Total Items	
Total Sublets	0.00

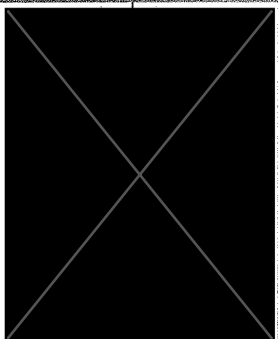
Notes	Totals
	Labor 643.50
	Parts 686.04
	Supplies 0.00
	Sublets 0.00
	Add'l Items 0.00
	Subtotal 1329.54
	Tax 57.46
Next service due on: ???	Total 1387.00

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641. Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 24895

Name Addr.		
Phone		
B- Name B-Addr.		
B-Phone		
Prod Date V.I.N. #	11/87 E28/S38/5SPD 2875263	

Inv. Date S.O. Date QC'd by Salesman Division	01/21/05 01/21/05 17 JK SS	Year Make Model Color Miles Lic #	1988 BMW M5 SCHWARZ 126467 2MOK235
---	--	--	---

Service Description	Hrs.	Lab\$
REPL V BELTS	0.50	55.00
REPL BLOWER MOTOR	1.50	165.00
INSTALL S/O BULBS L HI, L FOG	0.25	27.50
REPL GRILLE FASTENERS	0.10	11.00
REPL HP PS HOSES	2.50	275.00
INSTALL OWNER'S TIRES	1.00	110.00

Qty	Part Number	Part Description	Price
1	32-41-1-132-526	7-PRES HOSE ASY	173.70
1	32-41-2-225-104	7-HOSE ASSY	189.52
1	63-21-7-160-779	H3-55W BULB	11.70
1	H4	HIGH BULB 100W	11.81
1	07509064401	H1 BULB	8.96
1	11-23-1-706-668	BELT	8.91
1	64-52-1-711-056	BELT	10.35
1	32-42-1-706-750	BELT	6.30
4	WEIGHTS	WHEEL WEIGHTS	10.80
4	VALVE STEMS	VALVE STEMS	7.04
1	64-11-1-354-618	BLOWER	191.70
1	RL D4	D4 ATF	7.20
10	51-13-1-885-399	CLAMP	3.40
1	32 41 6 851 217	FLUID CONTAINER	34.65
1	FEE	TIRE RECYCLING	10.00

Additional Items	Sublet or Add'l Services
Total Items	Total Sublets
	0.00

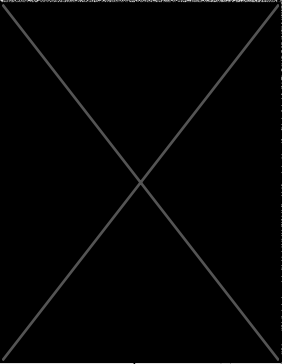
Notes	Totals
	Labor 643.50
	Parts 686.04
	Supplies 0.00
	Sublets 0.00
	Addl Items 0.00
	Subtotal 1329.54
	Tax 57.46
	Total 1387.00

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 26324

Name Addr.		
Phone		
B. Name		
B-Addr.		
B-Phone	11/87 E28/S38/5SPD	
Prod Date	2875263	
V.I.N. #		

Inv. Date	05/26/05	Year	1988
S.O. Date	05/26/05	Make	BMW
QC'd by	17	Model	M5
Salesman	TS	Color	SCHWARZ
Division	SS	Miles	126868
		Lic #	2MOK235

Service Description	Hrs.	Lab\$
CK TUNE		
OBC READS PPPP--RESET		
RESET SERVICE LIGHTS		
SERVICED 500 MILES AGO		
CK AC NOT COLD	1.40	154.00
REPR PLOVER WIRE TO COMPRESSOR, SVC A/C SYSTEM		
EVAC, CHARGE, INSTALL DYE, CK FOR LEAKS		
DEL TO TEST STATION	0.25	27.50

Qty	Part Number	Part Description	Price
10	R12 0.1 LB	REFRIGERANT	72.00
1	DYE	DYE	8.96
2	61-13-1-369-381	CONNECTOR	1.10

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

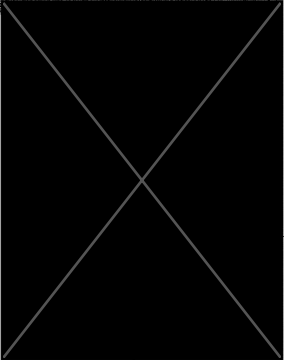
Additional Items	Sublet or Add'l Services
	TEST
Total Items	
	Total Sublets

Notes	Totals
	Labor 181.50
	Parts 82.06
	Supplies 0.00
	Sublets 50.00
	Add'l Items 0.00
	Subtotal 313.56
	Tax 6.98
Next service due on: ???	Total 320.54

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 26324

Name Addr.		
Phone		
B. Name		
B. Addr.		
B. Phone	11/87 E28/S38/5SPD	
Prod Date	2875263	
V.I.N. #		

Inv. Date	05/26/05	Year	1988
S.O. Date	05/26/05	Make	BMW
QC'd by	17	Model	M5
Salesman	TS	Color	SCHWARZ
Division	SS	Miles	126868
		Lic #	2MOK235

Service Description	Hrs.	Lab\$
CK TUNE		
OBC READS PPPP--RESET		
RESET SERVICE LIGHTS		
SERVICED 500 MILES AGO		
CK AC NOT COLD	1.40	154.00
REPR PLOWER WIRE TO COMPRESSOR, SVC A/C SYSTEM		
EVAC, CHARGE, INSTALL DYE, CK FOR LEAKS		
DEL TO TEST STATION	0.25	27.50

Qty	Part Number	Part Description	Price
10	R12 0.1 LB	REFRIGERANT	72.00
1	DYE	DYE	8.96
2	61-13-1-369-381	CONNECTOR	1.10

Additional Items	Sublet or Add'l Services
	TEST
Total Items	
	Total Sublets
	50.00

Notes	Totals
	Labor 181.50
	Parts 82.06
	Supplies 0.00
	Sublets 50.00
	Addl. Items 0.00
	Subtotal 313.56
	Tax 6.98
	Total 320.54

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Pinedrus Independent BMW, Inc.

Service Invoice: 34237

Name		
Addr		
Phone		
B- Name		
B-Addr		
B-Phone		
Prod Date	11/87 E28/S38/ISSP	
V.I.N. #	2875263	

Inv. Date	05/18/07	Year	1988
S.O. Date	05/09/07	Make	BMW
QC'd by	17	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	129237
		Lic #	2MOK235

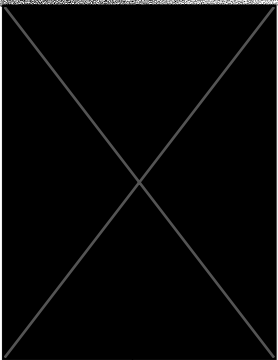
Service Description	Hrs	Lab's
REPR TACH INOP	1.50	180.00
REPL SI BOARD		
BULB FLUSH		
REPR R/F WINDOW INOP	1.50	180.00
REPL FAILED MOTOR - PART COMING VOR GERMANY		
CK TUNE	0.25	30.00
OIL CHANGE C	0.25	30.00

Qty	Part Number	Part Description	Price
1	11-12-1-716-993	OIL FILLER CAP	4.10
6	OW-40 MOBIL 1	CASTROL GTX	17.58
1	12X16	SEAL RING	0.27
1	11-42-9-063-138	OIL FILTER INSERT	7.02
1	62-11-1-385-094	COND. PLATE	440.78
16	BULB	MISC. LIGHT BULB	32.48
2	63-21-1-369-306	LAMP SOCKET *	8.92
1	51-33-1-375-404	EL DRIVE	249.75
1	51-95-1-924-961	DOOR FOIL	20.93
1	FEE	OIL RECYCLING	3.00

Additional Items	Sublet or Add'l Services
	TEST 50.00
Total Items	Total Sublets 50.00
Notes	
Next service due on: ???	
Totals	
Labor 420.00	
Parts 784.83	
Supplies 0.00	
Sublets 50.00	
Add'l Items 0.00	
Subtotal 1254.83	
Tax 66.46	
Total 1321.29	

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Name Addr.		
Phone		
B-Name B-Addr.		
B-Phone		
Prod Date V.I.N. #	11/87 E28/S38/5SPD 2875263	

Inv Date S.O. Date QC'd by Salesman Division	05/18/07 05/09/07 17 JK SS	Year Make Model Color Miles Lic. #	1988 BMW M5 SCHWARZ 129237 2MOK235
--	--	---	---

Service Description	Hrs.	Labs
REPR TACH INOP REPL SI BOARD BULB FLUSH	1.50	180.00
REPR R/F WINDOW INOP REPL FAILED MOTOR - PART COMING VOR GERMANY	1.50	180.00
CK TUNE	0.25	30.00
OIL CHANGE C	0.25	30.00

Qty	Part Number	Part Description	Price
1	11-12-1-716-993	OIL FILLER CAP	4.10
6	OW-40 MOBIL 1	CASTROL GTX	17.58
1	12X16	SEAL RING	0.27
1	11-42-9-063-138	OIL FILTER INSERT	7.02
1	62-11-1-385-094	COND. PLATE	440.78
16	BULB	MISC LIGHT BULB	32.48
2	63-21-1-369-306	LAMP SOCKET	8.92
1	51-33-1-375-404	EL DRIVE	249.75
1	51-95-1-924-961	DOOR FOIL	20.93
1	FEE	OIL RECYCLING	3.00

Additional Items	Sublet or Add'l Services
TEST	50.00
Total Items	
Total Sublets	50.00

Notes	Totals
Next service due on: ???	Labor 420.00 Parts 784.83 Supplies 0.00 Sublets 50.00 Add'l Items 0.00 Subtotal 1254.83 Tax 66.46 Total 1321.29

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

Service Invoice: 34351

Inv. Date	05/18/07	Year	1988
S.O. Date	05/18/07	Make	BMW
QC'd by	10	Model	M5
Salesman	JK	Color	SCHWARZ
Division	DS	Miles	0
		Lic #	2MOK235

[illegible]

Notes

THE DETAIL SHOP IS OPEN TUESDAY THROUGH SATURDAY,
9:30 A.M. - 5:30 P.M. CALL (415) 567-8000 TO MAKE
YOUR NEXT APPOINTMENT.

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 41589

Name		
Addr.		
Phone		
B- Name		
B- Addr.		
B-Phone		
Prod Date	11/87 E28/S38/5SPD	
V.I.N. #	2875263	

Inv. Date	03/31/09	Year	1988
S.O. Date	03/24/09	Make	BMW
QC'd by	11	Model	M5
Salesman	TLS	Color	SCHWARZ
Division	SS	Miles	130762
		Lic #	2MOK235

Service Description	Hrs.	Lab\$
CHECK THE BRAKES, SEEM TO BE SPONGEY FLUSH IF NEEDED CALIPERS MAKE SQUEAKY NOISE - PADS AND ROTORS WORN REPL PADS, ROTORS, FLUSH BRAKE FLUID NOTE: FRONT BRAKES MODIFIED BY DINAN - USE LATE MODEL 840CI ROTORS AND (BREMBO CALIPER) PADS	2.00	356.00
DRIVERS SIDE REAR WINDOW IS STUCK #30 PLEASE FIX REPL WORN CIRCUIT BREAKER SWITCH	0.50	64.00
REPL CRACKED AIRBOOT	0.25	32.00
DELIVER FOR TEST	0.25	32.00

Qty	Part Number	Part Description	Price
1	61-31-1-369-375	CIRCUIT BREAKER *	141.51
1	34-11-1-163-923	KIT BRK LINING	116.51
2	34-11-6-756-087	BRAKE DISC	215.52
1	34-35-1-179-819	SENSOR	8.37
3	HYD FLUID	HYDRAULIC FLUID PINT	19.44
1	11-61-1-306-724	7-RUBBER BOOT	16.37
1	FEE	HYD FLUID RECYCLING	1.50

Additional Items	Sublet or Add'l Services
	TEST 50.00
Total Items	Total Sublets 50.00

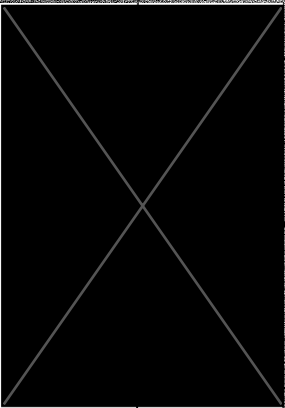
Notes	Totals
	Labor 384.00
	Parts 519.22
	Supplies 0.00
	Sublets 50.00
	Add'l Items 0.00
	Subtotal 953.22
	Tax 44.01
Next service due on: ???	Total 997.23

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AC159774

1641 Jackson Street, San Francisco CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 41589

Name Address		
Phone		
B- Name B-Addr		
B-Phone Prod Date V.I.N. #		
11/87 E28/S38/5SPD 2875263		

Inv. Date S.O. Date QC'd by Salesman Division	03/31/09 03/24/09 11 TLS SS	Year Make Model Color Miles Lic. #	1988 BMW M5 SCHWARZ 130762 2MOK235
---	---	---	---

Service Description		Hrs.	Lab\$
CHECK THE BRAKES, SEEM TO BE SPONGEY FLUSH IF NEEDED CALIPERS MAKE SQUEAKY NOISE - PADS AND ROTORS WORN REPL PADS, ROTORS, FLUSH BRAKE FLUID NOTE: FRONT BRAKES MODIFIED BY DINAN - USE LATE MODEL 840CI ROTORS AND (BREMBO CALIPER) PADS		2.00	256.00
DRIVERS SIDE REAR WINDOW IS STUCK #30 PLEASE FIX REPL WORN CIRCUIT BREAKER SWITCH		0.50	64.00
REPL CRACKED AIRBOOT		0.25	32.00
DELIVER FOR TEST		0.25	32.00

Qty	Part Number	Part Description	Price
1	61-31-1-369-375	CIRCUIT BREAKER *	141.51
1	34-11-1-163-923	KIT BRK LINING	116.51
2	34-11-6-756-087	BRAKE DISC	215.52
1	34-35-1-179-819	SENSOR	8.37
3	HYD FLUID	HYDRAULIC FLUID PINT	19.44
1	11-61-1-306-724	7-RUBBER BOOT	16.37
1	FEE	HYD FLUID RECYCLING	1.50

Additional Items		Sublet or Add'l Services	
		TEST	50.00
		Total Items	
		Total Sublets	50.00

Notes		Totals	
		Labor	384.00
		Parts	519.22
		Supplies	0.00
		Sublets	50.00
		Add'l Items	0.00
		Subtotal	953.22
		Tax	44.01
		Total	997.23

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 50146

Name		Address	
Phone		B- Name	
B- Name		B- Addr.	
B- Phone		Prod Date	
V.I.N. #		11/87 E28/S38/5SPD	
2875263			

Inv. Date	05/25/11	Year	1988
S.O. Date	05/24/11	Make	BMW
QC'd by	3	Model	M5
Salesman	DT	Color	SCHWARZ
Division	SS	Miles	132499
		Lic #	2WOK235

Service Description		Hrs.	Lab\$
OIL CHANGE- 15W40 CHANGE TRANS AND DIFF OILS SECURE L/R BUMPER TRIM		0.75	96.00
DRAIN AND FILL COOLANT AT RADIATOR AND ENGINE BLOCK FLUSH BRAKE FLUID		1.00	128.00
DELIVER FOR TEST		0.25	32.00

Qty	Part Number	Part Description	Price
6	OW-40 MOBIL 1	BMW 15W40 OIL	32.16
1	11-42-9-063-138	OIL FILTER INSERT	15.68
1	12X16	SEAL RING	0.27
3	HYD FLUID	ATE SL.6 DOT 4	19.44
8	82-14-1-467-7040	COOLANT(QUARTS)	22.00
1	FEE	OIL RECYCLING	3.00
1	FEE	COOLANT RECYCLING	1.60
1	FEE	HYD FLUID RECYCLING	1.50

Additional Items	Sublet or Add'l Services
	test
Total Items	
Notes	
Next service due on: ???	

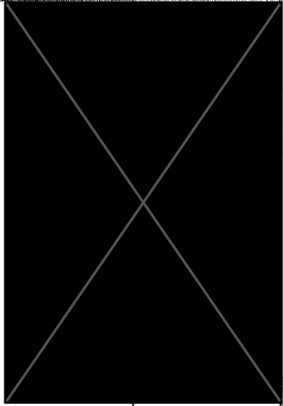
Totals	
Labor	256.00
Parts	95.65
Supplies	0.00
Sublets	50.00
Addl. Items	0.00
Subtotal	401.65
Tax	8.51
Total	410.16

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 50146

Name Addr.	
Phone	
B-Name B-Addr.	
B-Phone Prod Date V.I.N. #	
11/87 E28/S38/5SPD 2875263	

Inv. Date S.O. Date QC'd by Salesman Division	05/25/11 05/24/11 3 DT SS	Year Make Model Color Miles Lic #	1988 BMW M5 SCHWARZ 132499 2MOK235
---	---------------------------------------	--	---

Service Description	Hrs.	Lab\$
OIL CHANGE- 15W40 CHANGE TRANS AND DIFF OILS SECURE L/R BUMPER TRIM	0.75	90.00
DRAIN AND FILL COOLANT AT RADIATOR AND ENGINE BLOCK FLUSH BRAKE FLUID	1.00	128.00
DELIVER FOR TEST	0.25	32.00

Qty	Part Number	Part Description	Price
6	OW-40 MOBIL 1	BMW 15W40 OIL	32.16
1	11-42-9-063-138	OIL FILTER INSERT	15.68
1	12X16	SEAL RING	0.27
3	HYD FLUID	ATE SL 6 DOT 4	19.44
8	82-14-1-467-7040	COOLANT(QUARTS)	22.00
1	FEE	OIL RECYCLING	3.00
1	FEE	COOLANT RECYCLING	1.60
1	FEE	HYD FLUID RECYCLING	1.50

Additional Items	Sublet or Add'l Services
	test
Total Items	
	Total Sublets
	50.00

Notes	Totals
	Labor 256.00
	Parts 95.65
	Supplies 0.00
	Sublets 50.00
	Add'l Items 0.00
	Subtotal 401.65
	Tax 8.51
	Total 410.16

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA 94109 415-567-8000

Service Invoice: 56319

Inv. Date	10/25/12	Year	1988
S.O. Date	10/25/12	Make	BMW
QC'd by	7	Model	M5
Salesman	DT	Color	SCHWARZ
Division	SS	Miles	0
		Lic #	2MOK235

Qty	Part Number	Part Description	Price
1	40-71-8	WIPER BLADE 18"	11.75
1	40-72-0	WIPER BLADE 20"	14.40
1	16-11-7-222-391	GAS CAP W/STRAP	20.07

Totals	0.00
Labor	46.22
Parts	0.00
Supplies	0.00
Sublets	0.00
Add. Items	46.22
Subtotal	3.93
Tax	
Total	50.15

1641 Jackson Street San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 56319

Name		
Address		
Phone		
B- Name		
B-Addr.		
B-Phone		
Prod Date	11/87 E28/S38/5SPD	
V.I.N. #	2875263	

Inv. Date	10/25/12	Year	1988
S.O. Date	10/25/12	Make	BMW
QC'd by	7	Model	M5
Salesman	DT	Color	SCHWARZ
Division	SS	Miles	0
		Lic #	2MOK235

Service Description	Hrs.	Lab\$
GAS CAP FOR 540I, WIPER BLADES FOR M5		

Qty	Part Number	Part Description	Price
1	40-71-8	WIPER BLADE 18"	11.75
1	40-72-0	WIPER BLADE 20"	14.40
1	16-11-7-222-391	GAS CAP W/STRAP	20.07

Additional Items	Sublet or Add'l Services
Total Items	
	Total Sublets
	0.00

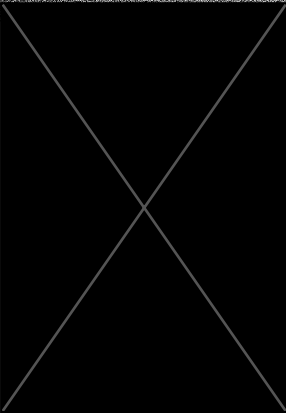
Notes	Totals
	Labor 0.00
	Parts 46.22
	Supplies 0.00
	Sublets 0.00
	Add. Items 0.00
	Subtotal 46.22
	Tax 3.93
Next service due on: ???	Total 50.15

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Car No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 58762

Name Addr.		
Phone		
B- Name B-Addr.		
B-Phone Prod Date V.I.N. #		
		11/87 E28/S38/5SPD 2875263

Inv. Date S.O. Date QC'd by Salesman Division	07/01/13 05/18/13 17,111 JK SS	Year Make Model Color Miles Lic #	1988 BMW M5 SCHWARZ 134746 2MOK235
---	--	--	---

Service Description	Hrs.	Lab's
SMOG #33 FAILED ON ALL 3 VALUES; GROSS POLLUTER ON CO MIKE SMELLED ROTTEN EGGS	0.50	70.00
OIL CHANGE #11 TIRES TO 40 PSI	0.25	35.00
BRAKE FLUSH #11	0.50	70.00
SAFETY CHECK #11 NO ISSUES AT THIS TIME	0.50	70.00
DX REPR FAILED SMOG #17 FOUND SYSTEM RUNNING V RICH (>8%) CLOSED LOOP FUEL PRESSURE GOOD, COOLANT TEMP SENSOR IN SPEC SWAP TEST DME- SYMPTOM PERSISTS NOTED TPS INOP AT IDLE- REPL- NO CHANGE USE BREAKOUT BOX TO TEST CHASSIS WIRING- GOOD CONT AFM SUSPECT- SEND OUT FOR OVERHAUL- SYSTEM RUNS AT 3% OPEN	4.00	560.00

Qty	Part Number	Part Description	Price
3	HYD FLUID	ATE SL.6 DOT 4	19.44
1	12X16	SEAL RING	0.27
1	11-42-9-063-138	OIL FILTER INSERT	12.74
6	OW-40 MOBIL 1	BMW 15W40 OIL	27.30
1	13-62-1-273-277	THROTTLE POSITION SENSOR	82.70
1	51-21-1-809-735	BUFFER *	2.03
1	13-72-1-307-134	7-AIR FILTER	44.58
1	FEE	OIL RECYCLING	3.00
1	FEE	HYD FLUID RECYCLING	1.50

Additional Items	Sublet or Add'l Services
	TEST SHIPPING AFM O-HAUL RETEST
Total Items	Total Sublets
	415.98

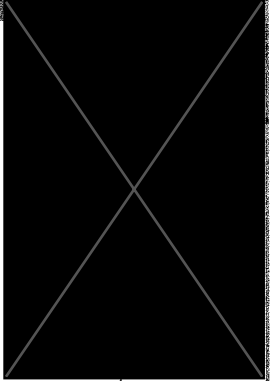
Notes	Totals
B2 EXH MANIFOLD REPR/REPL \$1000	Labor 805.00 Parts 193.56 Supplies 0.00 Sublets 415.98 Add'l Items 0.00 Subtotal 1414.54 Tax 16.54
Next service due on: ???	Total 1431.08

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 58762

Name Addr.		
Phone		
B-Name B-Addr.		
B-Phone Prod Date V.I.N. #		
11/87 E28/S38/I5SPD 2875263		

Inv. Date S.O. Date QC'd by Salesman Division	07/01/13 05/18/13 17,111 JK SS	Year Make Model Color Miles Lic #	1988 BMW M5 SCHWARZ 134746 2MOK235
---	--	--	---

Service Description	Hrs.	Lab\$
SMOG #33 FAILED ON ALL 3 VALUES; GROSS POLLUTER ON CO MIKE SMELLED ROTTEN EGGS	0.50	70.00
OIL CHANGE #11 TIRES TO 40 PSI	0.25	35.00
BRAKE FLUSH #11	0.50	70.00
SAFETY CHECK #11 NO ISSUES AT THIS TIME	0.50	70.00
DX REPR FAILED SMOG #17 FOUND SYSTEM RUNNING V RICH (>8%) CLOSED LOOP FUEL PRESSURE GOOD, COOLANT TEMP SENSOR IN SPEC SWAP TEST DME- SYMPTOM PERSISTS NOTED TPS INOP AT IDLE- REPL- NO CHANGE USE BREAKOUT BOX TO TEST CHASSIS WIRING- GOOD CONT AFM SUSPECT- SEND OUT FOR OVERHAUL- SYSTEM RUNS AT 3% OPEN	4.00	560.00

Qty	Part Number	Part Description	Price
3	HYD FLUID	ATE SL.6 DOT 4	19.44
1	12X16	SEAL RING	0.27
1	11-42-9-063-138	OIL FILTER INSERT	12.74
6	OW-40 MOBIL 1	BMW 15W40 OIL	27.30
1	13-62-1-273-277	THROTTLE POSITION SENSOR	82.70
1	51-21-1-809-735	BUFFER *	2.03
1	13-72-1-307-134	7-AIR FILTER	44.58
1	FEE	OIL RECYCLING	3.00
1	FEE	HYD FLUID RECYCLING	1.50

Additional Items	Sublet or Add'l Services
	TEST SHIPPING AFM O-HAUL RETEST
Total Items	Total Sublets
	415.98

Notes	Totals
B2 EXH MANIFOLD REPR/REPL \$1000	Labor 805.00 Parts 193.56 Supplies 0.00 Sublets 415.98 Add'l Items 0.00 Subtotal 1414.54 Tax 16.54
Next service due on: ???	Total 1431.08

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 58762

Name		
Addr.		
Phone		
B- Name		
B-Addr		
B-Phone		
Prod Date	11/87 E28/S38/5SPD	
V.I.N. #	2875263	

Inv. Date	07/01/13	Year	1988
S.O. Date	05/18/13	Make	BMW
QC'd by	17,111	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	134746
		Lic #	2MOK235

Service Description	Hrs.	Lab\$
LOOP, < 1% IN CLOSED LOOP; ALL OTHER VALUES IN SPEC CHECK VALUE OF AMBIENT TEMP THERMISTER- READING ~ 10% HI ALSO NOTED: B2 EXHAUST MANIFOLD FLEX JOINT PERFORATED EVENTUALLY WILL NEED TO REPR OR REPL MANIFOLD AND REPL #1 CONT AFM THERMISTER (WARRANTY) #1		

Qty	Part Number	Part Description	Price

Additional Items	Sublet or Add'l Services
	TEST SHIPPING AFM O-HAUL RETEST
Total Items	Total Sublets
	415.98

Notes	Totals
B2 EXH MANIFOLD REPR/REPL \$1000	Labor 805.00 Parts 193.56 Supplies 0.00 Sublets 415.98 Addl. Items 0.00 Subtotal 1414.54 Tax 16.54 Total 1431.08
Next service due on: ???	

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 58762

Name		
Addr.		
Phone		
B- Name		
B-Addr.		
B-Phone		
Prod Date	11/87 E28/S38/5SPD	
V.I.N. #	2875263	

Inv. Date	07/01/13	Year	1988
S.O. Date	05/18/13	Make	BMW
QC'd by	17,111	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	134746
		Lic #	2MOK235

Service Description	Hrs.	Lab\$
LOOP, < 1% IN CLOSED LOOP; ALL OTHER VALUES IN SPEC CHECK VALUE OF AMBIENT TEMP THERMISTER- READING ~ 10% HI ALSO NOTED: B2 EXHAUST MANIFOLD FLEX JOINT PERFORATED EVENTUALLY WILL NEED TO REPR OR REPL MANIFOLD AND REPL #1 CONT AFM THERMISTER (WARRANTY) #1		

Qty	Part Number	Part Description	Price

Additional Items		Sublet or Add'l Services	
		TEST SHIPPING AFM O-HAUL RETEST	87.00 42.23 235.00 51.75
Total Items			

Notes		Totals	
B2 EXH MANIFLOLD REPR/REPL \$1000.		Labor	805.00
		Parts	193.56
		Supplies	0.00
		Sublets	415.98
		Add. Items	0.00
		Subtotal	1414.54
		Tax	16.54
Next service due on: ???		Total	1421.09

Notes
B2 EXH MANIFOLD REPR/REPL \$1000
Next service due on: ???

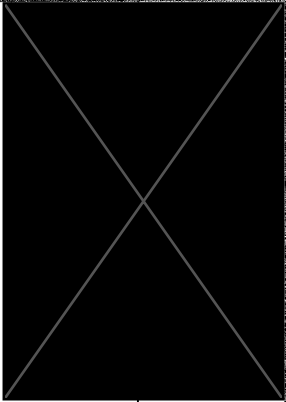
Totals	
Labor	805.00
Parts	193.56
Supplies	0.00
Sublets	415.98
Add. Items	0.00
Subtotal	1414.54
Tax	16.54
Total	1431.08

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 62369

Name Addr.	
Phone	
B- Name B-Addr.	
B- Phone Prod Date V.I.N. #	
11/87 E28/S38/5SPD 2875263	

Inv. Date S.O. Date QC'd by Salesman Division	04/17/14 04/02/14 36 JK SS	Year Make Model Color Miles Lic #	1988 BMW M5 SCHWARZ 134851 2MOK235
---	--	--	---

Qty	Part Number	Part Description	Price
6	11-61-1-306-790	7-RUBBER BOOT	66.42
1	17-12-1-119-294	HOSE	6.61
1	11-61-1-306-724	7-RUBBER BOOT	16.37
1	11-53-1-306-827	7-HOSE	14.67
1	07-11-9-906-322	7-O-RING	4.23
1	11-53-1-272-866	HOSE CONN	5.83
1	11-53-1-306-828	7-HOSE	7.97
1	11-53-1-306-850	7-HOSE	20.93
2	17-12-1-712-736	NEW COOLANT HOSE	90.46
1	17-11-2-226-018	7-RADIATOR	444.46
8	82-14-1-467-704Q	COOLANT(QUARTS)	22.00
1	64-21-1-374-635	7-HOSE	14.94
1	11-53-1-306-851	7-HOSE	32.40
1	11-15-1-306-958	7-BREAETHER HOSE	22.28
1	13-31-1-722-565	FUEL HOSE	0.00
4	12-31-1-268-447	ALT BUSH-POLY RED	51.88
1	11-53-1-307-737	O.E. ONLY T/STAT	61.50
1	11-53-1-310-625	7-HOSE	31.28
1	11-53-1-306-832	7-HOSE	22.73
1	11-53-1-306-829	7-HOSE	14.25

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

Service Description	Hrs.	Lab\$
EVAL COOLING SYSTEM UPPER RAD HOSE CAME OFF. TEMP TO RED NO MORE THAN 10 MIN FOUND RADIATOR UPPER NECK BROKEN, COOLING SYSTEM MOSTLY ORIGINAL REPL RADIATOR, THERMOSTAT, COOLANT HOSE SET RESEAL INTAKE ID SOURCE OF ENGINE MISS #2 SPARK PLUG WEAK- REPL PLUGS REPL ~10K MILES AGO, SHOULD BE SERVICABLE L/R BRAKE LIGHT INOP CLEAN SOCKET CONTACTS REPL WORN ALTERNATOR BUSHINGS REPL ALT BELT	8.00	1120.00

Additional Items			Sublet or Add'l Services		
Total Items			Total Sublets		0.00

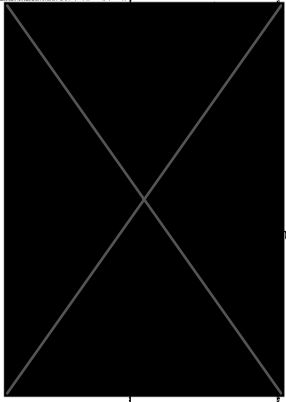
Notes						
Next service due on: ???						

Totals							
Labor				1120.00			
Parts				1125.21			
Supplies				0.00			
Sublets				0.00			
Add'l Items				0.00			
Subtotal				2245.21			
Tax				98.32			
Total				2343.53			

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 62369

Name Addr.		
Phone		
B- Name B-Addr.		
B- Phone Prod Date V.I.N. #		
		11/87 E28/S38/5SPD 2875263

Inv. Date S.O. Date QC'd by Salesman Division	04/17/14 04/02/14 36 JK SS	Year Make Model Color Miles Lic. #	1988 BMW M5 SCHWARZ 134851 2MOK235
---	--	---	---

Service Description	Hrs.	Lab\$
EVAP COOLING SYSTEM UPPER RAD HOSE CAME OFF, TEMP TO RED NO MORE THAN 10 MIN FOUND RADIATOR UPPER NECK BROKEN, COOLING SYSTEM MOSTLY ORIGINAL REPL RADIATOR, THERMOSTAT, COOLANT HOSE SET RESEAL INTAKE ID SOURCE OF ENGINE MISS #2 SPARK PLUG WEAK- REPL PLUGS REPL ~10K MILES AGO, SHOULD BE SERVICABLE L/R BRAKE LIGHT INOP CLEAN SOCKET CONTACTS REPL WORN ALTERNATOR BUSHINGS REPL ALT BELT	8.00	1120.00

Qty	Part Number	Part Description	Price
6	11-61-1-306-790	7-RUBBER BOOT	66.42
1	17-12-1-119-294	HOSE	6.61
1	11-61-1-306-724	7-RUBBER BOOT	16.37
1	11-53-1-306-827	7-HOSE	14.67
1	07-11-9-906-322	7-O-RING	4.23
1	11-53-1-272-866	HOSE CONN	5.83
1	11-53-1-306-828	7-HOSE	7.97
1	11-53-1-306-850	7-HOSE	20.93
2	17-12-1-712-736	NEW COOLANT HOSE	90.46
1	17-11-2-226-018	7-RADIATOR	444.46
8	82-14-1-467-704Q	COOLANT(QUARTS)	22.00
1	64-21-1-374-635	7-HOSE	14.94
1	11-53-1-306-851	7-HOSE	32.40
1	11-15-1-306-958	7-BREATHER HOSE	22.28
1	13-31-1-722-565	FUEL HOSE	0.00
4	12-31-1-268-447	ALT BUSH-POLY RED	51.88
1	11-53-1-307-737	O.E. ONLY T/STAT	61.50
1	11-53-1-310-625	7-HOSE	31.28
1	11-53-1-306-832	7-HOSE	22.73
1	11-53-1-306-829	7-HOSE	14.25

Additional Items	Sublet or Add'l Services
Total Items	Total Sublets

Notes	Totals
Next service due on: ???	Labor 1120.00 Parts 1125.21 Supplies 0.00 Sublets 0.00 Add'l Items 0.00 Subtotal 2245.21 Tax 98.32 Total 2343.53

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco CA. 94109 415-567-2000

Service Invoice: 62369

Inv. Date	04/17/14	Year	1988
S.O. Date	04/02/14	Make	BMW
QC'd by	36	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	134851
		Lic. #	2MOK235

Qty	Part Number	Part Description	Price
1	11-22-1-706-788	BELT 13X1040	13.13
1	17-11-2-227-683	RADIATOR CAP	20.29
1	11-53-1-307-324	COOLANT DIST TEE	6.81
1	64-21-1-374-636	WATER HOSE	22.24
6	07-12-9-952-133	CLAMP	15.66
1	11-61-1-305-124	INTAKE MANIFOLD O-RING	27.00
1	64-21-1-374-637	WATER HOSE	14.85
1	07-11-9-906-328	O-RING	0.90
1	13-41-1-310-699	7-HOSE	42.52
6	07-12-9-952-125	HOSE CLAMP	9.00
1	FEE	COOLANT RECYCLING	1.60

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street San Francisco, CA. 94109 415-567-8000

Service Invoice: 62369

Inv. Date	04/17/14	Year	1988
S.O. Date	04/02/14	Make	BMW
QC'd by	36	Model	M5
Salesman	JK	Color	SCHWARZ
Division	SS	Miles	134851
		Lic #	2MOK235

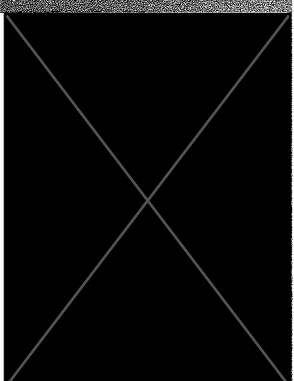
Qty	Part Number	Part Description	Price
1	11-22-1-706-788	BELT 13X1040	13.13
1	17-11-2-227-683	RADIATOR CAP	20.29
1	11-53-1-307-324	COOLANT DIST TEE	6.81
1	64-21-1-374-636	WATER HOSE	22.24
6	07-12-9-952-133	CLAMP	15.66
1	11-61-1-305-124	INTAKE MANIFOLD O-RING	27.00
1	64-21-1-374-637	WATER HOSE	14.85
1	07-11-9-906-328	O-RING	0.90
1	13-41-1-310-699	7-HOSE	42.52
6	07-12-9-952-125	HOSE CLAMP	9.00
1	FEE	COOLANT RECYCLING	1.60

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 64376

Name Addr:		
Phone		
B-Name B-Addr:		
B-Phone Prod Date V.I.N. #		
		11/87 E28/S38/S5PD 2875263

Inv. Date S.O. Date QC'd by Salesman Division	12/02/14 09/24/14 36 DB SS	Year Make Model Color Miles Lic.#	1988 BMW M5 SCHWARZ 134873 2MOK235
---	--	--	---

Service Description	Hrs.	Lab\$
REPL REAR EXHAUST MANIFOLD #36 HAD TO REMOVE BOTH MANIFOLDS TO INSTALL REAR MANIFOLD REPL TIMING CHAIN TENSIONER WITH S50 TENSIONER	7.00	350.00
R/F FOOTWELL HAS HISTORY OF WATER LEAK- REMOVE TRIM TO LIFT UP CARPET, R/F FOOTWELL UNDERPAD IS SATURATED WITH WATER AND MILDEW/PAD NLA, CARPET NLA. REMOVE CARPET, FRONT UNDERPAD TO CLEAN AND ELIMINATE MOLD. TEST FOR WATER LEAKS- MAIN LEAK IS WINDSHIELD SEAL, WINDSHIELD IS WORN. REPL WINDSHIELD NOTE: HEAVY CORROSION AT WINDSHIELD BOTTOM	13.00	1820.00
STOP CORROSION UNDER BATTERY TRAY AS POSSIBLE REMOVE BATTERY, NEUTRALIZE RUST WITH RUST CONVERTER	1.00	140.00
REPL DRIVER'S SEAT OUTER TRIM		
REPR CORROSION AT LOWER EDGES OF WINDSHIELD OPENING SEPARATE BILLING TO ISM		
REPR CIGAR LITER BEST POSSIBLE	0.25	35.00

Qty	Part Number	Part Description	Price
6	11-62-1-312-992	MANIFOLD GASKETS	47.28
2	11-76-1-308-686	EXH. PIPE GASKET	23.28
24	11-62-1-304-755	7-NUT	26.88
1	07-11-9-963-418	SEAL RING	0.94
1	11-31-1-405-081	TENSIONER	157.20
1	52-10-1-934-599	COVER	21.73
1	11-62-1-308-367	7-EXH MANIFOLD	812.25
1	51-31-1-959-969	7-MOULDING (M5)	64.12
1	51-31-1-959-987	7-MOULDING (M5)	12.27
1	51-31-1-959-988	8-MOULDING (M5)	12.27
1	51-31-1-979-077	8-WEATHERSTRIP	131.49
1	SW385GGN	WINDSHIELD	344.93
1	25-11-1-220-912	6-RUBBER BOOT	18.37

Additional Items	Sublet or Add'l Services
	WINDOW REPL
Total Items	Total Sublets
	345.00

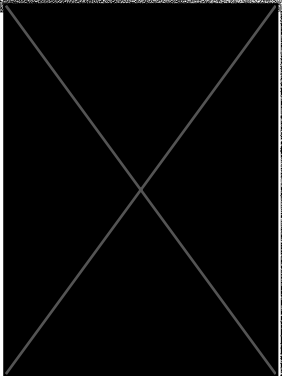
Notes	Totals
	Labor 3017.00
	Parts 1673.01
	Supplies 0.00
	Sublets 345.00
	Add'l Items 0.00
	Subtotal 5035.01
	Tax 146.39
Next service due on: ???	Total 5181.40

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD153774

1641 Jackson Street, San Francisco, CA, 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 64376

Name Addr.		
Phone		
B- Name B-Addr.		
B-Phone Prod Date V.I.N. #		
11/87 E28/S38/5SPD 2875263		

Inv. Date S.O. Date QC'd by Salesman Division	12/02/14 09/24/14 36 DB SS	Year Make Model Color Miles Lic #	1988 BMW M5 SCHWARZ 134873 2WOK235
---	--	--	---

Service Description	Hrs.	Lab\$
REPL REAR EXHAUST MANIFOLD #36 HAD TO REMOVE BOTH MANIFOLDS TO INSTALL REAR MANIFOLD REPL TIMING CHAIN TENSIONER WITH S50 TENSIONER	7.00	980.00
R/F FOOTWELL HAS HISTORY OF WATER LEAK- REMOVE TRIM TO LIFT UP CARPET, R/F FOOTWELL UNDERPAD IS SATURATED WITH WATER AND MILDEW/PAD NLA, CARPET NLA. REMOVE CARPET, FRONT UNDERPAD TO CLEAN AND ELIMINATE MOLD. TEST FOR WATER LEAKS- MAIN LEAK IS WINDSHIELD SEAL, WINDSHIELD IS WORN. REPL WINDSHIELD NOTE: HEAVY CORROSION AT WINDSHIELD BOTTOM	13.00	1820.00
STOP CORROSION UNDER BATTERY TRAY AS POSSIBLE REMOVE BATTERY, NEUTRALIZE RUST WITH RUST CONVERTER	1.00	140.00
REPL DRIVER'S SEAT OUTER TRIM		
REPR CORROSION AT LOWER EDGES OF WINDSHIELD OPENING SEPARATE BILLING TO ISM		
REPR CIGAR LITER BEST POSSIBLE	0.25	35.00

Qty	Part Number	Part Description	Price
6	11-62-1-312-992	MANIFOLD GASKETS	47.28
2	11-76-1-308-686	EXH. PIPE GASKET	23.28
24	11-62-1-304-755	7-NUT	26.88
1	07-11-9-963-418	SEAL RING	0.94
1	11-31-1-405-081	TENSIONER	157.20
1	52-10-1-934-599	COVER	21.73
1	11-62-1-308-367	7-EXH MANIFOLD	812.25
1	51-31-1-959-969	7-MOULDING (M5)	64.12
1	51-31-1-959-987	7-MOULDING (M5)	12.27
1	51-31-1-959-988	8-MOULDING (M5)	12.27
1	51-31-1-979-077	8-WEATHERSTRIP	131.49
1	SW385GGN	WINDSHIELD	344.93
1	25-11-1-220-912	6-RUBBER BOOT	18.37

Additional Items		Sublet or Add'l Services	
		WINDOW REPL	345.00
Total Items			
Total Sublets		345.00	

Totals	
Labor	3017.00
Parts	1673.01
Supplies	0.00
Sublets	345.00
Add. Items	0.00
Subtotal	5035.01
Tax	146.39
Total	5181.40

Notes	
Next service due on: ???	

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street San Francisco, CA. 94109 415-567-8000

Service Invoice: 64376

Hrs. 19h5



11/87 E28/S38/5SPD
2875263

NEEDS INNER SHIFT BOOT AND FOAM INSULATION- REPLACED

DEEP CLEAN CARPET
BILLED SEPARATELY

Service Description	Hrs.	Labs
NOTE NEEDS INNER SHIFT BOOT AND FOAM INSULATION- REPLACED DEEP CLEAN CARPET BILLED SEPARATELY	0.30	42.00

Additional Items		Sublet or Add'l Services	
		WINDOW REPL	345.00
Total Items			
Notes			
Next service due on: ???			

Totals	
Labor	3017.00
Parts	1673.01
Supplies	0.00
Sublets	345.00
Add'l Items	0.00
Subtotal	5035.01
Tax	146.39
Total	5181.40

(Page 2 of 2)

Totals	
Labor	3017.00
Parts	1673.01
Supplies	0.00
Sublets	345.00
Addl. Items	0.00
Subtotal	5035.01
Tax	146.39
Total	5181.40

(Page 2 of 2)

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Service Invoice: 64376

Hrs. Lab\$

Journal of Interpersonal Violence 28(10) 1976-1994
© The Author(s) 2013
Reprints and permissions:
<http://www.sagepub.com/journalsPermissions.nav>

10

11/87 E28/S38/5SPD

2875263

NEEDS INNER SHIFT BOOT AND FOAM INSULATION-REPLACED

DEEP CLEAN CARPET
BILLED SEPARATELY

Service Description	Hrs.	Lab\$
NOTE NEEDS INNER SHIFT BOOT AND FOAM INSULATION. REPLACED DEEP CLEAN CARPET BILLED SEPARATELY	0.30	42.00

Additional Items		Sublet or Add'l Services	
		WINDOW REPL	345.00
Total Items			
Notes		Totals	
		Labor	3017.00
		Parts	1673.01
		Supplies	0.00
		Sublets	345.00
		Addl Items	0.00
		Subtotal	5035.01
		Tax	146.39
Next service due on: ???		Total	5181.40

(Page 2 of 2)

(Page 2 of 2)

1641 Jackson Street, San Francisco, CA 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 65300

Name		
Addr.		
Phone		
B- Name		
B-Addr.		
B-Phone		
Prod Date	11/87 E28/S38/SSPD	
V.I.N. #	2875263	

Inv. Date	12/29/14	Year	1988
S.O. Date	12/22/14	Make	BMW
QC'd by	36	Model	M5
Salesman	DT	Color	SCHWARZ
Division	SS	Miles	134933
		Lic #	2MOK235

Service Description
ALT BELT CAME OFF, WATER PUMP SEIZED #36
REPL WATER PUMP, BELTS

Hrs. 3.50
Lab\$ 490.00

NOTE: REAR WINDOWS OKAY, REAR LOCKOUT SWITCH WAS
ACTIVATED, DEACTIVATED SWITCH AND CHECKED FUNCTIONS - OKAY.

Qty	Part Number	Part Description	Price
1	64-52-1-711-056	BELT 13X800	16.07
1	32-42-1-706-750	BELT 9.5X888	12.17
1	11-22-1-706-788	BELT 13X1040	13.13
1	11-51-1-312-539	RMFD WATER PUMP	181.45
8	82-14-1-467-704Q	COOLANT(QUARTS)	22.72
1	FEE	COOLANT RECYCLING	1.60

Additional Items	Sublet or Add'l Services
Total Items	Total Sublets
	0.00

Notes	Totals
	Labor 490.00
	Parts 247.14
	Supplies 0.00
	Sublets 0.00
	Add'l Items 0.00
	Subtotal 737.14
	Tax 21.48
Next service due on: ???	Total 758.62

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar No. AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000

Phaedrus Independent BMW, Inc.

Service Invoice: 65300

Name		
Addr.		
Phone		
B-Name		
B-Addr.		
B-Phone		
Prod. Date	11/87 E28/S38/5SPD	
V.I.N. #	2875263	

Inv. Date	12/29/14	Year	1988
S.O. Date	12/22/14	Make	BMW
QC'd by	36	Model	M5
Salesman	DT	Color	SCHWARZ
Division	SS	Miles	134933
		Lic #	2MOK235

Service Description
 ALT BELT CAME OFF, WATER PUMP SEIZED #36
 REPL WATER PUMP, BELTS

NOTE: REAR WINDOWS OKAY, REAR LOCKOUT SWITCH WAS ACTIVATED, DEACTIVATED SWITCH AND CHECKED FUNCTIONS - OKAY.

Hrs.	Lab's
3.50	490.00

Qty	Part Number	Part Description	Price
1	64-52-1-711-056	BELT 13X800	16.07
1	32-42-1-706-750	BELT 9.5X888	12.17
1	11-22-1-706-788	BELT 13X1040	13.13
1	11-51-1-312-539	RMFD WATER PUMP	181.45
8	82-14-1-467-7040	COOLANT(QUARTS)	22.72
1	FEE	COOLANT RECYCLING	1.60

Additional Items	Sublet or Add'l Services
Total Items	Total Sublets
	0.00

Notes	Totals
	Labor 490.00
	Parts 247.14
	Supplies 0.00
	Sublets 0.00
	Add'l Items 0.00
	Subtotal 737.14
	Tax 21.48
	Total 758.62

Thank you for giving us the opportunity to service your vehicle. If you notice any problems or have any concerns about these repairs, please call us immediately. Bar Nv, AD159774

1641 Jackson Street, San Francisco, CA. 94109 415-567-8000