




Tuttle Motorsports

4395 U.S. 158
Advance, NC 27006
(336) 298-1022
sales@tuttlemotorsportsnc.com
http://www.tuttlemotorsportsnc.com

Invoice for RO #1984

Service Advisor: K T
Posted Date: 02/26/26 at 06:10 PM EST
Client: Mark Landers
Vehicle: 1994 Jaguar XJS 2+2

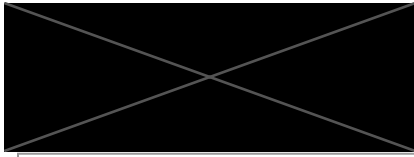

1994 Jaguar XJS 2+2 4.0L 6Cyl GAS AJ16
Naturally Aspirated
VIN: SAJNX2741RC193956
License: LVMY CAT
Color: N/A
Odometer In: 88638 / Out: 88647

RO # 1984

Client Concerns

C/S CEL light is on; inquired about reading codes and communicating with vehicle

Finding: Displayed DTC is FF17 Throttle Potentiometer is out of range. Inspected throttle body, visually OK. Actuated throttle manually to check that it operates its full range. Back-probed connector for throttle potentiometer and verified 5V reference and voltage change while throttle valve is opening and closing. Fault memory has been resolved. Vehicle was test driven and operated OK. No issues while the engine is idling or while accelerating were experienced at this time. No check engine light or fault codes at this time.

Check hydraulic fluid for convertible top

Finding: Convertible top pump is leaking fluid

Check AC compressor

Finding: Compressor clutch will kick on briefly when AC is commanded on but will not stay on

1 - Vehicle Diagnosis

Tech: T F

Note: CEL light is on; inquired about reading codes and communicating with vehicle

Displayed DTC is FF17 Throttle Potentiometer is out of range. Inspected throttle body, visually OK. Actuated throttle manually to check that it operates its full range. Back-probed connector for throttle potentiometer and verified 5V reference and voltage change while throttle valve is opening and closing. Fault memory has been resolved. Vehicle was test driven and operated OK. No issues while the engine is idling or while accelerating were experienced at this time. No check engine light or fault codes at this time.

Labor: Electrical/Mechanical Diagnostic Fee (up to 1hr)

✓ Approved on 10/13/25 at 02:00 PM EDT

Subtotal \$150.00 + est. Tax \$10.13

\$160.13

2 - General Vehicle Check w/ Fault Scan

Tech: K L

Note: Technician Visual Inspection Report:

- Brake Fluid Level/Condition: Brake Fluid Moisture content >4%
- Service Warning Indicator(s):
 - Check Engine Light ON
 - ABS Light ON
 - Parking Brake light on without parking brake engaged
- Inspect Suspension/Undercarriage:
 - All rear radius arm bushings are torn
 - Driver side rear subframe bushings are missing hardware
 - Both front sway bar end links are worn out
- Differential/Transfer Case: Rear Differential is leaking
- Additional Safety Concerns/Tech Notes: Convertible Top Pump is leaking fluid
- Fluid Leaks:
 - Power Steering line from reservoir to pump is leaking
 - Rear Differential leaking
- Engine Belts & Hoses: Belts look to be in good condition but there is a squeal on start-up

Labor: General Vehicle Check w/ Fault Scan Fee (up to 1hr)

✓ Approved on 01/20/26 at 10:00 AM EST

Subtotal \$100.00 + est. Tax \$6.75

\$106.75

3 - Brake Hydraulic System Bleeding - DOT4

Tech: K L

Note: Bled hydraulic braking system with OEM DOT4 Fluid to reduce overall moisture content within. Topped off brake fluid reservoir and verified proper brake pedal pressure.

Labor: Bleed Brake Hydraulic System
Part: Textar DOT4 LV Brake Fluid - 1L

2

✓ Approved on 01/20/26 at 10:00 AM EST

Subtotal \$285.58 + est. Tax \$19.28

\$304.86

Thank you for your business! The work is complete and your payment is due upon pickup of the vehicle. If you choose to finance payment of your invoice through affirm or klarna or other BNPL option, a 5% processing fee will be added to the total invoice in order to cover fees imposed upon our shop by the financing company. This payment will be due upon pickup of the vehicle and may not be included in original estimate or invoice.

Unless otherwise prearranged, vehicle must be picked up within 48 hours of final invoice receipt. Failure to pick up vehicle within this time frame may result in storage fees of up to \$45 per day.

Warranty info: Unless otherwise stated, from the date of delivery for a period of [24] months or [24,000] miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. Neglect or abuse of vehicle will immediately void any and all warranties.

Once a client has taken possession of the vehicle following the completion of services or repairs, Tuttle Motorsports shall no longer be liable for any damages, defects, or malfunctions occurring to the vehicle after it leaves the premises of Tuttle Motorsports or any failures of components, systems, or parts that were not directly serviced or repaired by Tuttle Motorsports. Tuttle Motorsports is not responsible for the failure, damage, or wear of components or parts that are adjacent to, connected to, or affected by the parts or systems repaired by Tuttle Motorsports.


Work Authorization Signature:

Total Labor: \$468.75
Total Parts: \$53.70
Total Fees: \$13.13
Subtotal: \$535.58
Taxes: \$36.15
Grand Total: \$571.73
BALANCE DUE: \$0.00

X _____

✓ PAID

Payment History

Date	Customer Name	Payment Method	Amount	Payment Info	Transaction Details	Signature
02/26/2						



Twin City Euro
3480 Vest Mill Road
Winston-Salem, NC 27103
(336) 310-6484
twincityeuro@gmail.com
<https://twincityeuronc.net/>

Invoice for RO #7797

Service Advisor: Jacob Fearington
Posted Date: 09/03/25 at 01:29 PM EDT
Client: Mark Landers
Vehicle: 1994 Jaguar XJS 2+2

1994 Jaguar XJS 2+2 4.0L 6Cyl GAS AJ16
Naturally Aspirated
VIN: SAJNX2741RC193956
License: LVMYCAT
Color: N/A
Odometer: INOP

RO # 7797
Save Parts: No

Client concerns:

- Battery is dead and thinks it may have a draw.
- Taillights/Brake lights are not working.

1 - Diagnose Client's Concerns

Note:

- Found the battery to be very weak. We will replace it under warranty while the vehicle is here.

Labor:	Battery is dead and thinks it may have a draw. He hasn't cranked it in about two weeks and the battery was dead. He has to jump it a few times since battery was put in back in April.	\$0.00
--------	--	--------

✓ Approved on 08/21/25 at 12:50 PM EDT

0

0

2 - Diagnose Client's Concerns

Note:

- The technician noted that the rear running lights were not functioning, while the brake lights and turn signals were operating correctly. Additionally, the dash lights, front and rear marker lights, and license plate lights were also not functioning.
- The technician performed a thorough inspection, tracing the wiring from the rear of the vehicle to the front. The issue was traced to a faulty headlight relay, which was causing the lighting malfunction. The relay socket was cleaned, and the faulty relay was replaced with a new unit.
- After replacement, all lights are now functioning properly.

Labor:	Was told the taillights/brake lights are not working, but when it was towed in the brake lights were working.	\$250.00
--------	---	----------

Part:	Relay	1	\$25.59
-------	-------	---	---------

✓ Approved on 08/25/25 at 11:48 AM EDT

Subtotal \$275.59 + est. Tax \$19.29

\$294.88

3 - Warranty Battery Replacement

Note:

Labor:	Remove and Replace Battery	\$0.00
--------	----------------------------	--------

Part:	Battery 650CAA -60 Amp Hour	1	\$0.00
-------	-----------------------------	---	--------

✓ Approved on 08/28/25 at 01:25 PM EDT

0

0

I hereby authorize the above repair work to be completed and hereby grant Twin City Euro and employees permission to operate the vehicle for testing and inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. All Parts removed will be discarded unless instructed otherwise and are only saved as requested. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE. Storage fees start once vehicle isn't picked up within 3 days of work being completed or declined. Day 10 results in car being reported to the DMV as abandoned in accordance with NC State Law G.S. §20-77(d) Due to the nature of design on vehicles small incidentals are needed during repairs, by authorizing repairs you also authorize a 10% window to cover incidentals such as hardware, gaskets, seals, small parts and etc. When working with aftermarket warranty companies on client's behalf, the client hereby authorizes to cover the cost of administration fees, diagnostics and cost that isn't covered or paid for by aftermarket warranty companies. We do not sell, work for, represent or speak on behalf of these companies. This may also add to the timeline of repairs. The vehicle can't be picked up until warranty company has paid for repairs. These companies work at their own pace and any delays, approval, disapproval and method of their operations are not within our control. Warranty on parts and labor is 3 years/36k miles, whichever comes first unless otherwise stated. This is subject to where parts are sourced and the vendor's warranty although we stand behind our workmanship. Air cooled and vintage car warranties are case by case. As we stand behind our workmanship fully we ask that you understand that modern parts quality is not what is used to be and we unfortunately fall subject to vendor/manufacture warranties on parts and labor warranty is not offered. We will support you in any way possible!

Total Repair Order & Signature:

Total Jobs:	\$275.59
Total Fees:	\$0.00
Subtotal:	\$275.59
Taxes:	\$19.29
Grand Total:	\$294.88
BALANCE DUE:	\$0.00

X

✓ PAID

Completed Transactions

09/03/25



Twin City Euro
3480 Vest Mill Road
Winston-Salem, NC 27103
(336) 310-6484
twincityeuro@gmail.com
<https://twincityeuronc.net/>

Invoice for RO #7

Service Advisor: Jacob Fearing
Posted Date: 05/22/25 at 11:15 AM EDT
Client: Mark Landers
Vehicle: 1994 Jaguar XJS 2+2

1994 Jaguar XJS 2+2 4.0L 6Cyl GAS AJ16
Naturally Aspirated
VIN: SAJNX2741RC193956
License: LVMYCAT
Color: N/A
Odometer In: 88599 / Out: 88600

RO # 7164
Save Parts: No

Client concerns:

- AC

1 - Perform A/C System Function Test and Diagnostics.

Note:

• Tested the A/C system and found it to be 1.5 lbs. low on refrigerant. Performed a vacuum test, and the system held, indicating no major leaks. Recharged the system with refrigerant, added oil and UV dye for future leak detection. The A/C is currently functioning properly.

Labor:	Blowing cool but not cold.		\$132.00
Parts:	Refrigerant	2	\$50.00
	Refrigerate Oil	1	\$45.00

✓ Approved on 05/22/25 at 09:56 AM EDT

Subtotal \$227.00 + est. Tax \$15.89

\$242.89

I hereby authorize the above repair work to be completed and hereby grant Twin City Euro and employees permission to operate the vehicle for testing and inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. All Parts removed will be discarded unless instructed otherwise and are only saved as requested. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE. Storage fees start once vehicle isn't picked up within 3 days of work being completed or declined. Day 10 results in car being reported to the DMV as abandoned in accordance with NC State Law G.S. §20-77(d) Due to the nature of design on vehicles small incidentals are needed during repairs, by authorizing repairs you also authorize a 10% window to cover incidentals such as hardware, gaskets, seals, small parts and etc. When working with aftermarket warranty companies on client's behalf, the client hereby authorizes to cover the cost of administration fees, diagnostics and cost that isn't covered or paid for by aftermarket warranty companies. We do not sell, work for, represent or speak on behalf of these companies. This may also add to the timeline of repairs. The vehicle can't be picked up until warranty company has paid for repairs. These companies work at their own pace and any delays, approval, disapproval and method of their operations are not within our control. Warranty on parts and labor is 3 years/36k miles, whichever comes first unless otherwise stated. This is subject to where parts are sourced and the vendor's warranty although we stand behind our workmanship. Air cooled and vintage car warranties are case by case. As we stand behind our workmanship fully we ask that you understand that modern parts quality is not what is used to be and we unfortunately fall subject to vendor/manufacture warranties on parts and labor warranty is not offered. We will support you in any way possible!

Total Repair Order & Signature:

Total Jobs: \$227.00
Total Fees: \$0.00
Subtotal: \$227.00
Taxes: \$15.89
Grand Total: \$242.89
BALANCE DUE: \$0.00

X

✓ PAID

Completed Transactions



Twin City Euro
3480 Vest Mill Road
Winston-Salem, NC 27103
(336) 310-6484
twincityeuro@gmail.com
<https://twincityeuronc.net/>

Invoice for RO #6838

Service Advisor: Jacob Fearington

Date Created: 04/01/25 at 06:19 PM EDT

Client: Mark Landers

Vehicle: 1994 Jaguar XJS 2+2

1994 Jaguar XJS 2+2 4.0L 6Cyl GAS AJ16
Naturally Aspirated
VIN: SAJNX2741RC193956
License: LVMYCAT
Color: N/A
Odometer In: 88558 / Out: 88564

RO # 6838
Save Parts: No

Client concerns:

- Look over for anything needed

1 - Diagnose Client's Concerns

Note: Vehicle is in good shape and was taken care of when someone was driving prior to being parked. It does need a battery and hood struts. Valve cover gasket is leaking oil and it needs an ignition tune up. Transmission cooler lines are leaking so bad the ATF is all out and the transmission can't drive the vehicle. Need to repair cooler lines first and service transmission to get driving. Recommend repairing lines versus replacing as there are several variants and they are expensive. Needs oil change and brakes due to wear and corrosion from sitting. Rear diff we recommend cleaning and seeing if it leaks down. AC and lights work and wipers. Belts look good. Needs some general service work. ABS light is on, we are unable to diagnose that system unfortunately due to age and nature of the design of the vehicle. It also does have some worn out harnesses on a couple ABS sensors. Vehicle is now driving well and will need driven after sitting and there may be some kinks to work out. We did not touch or operate the convertible top to avoid any unforeseen things there. We do not repair convertible tops.

Labor: Look over for anything needed \$0.00

✓ Approved on 04/01/25 at 06:19 PM EDT

0

0

2 - Battery

Note: Replaced main vehicle battery and found cable lead was broken. Repaired and got cables attached properly

Labor:	Remove & Replace Battery		\$55.00
	Repair battery cable end - broken		\$55.00
Part:	Primary Vehicle Battery	1	\$198.26

✓ Approved on 04/11/25 at 11:55 AM EDT

Subtotal \$308.26 + est. Tax \$21.58 **\$329.84**

3 - Replace defective Hood Struts

Part:	Hood Strut	2	\$58.24
-------	------------	---	---------

✓ Approved on 04/11/25 at 11:55 AM EDT

Subtotal \$58.24 + est. Tax \$4.08 **\$62.32**

4 - Remove & Replace Valve Cover Gasket due to oil leak

Labor:	Remove & Replace Valve Cover Gasket due to oil leak		\$220.00
Part:	Valve Cover Gasket Set	1	\$85.04

✓ Approved on 04/11/25 at 11:55 AM EDT

Subtotal \$305.04 + est. Tax \$21.35 **\$326.39**

5 - Perform Ignition System Overhaul

Note: Performed ignition overhaul, cap and rotor were very burnt on contacts inside. The spark plugs were fouled out and worn as well.

Labor:	Perform Ignition System Overhaul		\$198.00
Parts:	OEM Distributor Cap	1	\$98.25
	Distributor Rotor	1	\$53.23
	Ignition Wire Set Without Coil Boot	1	\$288.51
	Spark Plug	6	\$116.88

✓ Approved on 04/11/25 at 11:55 AM EDT

Subtotal \$754.87 + est. Tax \$52.84 **\$807.71**

6 - Drain & Refill Transmission Fluid after repairs

Note: After repairs and servicing the transmission it is now operating as it should and vehicle is now driveable at this time.

Labor:	Drain & Refill Transmission Fluid after repairs			\$264.00
Parts:	Auto Trans Fluid TOPTEC 1200 5L	3		\$297.66
	Transmission Service Kit	1		\$39.89

✓ Approved on 04/11/25 at 11:55 AM EDT

Subtotal \$601.55 + est. Tax \$42.11

\$643.66

7 - Liqui Moly Oil Change (8.5 QT)

Labor:	Liqui Moly Oil Change (8.5 QT)			\$56.25
Parts:	Full Synthetic Oil	1		\$108.95
	Oil Filter	1		\$19.69

✓ Approved on 04/11/25 at 11:55 AM EDT

Subtotal \$184.89 + est. Tax \$12.94

\$197.83

8 Remove & Replace Front Brake Pads, Rotors and Calipers, repack front wheel bearings and paint hub and calipers. Calipers are seized on the front brakes.

Note: Front calipers were seized and stuck to the rotors, fortunately there were two new ones in the vehicle so we installed those during repairs. Cleaned front hubs and painted those and the calipers. Packed wheel bearings and put everything together. Front brakes are now operating normally.

Labor:	Remove & Replace Front Brake Pads, Rotors and Calipers, repack front wheel bearings and paint hub and calipers. Calipers are seized on the front brakes.			\$440.00
Parts:	Brake Pad Set	1		\$77.88
	Brake Disc	2		\$196.68
	Front brake caliper that was in the car - Used what is in vehicle - no warranty	2		\$0.00

✓ Approved on 04/11/25 at 11:55 AM EDT

Subtotal \$714.56 + est. Tax \$50.02

\$764.58

9 - Remove & Replace Rear Brake Pads and Rotors

Note: Replaced rear brakes and found hoses collapsed internally, they will need replaced to restore fluid flow.

Labor:	Remove & Replace Rear Brake Pads and Rotors			\$240.00
Parts:	Brake Pad Set w/ Shims	1		\$60.78
	Brake Pad Sensor	2		\$57.46
	Brake rotor that was in car - No warranty	2		\$0.00

✓ Approved on 04/11/25 at 11:55 AM EDT

Subtotal \$358.24 + est. Tax \$25.08

\$383.32

10 - Repair Transmission Oil Cooler Lines

Note: Repaired transmission lines to save client money and since there are many variants of lines that are also expensive. Repaired and they are no longer leaking at crimps and hoses where they meet the lines.

Labor:	Repair Transmission Oil Cooler Lines			\$330.00
Part:	Pressure hose and fittings	1		\$30.00

✓ Approved on 04/11/25 at 11:55 AM EDT

Subtotal \$360.00 + est. Tax \$25.20

\$385.20

11 - Coolant System Flush

Labor:	Coolant System Flush			\$220.00
Parts:	Radiator Cleaner Concentrate 300ML	1		\$16.13
	Coolant	1		\$36.99

✓ Approved on 04/11/25 at 11:55 AM EDT

Subtotal \$273.12 + est. Tax \$19.12

\$292.24

12 - Replace Deteriorated Wipers

Part:	Window Wiper Blade 15"	2		\$16.58
-------	------------------------	---	--	---------

✓ Approved on 04/17/25 at 12:46 PM EDT

Subtotal \$16.58 + est. Tax \$1.16

\$17.74

13 - Replace front brake calipers due to pistons being seized. Replace hoses also. Flush brake system

Note: Replaced defective brake hoses and had to flush all the brake fluid and bleed brakes. Brakes are now operating as they should at this time.

Labor:	Replace front brake calipers due to pistons being seized. Replace hoses also. Flush brake system		\$132.00
Parts:	Brake Hydraulic Hose	2	\$91.72
	Brake Hydraulic Hose	1	\$27.97
	Front Brake Calipers Found in The Car - No warranty	1	\$0.00
	Brake Hydraulic Hose	1	\$27.97

✓ Approved on 04/17/25 at 12:46 PM EDT

Subtotal \$279.66 + est. Tax \$19.58

\$299.24

14 - Replace broken rear subframe mounts to resecure rear drive axle, rubber has come apart

Labor:	Replace broken rear subframe mounts to resecure rear drive axle, rubber has come apart		\$240.00
Part:	Suspension Subframe Mount	4	\$183.68

✓ Approved on 04/17/25 at 12:46 PM EDT

Subtotal \$423.68 + est. Tax \$29.66

\$453.34

15 - Gas

Sublet:	Gas		\$15.00
---------	-----	--	---------

✓ Authorized on 04/17/25 at 12:46 PM EDT

Subtotal \$15.00 + est. Tax \$1.05

\$16.05

I hereby authorize the above repair work to be completed and hereby grant Twin City Euro and employees permission to operate the vehicle for testing and inspection. Express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. All Parts removed will be discarded unless instructed otherwise and are only saved as requested. NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE. Storage fees start once vehicle isn't picked up within 3 days of work being completed or declined. Day 10 results in car being reported to the DMV as abandoned in accordance with NC State Law G.S. §20-77(d) Due to the nature of design on vehicles small incidentals are needed during repairs, by authorizing repairs you also authorize a 10% window to cover incidentals such as hardware, gaskets, seals, small parts and etc. When working with aftermarket warranty companies on cleint's behalf, the client hereby authorizes to cover the cost of administration fees, diagnostics and cost that isn't covered or paid for by aftermarket warranty companies. We do not sell, work for, represent or speak on behalf of these companies. This may also add to the timeline of repairs. The vehicle can't be picked up until warranty company has paid for repairs. These companies work at their own pace and any delays, approval, disapproval and method of their operations are not within out control. Warranty on parts and labor is 3 years/36k miles, whichever comes first unless otherwise stated. This is subject to where parts are sourced and the vendor's warranty although we stand behind our workmanship. Air cooled and vintage car warranties are case by case. As we stand behind our workmanship fully we ask that you understand that modern parts quality is not what is used to be and we unfortunately fall subject to vendor/manufacture warranties on parts and labor warranty is not offered. We will support you in any way possible!

Total Repair Order & Signature:

X

Total Jobs:	\$4,653.69
Total Fees:	\$0.00
Subtotal:	\$4,653.69
Taxes:	\$325.76
Grand Total:	\$4,979.45
BALANCE DUE:	\$4,979.45