

DEADWOODCUSTOMS

REIMAGINED RESTORATION

Deadwood Customs

13073 W Grand Ave

Surprise, AZ. 85374

Phone: (623)-933-9507

<https://www.deadwoodcustoms.com> | info@deadwoodcustoms.com

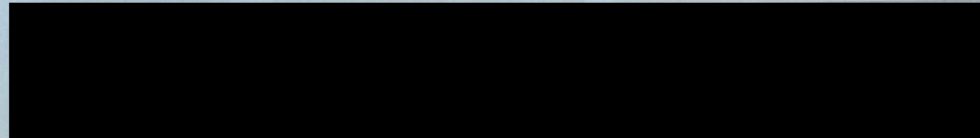
facebook.com/DeadwoodCustoms

Invoice # **0135**

Original Est # 5426

Invoice

Balance Due: \$2,180.35



Work Complete: 09/12/2025
 Service Advisor: David Mascian...
 Customer ID: 12359
 Printed Date: 09/12/2025

Type	Description	Qty/Hr	Sale	Total
Notices				\$0.00

Note Line items noting TIME & MATERIALS estimate labor & parts for typical repair of that type. Actual cost will vary due to unknown parts that need to be procured and unknown time should repair be simpler, or more complicated, than estimated.

Labor time & materials cost will be adjusted based on actual service performed.

Note Line items noting CUSTOMER SUPPLIED PARTS have warranty on labor only (Deadwood Customs warrants parts will be installed correctly according to manufacturer specifications).

Defective parts are expressly not covered by Deadwood Customs warranty. If customer supplied parts are found defective during the part's manufacturer warranty period, removal & re-installation will be at customer expense. Part return handling will be customer responsibility.

Any parts listed on invoice are supplied by Deadwood Customs and covered under standard warranty listed on invoice. All other parts installed are customer supplied, warranty on labor only.

Parts: \$0.00 Labor: \$0.00 Tax: \$0.00 Total: \$0.00

Inspection

Labor	Check-In Inspection Completed vehicle check-in inspection, see attached.	0.30 hr	\$0.00
Labor	SUSPENSION - Inspect rear suspension Inspection found: - vehicle has a bolt-in shock absorber relocation cross member installed - left side bracket from crossmember to frame is missing, bolt holes at subframe are torn from when bracket detached - customer supplied replacement part is incorrect for application, it will move shock geometry and require re-routing rear of exhaust	0.30 hr	\$65.40

Recommend:

- procure equivalent replacement part to keep existing shock absorber geometry the same for fitment
- repair mount locations at subframe

Symptom: Customer states rear shock tower support damaged/detached from vehicle. Customer has replacement part, may need welding to attach. Inspect & estimate repair.

Type Description

Qty/Hr

Sale

Inspection [Continued]

Note Customer requested inspection of vehicle for fit & finish items that may improve aesthetic for value. The following list are suggestions:

Electrical/Underhood:

- wire harness routing & looming can be improved
- A/C receiver drier loose

Steering/Suspension/Drivetrain:

- gear oil leak at axle 3rd member gasket & pinion seal
- transmission mount uses 20 washers (10 on each fastener) to shim for proper driveline angle
- front bump stops hitting springs, one damaged
- right, front shock bottoms out
- headers have hit ground, consider raising front end to prevent further damage

Chassis/Body

- door hinge pins & rollers loose
- fasteners missing in front bumper
- fasteners missing at rear spoiler
- patch hole in trunk floor
- patch holes in cabin floors
- paint floor underside
- chrome trim dented at lower window exterior moldings
- windows are misaligned
- right, front wheel opening molding damaged
- paint chips/defects around body
- dent at right quarter panel, lower section behind rear wheel
- right, rear inner quarter panel filled with body filler
- quarter panel louvers are loose
- align all body panels

Interior

- fasteners/screws missing in some trim panels
- headliner falling down
- A/C hoses visible at front passenger seating position
- refurbish sun visors
- carpet fitment is poor at door sills
- door openings missing interior trim
- headlight switch stalk too long, trim to fit knob

Parts: \$0.00 Labor: \$65.40 Tax: \$0.00 Total: \$65.40

Maintenance (CUSTOMER SUPPLIED PARTS)(TIME & MATERIALS)

Labor	COIL PACK COVER - Install	1.00 hr	\$0.00
	Inspection found vehicle currently has aftermarket valve covers, coil packs are not in factory location. Additionally, vehicle has aftermarket fuel injection harness. FI harness and coil pack location interfere with supplied coil pack covers and prevent proper fitment. Unable to install customer supplied coil pack covers.		
	No work performed.		
	Symptom: At vehicle drop off, customer requested install customer supplied coil pack covers.		
Labor	RADIATOR COVER - Install	0.40 hr	\$0.00
	Installed customer supplied decorative radiator cover.		
	Symptom: At vehicle drop off, customer requested install customer supplied radiator cover.		

Parts: \$0.00 Labor: \$0.00 Tax: \$0.00 Total: \$0.00

Description	Qty/Hr	Sale	Total
ension (TIME & MATERIALS)			\$1,515.74

Labor	SHOCK ABSORBER CROSSMEMBER, REAR - Remove & Replace Performed the following: - removed existing, damaged shock crossmember - cleaned metal around damaged area at subframe in preparation for welding - installed/welded weld-in nuts at damaged subframe to crossmember bolt-in mount locations - test fit new shock crossmember, made necessary adjustments for fitment, clean metal surfaces for welding - final installed crossmember; bolted in as designed to weld-in nuts, welded to subframe for additional strength, painted welded surfaces - installed existing shock absorbers - test drove vehicle; rear suspension functioning normally	6.50 hr		\$1,417.00
-------	---	---------	--	------------

NOTE - during test drive mechanic noted:
 - alternator voltage on dash gauge read 14V while cruising but 12V or lower at idle, 12.6V is required to keep battery charged
 - due to low voltage at idle, electric cooling fans reduce speed
 - A/C does not blow cold
 Symptom: Inspection found damaged rear shock crossmember relocation system.
 Customer supplied part is incorrect for application, repair.

Part	Shock Crossmember Relocation Kit, Rear, 1967-74 Camaro	1.00	\$79.99	\$79.99
Sublet	SHIPPING - Crossmember Kit		\$11.47	\$11.47

Parts: \$79.99 Labor: \$1,428.47 Tax: \$7.28 Total: \$1,515.74

Air Conditioning Service - R-134				\$352.95
---	--	--	--	-----------------

Labor	A/C SYSTEM - Service HVAC, inspect A/C system (R-134a) for proper function Physical Inspection: - A/C belt tension: at spec. - compressor engages: normal - radiator fan function: normal - heater hose condition: good - radiator hose condition: good - blower motor function: normal - A/C vent door operation: normal	1.50 hr		\$327.00
-------	---	---------	--	----------

A/C Service:
 - recovered refrigerant: 0.78lbs
 - evacuated air/moisture: 30 minutes
 - pulled vacuum: 28 in/Hg
 - held vacuum: 45 minutes, no leak indicated
 - charged refrigerant: 1.4 lbs
 - ambient temp: 87F
 - low side pressure @ idle: 30PSI
 - low side pressure @ 1,500RPM: 27PSI
 - high side pressure @ 1,500RPM: 220PSI
 - duct temp: 54F

NOTE - on test drive mechanic noticed driver side kick panel vent is open, mechanism to operate vent missing, unknown if vent door is installed behind kick panel. Opening allows warm outside air into cabin reducing A/C system performance.

Part	Freon, R-134a Size: POUNDS	1.40	\$16.99	\$23.79
------	----------------------------	------	---------	---------

Parts: \$23.79 Labor: \$327.00 Tax: \$2.16 Total: \$352.95

Charging System (TIME & MATERIALS)				\$130.80
---	--	--	--	-----------------

Labor	CHARGING SYSTEM - diagnose starting/charging system Inspection found poor ground at alternator. Added dedicate wire to ground alternator. Test drove vehicle, voltage 13.1V or greater at idle with A/C active, 14.5V or greater when cruising. Charging system operation normal. Symptom: Inspection found charging system drops below 12.6V when at an idle with A/C active, diagnose & repair.	0.60 hr		\$130.80
-------	---	---------	--	----------

Parts: \$0.00 Labor: \$130.80 Tax: \$0.00 Total: \$130.80

Type	Description	Qty/Hr	Sale
Inspection			
Labor	Wash vehicle	0.80 hr	\$0.00
Labor	Checkout Inspection	0.60 hr	\$0.00
	Completed vehicle check-out inspection: - all items nominal		

Parts: \$0.00 Labor: \$0.00 Tax: \$0.00 Total: \$0.00

Order			\$115.46
Misc	Hazardous Materials		\$18.00
Misc	Shop Supplies		\$87.83
Total: \$115.46		Tax: \$9.63	

Thanks for your business! Leave a review on Google or Yelp.
 I hereby authorize the above repair work to be done along with the necessary material and hereby grant Deadwood Customs or assigns permission to operate the vehicle described for testing and/or inspection.

An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

Warranty on labor is 12 months or 12,000 miles, whichever comes first. Deadwood Customs honors parts manufacturer warranty. Performing a warranty repair does not begin a new warranty period. Warranty work must be performed at Deadwood Customs and cannot exceed the original cost of repair.

I hereby assign and grant to Deadwood Customs, the right and permission to use and publish photo/video/electronic representations made of my vehicle while it is under the care of Deadwood Customs, and I release Deadwood Custom and all employees from any and all liability from such use and publication. I waive any right to any compensation for any of the foregoing.

DEADWOOD CUSTOMS IS NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE.

Labor	\$1,940.20
Parts	\$103.78
Sublet	\$11.47
Hazardous Materia	\$18.00
Shop Supplies	\$87.83
Subtotal	\$2,161.28
Taxes	\$19.07
Order Total:	\$2,180.35

Signature _____ Date _____ Time _____
 Technician(s) : Prunier, Matt MATTP; Masciangelo, David DAVIDM; Adams, Preston PRESTONA; D'Andrea, Alex ALEXD

DEADWOODCUSTOMS
REIMAGINED RESTORATION

Deadwood Customs

13073 W Grand Ave
Surprise, AZ. 85374
Phone: 623-933-9507
<https://www.deadwoodcustoms.com>

Date : 09/12/2025

Receipt

info@deadwoodcustoms.com

Received from: [REDACTED]

Paid on Account: 013532

Invoice Amount: **\$2,180.35**

Previous Balance: **\$2,180.35**

Payments:

<u>Date</u>	<u>Type</u>	<u>Authorization</u>	<u>Payment Amount</u>
09/12/2025	Visa	012929	\$2,180.35

Remaining Balance for this Invoice :

PAID

Total Payments on this Receipt: \$2,180.35				Balance Due: = \$0.00
---	--	--	--	--------------------------



PAID

INVOICE # 10369
DATE 10/09/2025
DUE DATE 10/09/2025
TERMS Due on receipt

DATE	ACTIVITY	DESCRIPTION	QTY	RATE	AMOUNT
10/09/2025	Taxable items	Headliner and sail panels	1	212.50	212.50T
10/09/2025	non taxable		1	637.50	637.50

1969 CAMARO

SUBTOTAL 850.00
TAX 19.34
TOTAL 869.34
BALANCE DUE **\$869.34**



Greulich's Automotive #29

16641 W Bell Rd
Surprise, AZ 85388

Phone (623) 223-1035 - Fax (623) 544-6980

5/7/2024

**** R.O. #96602 OF ESTIMATE #38447 ****

Page 1 of 1

Customer:
Address:

Home Phone:
Work Phone:
Cellular Phone:
Email:
Service Writer: KYLE28



Vehicle: 1969 Chevrolet Camaro
License: EX55
Current Mileage: 5000
V.I.N.:
Engine: LS3
Prod. Date:
Color:
Next Service: 8/7/2024, Mileage: 8000

LABOR COMPLETED

TITLE	TECH.	TOTAL \$
Problems/Concerns something hanging back towards the rear and has some type of fluid coming from it	MAYNARD	0.00
-- Vehicle Inspection -- Perform complete inspection of the engine compartment and under carriage of the vehicle. This inspection includes wear items, safety components, factory recommended maintenance, and items that may have failed or failing. Comfort items such as air conditioning and interior components are not included in inspection.	MAYNARD	0.00

*** Continued on Next Page ***

ORIGINAL ESTIMATE: 0.00

All parts that were replaced have been saved for customer inspection. Customer can take the old parts with them as long as all core charges are satisfied if applicable. If the customer does not want old parts they will be disposed of after customer picks up their vehicle. We are not required to hold customers parts after delivery of vehicle.

Payment Type: Visa	TOTAL Labor	214.80
Card #: **9114	TOTAL Parts	63.52
Approval Code: 051001	TOTAL Shop Supplies	23.63
Amount \$: 316.35	TOTAL Hazardous Waste	6.99
Date: 5/7/2024	SUBTOTAL	308.94
Employee: DIANG38174X		7.41
	** TOTAL **	\$316.35

*Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to perform the obligations set forth by the card member's agreement with the issuer.



*SIGNATURE ACKNOWLEDGES RECEIPT OF VEHICLE: X

Thank You For Your Business. 2 Year/24,000 Mile Warranty 877-367-6144
store29@greulichs.com - www.greulichs.com

Hours: Monday Through Saturday 7:30 a.m. - 5:30 p.m. ■ Closed Sunday

LIKE OUR SERVICE, WE'VE STOOD THE TEST OF TIME! SERVING ARIZONA SINCE 1977!

I hereby authorize the repair work to be done along with the necessary material, and hereby grant your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. If automobile is returned to customer before authorized service is performed, a diagnostic and handling charge will be made. I have read and understand the above estimate and terms. I authorize service to be performed, including sublet work, and acknowledge receipt of this estimate. CUSTOMER IS HEREBY NOTIFIED THAT THE SAID PROPERTY IS NOT INSURED OR PROTECTED AGAINST LOSS OCCASIONED BY THEFT, FIRE OR VANDALISM WHILE THE PROPERTY REMAINS WITH OUR FACILITY. NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE. CUSTOMER ACKNOWLEDGES RECEIPT OF A COPY HEREOF. SUBJECT TO CONDITIONS ON REVERSE SIDE OF THIS CONTRACT. PLEASE READ REVERSE SIDE.

FREE LOCAL SHUTTLE SERVICE - SERVICE ON ALL MAKES & MODELS



CarCareONE READ IMPORTANT INFORMATION ON REVERSE SIDE



Greulich's Automotive #29

16641 W Bell Rd

Surprise, AZ 85388

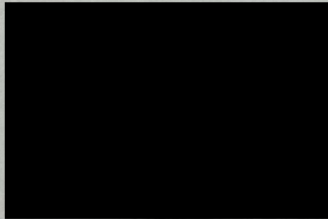
Phone (623) 223-1035 - Fax (623) 544-6980

5/7/2024

**** R.O. #96602 OF ESTIMATE #38447 ****

Page 2 of 1

Customer:
Address:



Home Phone:
Work Phone:
Cellular Phone
Email:
Service Writer:


Vehicle: 1969 Chevrolet Camaro
License: EX55
Current Mileage: 5000
V.I.N.:
Engine: LS3
Prod. Date:
Color:
Next Service: 8/7/2024, Mileage: 8000

-- Inspection Results --

FOUND GAS TANK BREATHER HOSE LOOSE AND HANGING DOWN FROM MOUNTING POINT. RESECURED VENT HOSE / DIFFERENTIAL VENT LEAKING OVERFLOW OF GEAR OIL. DRAINED DIFFERENTIAL TO THE PROPER LEVEL. / HEADLIGHT BROKEN, RECOMMEND REPLACEMENT AND ADJUSTMENT OF HEADLIGHTS. / EXTERIOR DOOR HANDLE LOOSE. RECOMMEND TIGHTENING HANDLE

INSTALL AND ADJUST HEADLIGHT BULB	MAYNARD	89.50
ADJUST EXTERIOR DOOR HANDLE AND TIGHTEN	MAYNARD	125.30

PARTS ISSUED			TECH.	EACH \$	TOTAL \$
QTY.	PART #	DESCRIPTION			
1	-	HEADLIGHT BULB	MAYNARD	63.52	63.52

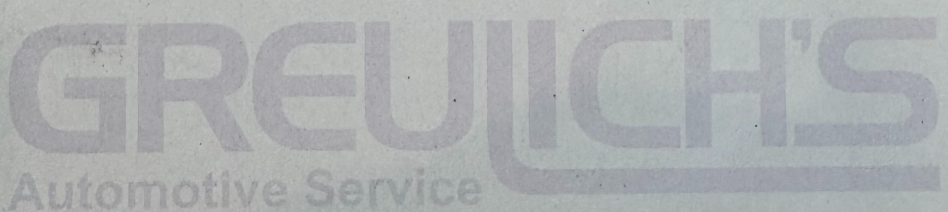

Thank You For Your Business. 2 Year/24,000 Mile Warranty 877-367-6144
store29@greulichs.com - www.greulichs.com

Hours: Monday Through Saturday 7:30 a.m. - 5:30 p.m. ■ Closed Sunday

LIKE OUR SERVICE, WE'VE STOOD THE TEST OF TIME! SERVING ARIZONA SINCE 1977!

I hereby authorize the repair work to be done along with the necessary material, and hereby grant your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. If automobile is returned to customer before authorized service is performed, a diagnostic and handling charge will be made. I have read and understand the above estimate and terms. I authorize service to be performed, including sublet work, and acknowledge receipt of this estimate. CUSTOMER IS HEREBY NOTIFIED THAT THE SAID PROPERTY IS NOT INSURED OR PROTECTED AGAINST LOSS OCCASIONED BY THEFT, FIRE OR VANDALISM WHILE THE PROPERTY REMAINS WITH OUR FACILITY. NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE. CUSTOMER ACKNOWLEDGES RECEIPT OF A COPY HEREOF. SUBJECT TO CONDITIONS ON REVERSE SIDE OF THIS CONTRACT. PLEASE READ REVERSE SIDE.

FREE LOCAL SHUTTLE SERVICE ■ SERVICE ON ALL MAKES & MODELS



CarCareONE READ IMPORTANT INFORMATION ON REVERSE SIDE

1969 Chevrolet Camaro Z/28 Tribute



Stock #	2539-PHX
Engine	350 V8
Transmission	4 Speed Manual
Color	Black
Interior	Black
Mileage	7,653 (Unknown)
Vin #	124379N535698

Chassis

Front Suspension Type	A-Arm with coil springs
Rear Suspension Type	Leaf Springs w/ Shocks
Front Wheel Specification	18"
Rear Wheel Specification	18"
Front Tire Specification	235/45R17
Rear Tire Specification	245/45R18
Front Brakes Specification	Power Disc

Options

AM/FM Radio	Front Disc Brakes
Heat	Power Brakes
Power Steering	Seatbelts
Vinyl Interior	



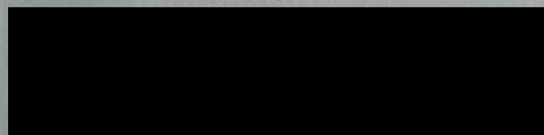
WWW.STREETSIDECCLASSICS.COM

PHOENIX SHOWROOM



Description coming soon, call for details!

With a hot small block, four-on-the-floor, a mean look, and speedy style, this 1969 Chevrolet Camaro is a Z/28 tribute that knows how to deliver both a ton of style and plenty of power. The black has a great sinister look you want on a car like this. It's part of an upgrade that gives the black a nice hard shine of an upper-level driver quality appearance. Plus, the upgraded cowl hood, Z/28 badging, chin spoiler, and rear spoiler all give this plenty of attitude. So it looks like this has earned the white racing stripes painted on top to remind you that it will always be a speedy machine. When it comes to brightwork, not only will you love the chrome bumpers and trim, but also the polished American Racing Torq Thrust wheels. They have a 17/18-inch front/rear stagger to make sure this one has extra shine and the right stance. The darkness continues inside. It's an attractive and driver-ready kind of style that even has nice classic details like working under-dash lights and wide headrests for the front seats. And a retro-style AM/FM stereo subtly adds modern driving music. But above all, this one loves to speak directly to the driver. That means bucket seats up front, a three-spoke... Please ask for the full description.



VIEW OUR COMPLETE INVENTORY NOW

WWW.STREETSIDECCLASSICS.COM

PHOENIX SHOWROOM
614 East Auto Center Dr, Suite 101
Mesa, AZ









614 East Auto Center Dr
Suite 101
Mesa, AZ 85204
(480) 926-1344

Vehicle Purchase Contract

Date: 06/08/22 Stock: 2539-PHX

I, [Redacted] (Customer) and [Redacted] (Customer) agree to purchase the vehicle referenced below under the following terms:


1. Vehicle: Year: 1969 Make: Chevrolet Model: Camaro Z/28 Tribute
2. VIN#: 124379N535698 Color: Black
3. The customer has inspected the vehicle, or has had the opportunity to inspect the vehicle, and accepts the vehicle on an AS-IS basis. 
4. It is Customer's sole responsibility to determine their state's titling and registration requirements for classic/specialty interest/modified vehicles prior to purchasing. Customer agrees to hold Streetside Classics harmless from VIN/safety inspections, emissions testing, or other registration issues that are unique to Customer's state and/or country. 
5. This vehicle is a "For Sale by Owner", displayed at Streetside Classic Cars (Company), who is acting only as a Sales Agent. The Company is not making any representations as to the condition and/or the value of this vehicle. Streetside Classic Cars has not checked the condition (mechanical or structural) or mileage of this vehicle and is relying on the information provided by the seller. The Customer agrees to hold the Company harmless from all future claims arising from any representations made by the seller. By signing this document, the Customer expressly gives up the right to sue the Company for any damage or liability arising from these terms. 
6. This Vehicle is owned by Streetside Classic Cars. However, the Company is not making any representations as to the actual condition and mileage of the vehicle. The Company is not issuing any warranties, verbal or written. Any additional agreements or contracts must be in writing on a separate document known as the Addendum to the Sales Agreement and be signed by a corporate officer of the Company. Sale's staff is not authorized to enter into these agreements. 
7. The Price of the vehicle \$ [Redacted]
8. Trade Allowance \$ _____
9. Dealer Preparation Fee* \$ _____
10. Freight \$ _____
11. Sales Tax \$ _____
12. Titling Fees \$ _____
13. Total Price \$ _____
14. Down Payment/Deposit \$ _____
15. Balance Due (within 7 days of this contract date): \$ _____

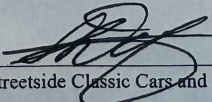
*This charge represents costs and profit to the dealer for items such as inspecting, cleaning and adjusting vehicles, and preparing documents for sale

16. [Redacted]
17. [Redacted]
18. [Redacted]
19. [Redacted]
20. [Redacted]

21. The Company must receive good funds from the Customer in the entire amount within seven days of signing this contract. The funds must be in the form of cash, cashier's check or wire transfer to the Company's bank account. A personal check will be considered good funds once cleared by the issuing bank and funds have been received by the Company's bank.
22. If the Customer fails or refuses to pay for the vehicle after entering into this agreement then the Customer is in violation of this agreement and agrees to pay the Company all funds due immediately upon written demand. The Company reserves the right to sue for breach of contract and collect for damages. The Customer agrees to pay for all costs of collection including legal, along with any amounts due under this agreement. The Customer further agrees to forfeit any deposits to the Company as liquidated damages.
23. This contract shall be governed by the laws of the State of Arizona. Any suits by either party shall be filed in Maricopa County Civil Courts. The Customer understands that by signing this contract he / she / they give up the right to sue the Dealer in any other venue except as stated herein.
24. The Customer authorizes SCC to release this vehicle to a carrier to transport this vehicle to an address designated by the Customer. SCC does not bear any responsibility of shipment other than transferring the vehicle to the carrier, from its showroom, in the condition sold to the Customer. Any issues related to shipping are to be resolved between the Customer and the carrier. SCC assumes no responsibility once the vehicle is delivered to the carrier.

The Customer has read the above and agrees to abide by the terms.

 6.8.2022
Customer Signature and Date

 6/8/22
Streetside Classic Cars and Date



AUDIO EXPRESS #4
 4961-1 W. BELL ROAD
 PHOENIX, AZ 85308
 Phone (602) 938-4199

Invoice	C53644
Date	12-24-22
Store	AE04
Type	Delivery
Printed	122422 13:26
Customer ID	[REDACTED]

Bill to

[REDACTED]

Ship to

[REDACTED]

Warehouse	P/O Number	Delivery Date	Terms	Sold At		Bill to Phones	Ship to Phones
AE04		12-24-22	COD	AE04	Home	(602) 214-9558	(602) 214-9558
Salesperson		Salesperson			Work		
0465 ANDREW MELENDEZ					Cell	(602) 214-9558	(602) 214-9558
1969 CAMARO							

Item Number	Description	Brand	U/M	Order	Ship	List Price	Extended
C2690TX	JL~EVOLUTION C2 6X9 3WAY TRIAX	JLA	EA	1	0	279.99	279.99
C2650X	JL~EVOLUTION C2 6.5" 2WAY COAX	JLA	EA	1	0	279.99	279.99
MX280/4	JL~MX-POWERSPORT 70X4@20HMS	JLA	EA	1	0	329.99	329.99
ACP208LGW3V3	JL AMPLIFIED CP208 DUAL 8" W3	JLA	EA	1	0	929.99	929.99
8604	TOGGLE SWITCH SKU'D SINGLE/EA	VIP	EA	2	0	5.99	11.98
3305V	~VIPER RESPONDER 350 2-WAY SEC	VIP	EA	1	0	299.99	299.99
507M	DIGITAL MOTION/TILT SENSOR	VIP	EA	1	0	79.99	79.99
TC6SW16-500	16AWG SILVER OFC	TRU	FT	75	0	.99	74.25
INSTASPK	STANDARD SPEAKER INSTALL	FRE	EA	2	0	75.00	150.00
TC6KIT-8	8 GUAGE OFC AMP KIT- RETAIL	TRU	EA	2	0	89.99	179.98
KWM875BW	JVC MECHLESS WIRELESS CPLAY/AA	JVC	EA	1	0	629.99	629.99
AE00040	HUSHMAT~PRO 12X12 4 SHEETS	HUS	EA	4	0	59.99	239.96
INSTAAMP	STANDARD MONO/2 CHNL INSTALL	FRE	EA	1	0	110.00	110.00
INSTA4AMP	STANDARD 4 CHNNL AMP INSTALL	FRE	EA	1	0	120.00	120.00
INCUSTOMPRO	CENTER CONSOLE AND STEREO	FRE	EA	1	0	180.00	180.00
SHOP	NECESSARY SHOP SUPPLIES	FRE	EA	1	0	151.47	151.47
TLP100IRC	~CMOS CHROME PLATE FRAME CAM	ACC	EA	1	0	139.99	139.99
INSTACAM	STANDARD CAMERA INSTALL INCLUD	FRE	EA	1	0	100.00	100.00
WARNING	WAIVES FREE EXCHANGE!	FRE	EA	1	0		



18865 Goll St.
San Antonio, TX 78266
www.vintageair.com

Phone: (210) 654-7171
Fax: (210) 654-3113
Toll Free: (800) TO-COOL-U (862-6658)

an ISO 9001:2008 Registered Company

Warranty Extension Request

Vintage Air would like to thank you for your recent purchase. As a Vintage Air customer, you can rest assured that you have purchased the finest equipment and customer service in the industry.

We always recommend the purchase of a **complete system** to ensure properly matched components, peak efficiency, and proper safety switch protection. A **complete system** includes the evaporator, compressor, mounting bracket, hose kit, condenser and safety switch. An added benefit to purchasing a **complete system** is that every component is covered by our **3-year warranty**.

Vintage Air is also pleased to offer several extended warranty options that provide for up to an additional 2 years of protection, for a total warranty period of up to 5 years. These extended warranty plans are offered in addition to our standard warranty, and are governed by the same terms and conditions.

The following extended warranty options are available:

Complete System (Evaporator, Compressor, Mounting Bracket, Hose Kit, Condenser and Safety Switch)

1-Year Extension: \$25.00

2-Year Extension: \$40.00

Evaporator Only

1-Year Extension: \$40.00

2-Year Extension: \$60.00

To purchase an extended warranty, simply choose your preferred option above, and send this form and a check or money order for the applicable amount to Vintage Air along with the completed Warranty Registration Form.

Once again, we thank you for choosing Vintage Air, where we look forward to serving you for many years to come!