

4875/1928

VIN 10704412042625

MERBZ 450CP

Licenses 255TMO

MSG 11-21

ORCAS AUTO-TECH, INC.

35 HOPE LANE
PO BOX 1385

EASTSOUND WA 98245
360-376-5400

NAPA AUTOCARE CENTER

24 HOUR TOWING AND ROADSIDE CALL 376-TOWS (8697)

Repair Order #3421

Vehicle : 1978 Mercedes Benz 450SL 4.5 L 4520 CC V8
VIN : 10704412042625
Created : 11/20/2007 5:33:05 PM

Day Phone : [REDACTED]
Tag/State : 255TMO / WA
Last Mileage : 0
Odometer In : 43851
Odometer Out : 43851

Labor/Notes

Qty	Code/Tech*	Reference	Description	Unit Price	Price
2.6	ES*	B INSP	BUYER INSPECTION	\$80.50	\$209.30

INCLUDES: ROAD TEST VEHICLE. RAISE ON LIFT TO CHECK UNDERCAR CONDITION. CHECK FOR FLUID LEAKS. CHECK BRAKE LININGS. CHECK OVERALL ENGINE AND DRIVETRAIN CONDITION. PERFORM CYLINDER BALANCE TEST. CHECK ALL VEHICLE VITALS. BELTS, HOSES, FILTERS, FLUID LEVELS, STEERING, SUSPENSION AND TIRE CONDITION. RUN COMPRESSION TEST ON ENGINE.
BRAKES: FRONT 4 mm REAR 4 mm PADS
COOLANT: -40 *F

COMPRESSION TEST RESULTS: 1 - 140, 2 - 140, 3 - 140, 4 - 145, 5 - 148, 6 - 150, 7 - 150, 8 - 150
- CONCERNS THIS VEHICLE HAS THE FOLLOWING CONCERNS:

THE TRANSMISSION OIL PAN GASKET AND THE BANJO BOLT THAT HOLDS THE TRANSMISSION DIPSTICK ARE LEAKING FLUID.
THE BATTERY TESTS LOW AND HAD TO BE CHARGED DURING THE COMPRESSION TEST.
THE ENGINE WAS 1 QUART LOW ON OIL.
THE A/C COMPRESSOR CLUTCH IS LEAKING OIL, NEEDS TO BE REPLACED.

Roundt
EST
#225
150.-

Parts

Qty	Code/Tech*	Reference	Description	Condition	Unit Price	Price
1	NOL	10W30	OIL		\$2.85	\$2.85

THANK YOU
PD VISA

Labor		\$209.30
Parts		\$2.85
Sublet/Misc.		\$0.00
Shop Supplies		\$8.37
Charges		\$0.00
Sales Tax	Tax @ \$220.52 * 7.7000%	\$16.98
Repair Total		\$237.50

Tech Certification #
ES



The Mercedes Specialists

Independent Servicing Since 1985

340 Bellevue Way N.E. Bellevue, WA 98004 (425) 454-2937

CHRIS SIDEBOTHAM
16055 SE 135th
RENTON WASH 98059

REPAIR ORDER

19924

Name: [Redacted] Date: 5/20/08

Address: [Redacted] Year: 1978 Model: 450SL Make: Engine: Odometer: 44280 License: 255TMO Chassis: 107

Qty	PART DESCRIPTION	Price	MB Services	C	#1	#2	#3	#3Z				
	INJECTORS	448 ⁰⁰	Oper No. INSTRUCTIONS REPLACED INJECTORS - HOLDERS + SEALS ALSO CHECKED AND ADJUSTED INJECTION SYSTEM + IDLE. PUT CARBON REMOVER IN FUEL Plus - REPAIRED 2 CRACKED VACUUM LINES + REPLACED 1 THROTTLE LINKAGE HINGE-BALL. REPLACED 212° FRONT FAN SWITCH BRAKES - REPLACED LEAKING MASTER CYLINDER + BLEED									
	INJECTOR SEALS + O-RINGS	24 ⁴⁰										
	INJECTOR HOLDERS	25 ⁷²										
	BRAKE MASTER CYLINDER	326 ⁰⁰										
	212° FRONT FAN SWITCH	36 ⁷⁸										
	PARTS NEEDED											
	INJECTION SYSTEM MIGHT NEED TO BE RE ADJUSTED										N/C	
	AFTER RUNNING FOR A WHILE										95 ⁰⁰	
	* TRANSMISSION MIGHT HAVE A CRACK IN IT AT THE DIPSTICK FITTING. FROM PREVIOUSLY OVER TIGHTENING											
	Total	824 ¹²									351 ⁰⁰	

Qty	FLUIDS ADDED	Price	C SERVICE	OK	Need	FLUIDS	OK	Added
	Oil & Filter					Engine		
	Brakes					Transmission		
	Belts					Radiator		
	Hoses					Washer		
	Tires					Battery		
	Lights					Rear End		
	Alignments					Suspension		
						Power Steering		

	Qts. Oil							
	Qts. Transmission							
	Gal. Anti Freeze							
1	Pts Brake Fluid	8 ⁴⁰						
	Qts. Washer Fluid							
	Pts. Gear Oil							
	Lbs. Freon							
	Pts. Hydraulic							
	Pts. Power Steering							
	Total							

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. Any express mechanic's lien is acknowledged on above vehicle to secure the amount or repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft accident or any other cause beyond your control. I agree to pay reasonable storage on vehicle left more than 48 hours after notification that repairs are completed.

I FORGOT TO ADD →

Labor	351 ⁰⁰
Parts	824 ¹²
Gas/Oil/Fluids	8 ⁰⁰
Sublet FRONT FAN SW.	36 ⁷⁸
Hazardous Waste	
Sub Total	1219 ⁹⁰ 1183 ¹²
Tax	109 ⁷⁹ 1064 ⁸
TOTAL	1289⁶⁰

Authorized By _____

\$1329⁶⁹



The Mercedes Specialists
Independent since 1983
1457-154-2821

CHRIS SIDEBAM
10055 SE 188th
BENTON WASH 98005

REPAIR ORDER
1991

SOFT TOP - 650
LEAK 680

CHECK
TO

RANDY RITWALD

1978 Ford

44260 / 252100 107

* I CAN MAKE THE STEERING
TIGHTER IF YOU WANT.

QTY	PART DESCRIPTION	UNIT PRICE	TOTAL PRICE
1	REAR BRAKE PADS	48.00	48.00
1	FRONT BRAKE PADS	62.00	62.00
1	SHOCK STRUTS	14.00	14.00
1	SPRINGS	8.00	8.00
1	THRESHOLD KIT	27.00	27.00
1	AIR FILTER	15.00	15.00
1	AIR PUMP	11.00	11.00
1	REPLACED AIR FINE/PAVE PERS	280.00	280.00
1	INSTRUCTIONS	12.00	12.00

QTY	PART DESCRIPTION	UNIT PRICE	TOTAL PRICE
1	REPLACED THRESHOLD	48.00	48.00
1	FRONT BRAKE PADS	62.00	62.00
1	SHOCK STRUTS	14.00	14.00
1	SPRINGS	8.00	8.00
1	THRESHOLD KIT	27.00	27.00
1	AIR FILTER	15.00	15.00
1	AIR PUMP	11.00	11.00
1	REPLACED AIR FINE/PAVE PERS	280.00	280.00
1	INSTRUCTIONS	12.00	12.00

QTY	PART DESCRIPTION	UNIT PRICE	TOTAL PRICE
1	REAR BRAKE PADS	48.00	48.00
1	FRONT BRAKE PADS	62.00	62.00
1	SHOCK STRUTS	14.00	14.00
1	SPRINGS	8.00	8.00
1	THRESHOLD KIT	27.00	27.00
1	AIR FILTER	15.00	15.00
1	AIR PUMP	11.00	11.00
1	REPLACED AIR FINE/PAVE PERS	280.00	280.00
1	INSTRUCTIONS	12.00	12.00

STARTING TO LEAK

9.91

1100.00
1100.00
1100.00



The Mercedes Specialists

Independent Servicing Since 1985

340 Bellevue Way N.E. Bellevue, WA 98004 (425) 454-2937

REPAIR ORDER

17390

Name	[REDACTED]	Cell	Date	7/3/08
Address		Engine		
City &		Chassis	107	

Qty	PART DESCRIPTION	Price	MB Services	#1	#2	#3	#3Z			
	STEERING PUMP REPAIR KIT	27 ⁷⁰								
			Oper No.	INSTRUCTIONS					Labor	
			①	VOIL LEAK LOCATED PROBLEM IN POWER STEERING PUMP. <u>R+R PUMP</u> →					142 ⁵⁰	
				REBUILT - CLEANED + PAINTED					162 ⁰⁰	
			②	R+R - RADIATOR					191 ⁰⁰	
	PARTS NEEDED			HAD RADIATOR RE CORED AND REPAIRED (DENTED AND BENT)					SUBLET	
	APPEARS THE RADIATOR WAS JACKED UP ON BOTTOM TANK			* THREE TUBE CORE						
			③	ADJUSTED STEERING BOX					114 ⁰⁰	
	3 TUBE CORE			* HAD TO LIFT MOTOR TO GET TO THE ADJUSTER.						
	MEANS - 3 TUBES IN EA. ROW									
	APPROX 30% MORE EFFICIENT									
		Total							609 ⁵⁰	

Qty	FLUIDS ADDED	Price	C SERVICE	OK	Need	FLUIDS	OK	Added
	Qts. Oil		Oil & Filter			Engine		
	Qts. Transmission		Brakes			Transmission		
	Gal. Anti Freeze		Belts			Radiator		
	Pts Brake Fluid		Hoses			Washer		
	Qts. Washer Fluid		Tires			Battery		
	Pts. Gear Oil		Lights			Rear End		
	Lbs. Freon		Alignments			Suspension		
	Pts. Hydraulic					Power Steering		
	Pts. Power Steering							
		Total						

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. Any express mechanic's lien is acknowledged on above vehicle to secure the amount or repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft accident or any other cause beyond your control. I agree to pay reasonable storage on vehicle left more than 48 hours after notification that repairs are completed.

PO Test ✓ # 495
7/10/08

Authorized By

Labor	609 ⁵⁰
Parts	27 ⁷⁰
Gas/Oil/Fluids	
Sublet	545 ⁰⁰
Hazardous Waste	
Sub Total	1182 ²⁰
Tax	106 ⁴⁰
TOTAL	1288⁶⁰


Compression			Cylinder Leakage Test		
1	5		1	5	
2	6		2	6	
3	7		3	7	
4	8		4	8	

the tracking link below or contact CAN-AMER
FREIGHT directly.


Important Delivery Information

Scheduled Delivery: 15-July-2008

Shipment Detail

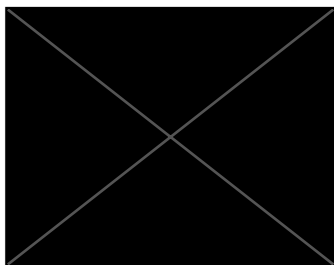

Number of Packages 1
UPS Service: GROUND
Weight: 9.2 LBS

Tracking Number: [1Z7A3T210346092786](#)
Reference Number 1: LOVE THE DRIVE
Reference Number 2: 

[Click here](#) to track if UPS has received your shipment
or visit
http://www.ups.com/WebTracking/track?loc=en_US
on the Internet.

____2H2H2y8YHxIb____

Discover more about
UPS:
[Visit www.ups.com](#)
[Sign Up For Additional](#)
[E-Mail From UPS](#)



The Mercedes Specialists

Independent Servicing Since 1985

340 Bellevue Way N.E. Bellevue, WA 98004 (425) 454-2937

2 of 2

REPAIR ORDER

19271

		Cell	Date
		Engine	5/28/09
		Chassis	107

Qty	PART DESCRIPTION	Price	MB Services	C	#1	#2	#3	#3Z			
2	RESISTER CONNECTORS	55 40									
			Oper No.	INSTRUCTIONS							Labor
				REPAIR RUNNING COLD							76 ⁰⁰
				CHECKED ON ANALIZER							
				REPLACED # 5 AND # 8							
				RESISTER CONNECTORS							
	PARTS NEEDED			* RATTLE IN FRONT							
				APPEARS TO BE THE SHOCKS							
				* IT HAS AFTERMARKET SHOCKS							
				ON IT NOW							
				Total							

Qty	FLUIDS ADDED	Price	C SERVICE	OK	Need	FLUIDS	OK	Added
	Qts. Oil		Oil & Filter			Engine		
	Qts. Transmission		Brakes			Transmission		
	Gal. Anti Freeze		Belts			Radiator		
	Pts Brake Fluid		Hoses			Washer		
	Qts. Washer Fluid		Tires			Battery		
	Pts. Gear Oil		Lights			Rear End		
	Lbs. Freon		Alignments			Suspension		
	Pts. Hydraulic					Power Steering		
	Pts. Power Steering							

*paid 6/1/09
TOTAL 14388
on page*

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. Any express mechanic's lien is acknowledged on above vehicle to secure the amount or repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft accident or any other cause beyond your control. I agree to pay reasonable storage on vehicle left more than 48 hours after notification that repairs are completed.

Thank you

Authorized By _____

Labor	76 ⁰⁰
Parts	55 40
Gas/Oil/Fluids	
Sublet	
Hazardous Waste	
Sub Total	131 40
Tax	12 48
TOTAL	143 88

Compression				Cylinder Leakage Test			
1		5		1		5	
2		6		2		6	
3		7		3		7	
4		8		4		8	



The Mercedes Specialists

Independent Servicing Since 1985

340 Bellevue Way N.E. Bellevue, WA 98004 (425) 454-2937

MERCEDES SPECIALISTS
16066 SE 135TH ST
RENTON WASH. 98059

WAS A CAR
IN FRONT OF
THE SO-DOOR

REPAIR ORDER
16611

Date 11/10/10

Qty	PART DESCRIPTION	Price	MB Services	C	#1	#2	#3	#3Z				
	BLACK GERMAN TOP	795 ⁰⁰	Oper No.	INSTRUCTIONS							Labor	
	OIL FILTER	12 50										
				REPLACED CONVERTABLE TOP WITH GERMAN TOP-							820 ⁰⁰	
				CHANGED ENGINE OIL+FILTER							25 ⁰⁰	
	PARTS NEEDED											
	WILL NEED FRONT BRAKE CALIPERS											
	* AIR PUMP IS ← MAKING NOISE MIGHT NEED TO BE REPLACED - ^{OR} REPAIR											
	* ENGINE NOISE RATTLE? ADJUSTED BELTS											
	* REPLACED R-FR. FOG LIGHT LENS N/K											
	Total											

FLUIDS ADDED		Price	C SERVICE	OK	Need	FLUIDS	OK	Added	
9	Qts. Oil HENDALL 10-30	43 ⁰⁰	Oil & Filter			Engine			
	Qts. Transmission		Brakes			Transmission			
	Gal. Anti Freeze		Belts			Radiator			
	Pts Brake Fluid		Hoses			Washer			
	Qts. Washer Fluid		Tires			Battery			
	Pts. Gear Oil		Lights			Rear End			
	Lbs. Freon		Alignments			Suspension			
	Pts. Hydraulic					Power Steering			
	Pts. Power Steering								
	Total								43 ⁰⁰

Compression				Cylinder Leakage Test			
1		5		1		5	
2		6		2		6	
3		7		3		7	
4		8		4		8	

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. Any express mechanic's lien is acknowledged on above vehicle to secure the amount or repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft accident or any other cause beyond your control. I agree to pay reasonable storage on vehicle left more than 48 hours after notification that repairs are completed.

THANK YOU TOTAL \$1615⁰⁰

Authorized By _____

Labor	25 ⁰⁰
Parts 807 ⁵⁰	795 ⁰⁰
Gas/Oil/Fluids	43 ⁰⁰
Sublet LABOR-	820 ⁰⁰
Hazardous Waste	
Sub Total 1695 ⁵⁰	1615 ⁰⁰
Tax 161 ⁰⁷	153 ⁹³
TOTAL	1769



The Mercedes Specialists


Independent Service Since 1982

10000 W. 1st Street, Arlington, VA 22204

202-422-6000

MERCEDES SPECIALISTS
10000 E 13TH ST
ARLINGTON WASH. 22204

REPAIR ORDER
16858

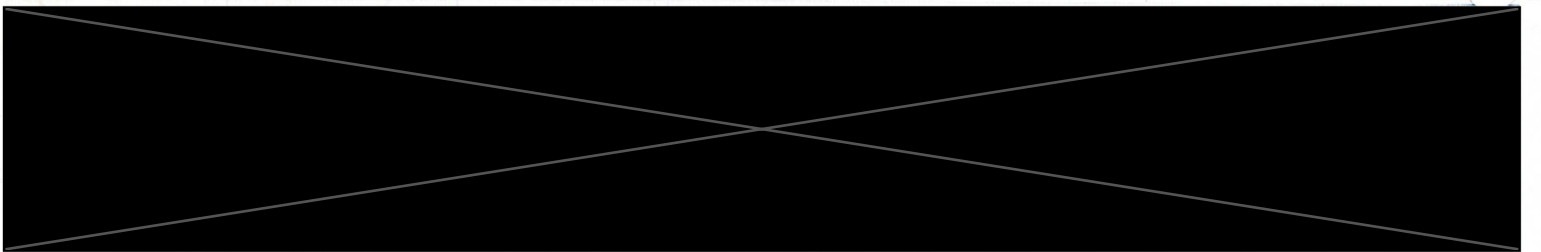

LABOR	INSTRUCTIONS	EST. HRS	CHARGE
	1. TIEROD	1.00	
	STEERING SHOCKS	1.50	
	OIL FILTER	1.00	
	BATTERY	1.00	
	check noise in front end	1.00	
	checked & replaced left tierod and nut	1.00	
	steering rack (set alignment)	1.00	
	check climate control - stuck in cooling mode (not cool). checked fuses - ok	1.00	
	pressures (ok now) also - rechecked	1.00	
	control panel. rechecked vacuum circuit + int. wiring	1.00	
	replaced battery	1.00	
	1. Door Window Rattle - Rk Door Panel	1.00	
	replaced rear glass guide - no rattle	1.00	
	total	10.00	499.50

FLUIDS	OK	NEED	CHARGE
Oil & Filter	X		1.00
Brake	X		1.00
Balls	X		1.00
Fluor	X		1.00
Washer	X		1.00
Wax	X		1.00
Light	X		1.00
Alignment	X		1.00
total			8.00

FLUIDS ADDED	CHARGE
Oil	1.00
Oil Removal 2 1/2 quarts	4.00
Oil Transmission	1.00
Oil Antifreeze	1.00
Oil Brake Fluid	1.00
Oil Washer Fluid	1.00
Oil Gear Oil	1.00
1.0 lbs Freon R12	3.00
Oil Hydraulic	1.00
Oil Power Steering	1.00
total	12.00

MAYBE NEXT TIME
WE CAN REPLACE
THE STEERING COUPLER.
I THINK YOU WOULD LIKE
DRIVING IT BETTER WITH
THAT FIXED. ?

Thank you

FLUIDS	CHARGE
Oil	1.00
Oil Removal 2 1/2 quarts	4.00
Oil Transmission	1.00
Oil Antifreeze	1.00
Oil Brake Fluid	1.00
Oil Washer Fluid	1.00
Oil Gear Oil	1.00
1.0 lbs Freon R12	3.00
Oil Hydraulic	1.00
Oil Power Steering	1.00
total	12.00



The Mercedes Specialists


Independent Servicing Since 1985

340 Bellevue Way N.E. Bellevue, WA 98004 (425) 454-2937

CHRIS SIDEBOTHAM
16055 SE 135th
RENTON WASH 98059

REPAIR ORDER
16935

206-953-6000

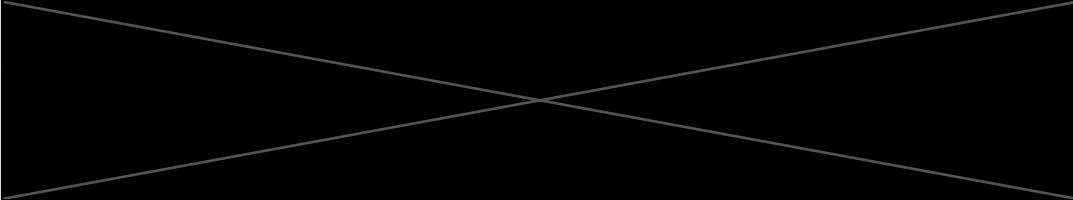

Cell	Date
	5/17/13
Engine	
Chassis	107

Qty	PART DESCRIPTION	Price	MB Services	#1	#2	#3	#3Z				
	A/C LEAK STOP-	24 ⁰⁰	Oper No.	INSTRUCTIONS							Labor
	R12a (2) LB -	20 ⁰⁰									
	-W-LEAK DYE										
	STEERING LOWER ARM KIT	70 ⁰⁰									
	(WHEELS) PAINT			✓ A/C NOT COLD CHECKED SYSTEM FOR LEAKS SLIGHT LEAK AT SERVICE VALVE AND COMPRESSOR MANIFOLD FITTINGS - REPLACED SERVICE VALVE AND SECURED FITTINGS -							95 ⁰⁰
	PARTS NEEDED										
	ALIGNMENT										
	AUTODYNAMIXS										
	425-283-5766			✓ TIGHTEN - STEERING - LIFTED LEFT SIDE OF ENGINE AND ADJUSTED STEERING BOX - AND - REPLACED (LOOSE) LOWER ARM BUSHINGS							125 ⁰⁰
	Total	114 ⁰⁰		C SERVICE OK Need FLUIDS OK Added							Total 220 ⁰⁰

Qty	FLUIDS ADDED	Price
	Qts. Oil	
	Qts. Transmission	
	Gal. Anti Freeze	
	Pts Brake Fluid	
	Qts. Washer Fluid	
	Pts. Gear Oil	
	Lbs. Freon	
	Pts. Hydraulic	
	Pts. Power Steering	
	Total	

Oil & Filter	OK	Need	Engine	OK	Added
Brakes			Transmission		
Belts			Radiator		
Hoses			Washer		
Tires			Battery		
Lights			Rear End		
Alignments			Suspension		
			Power Steering		

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. Any express mechanic's lien is acknowledged on above vehicle to secure the amount or repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft accident or any other cause beyond your control. I agree to pay reasonable storage on vehicle left more than 48 hours after notification that repairs are completed.

Labor	220 ⁰⁰
Parts	114 ⁰⁰
Gas/Oil/Fluids	
Sublet	
Hazardous Waste	
Sub Total	334 ⁰⁰
Tax	31 ⁷³
TOTAL	365⁷³

Compression			Cylinder Leakage Test		
1	5		1	5	
2	6		2	6	
3	7		3	7	
4	8		4	8	

Authorized By _____



The Mercedes Specialists


Independent Servicing Since 1985

340 Bellevue Way N.E. Bellevue, WA 98004 (425) 454-2937

MERCEDES SPECIALISTS
 16055 SE 135TH ST
 RENTON WASH. 98059

REPAIR ORDER

17455

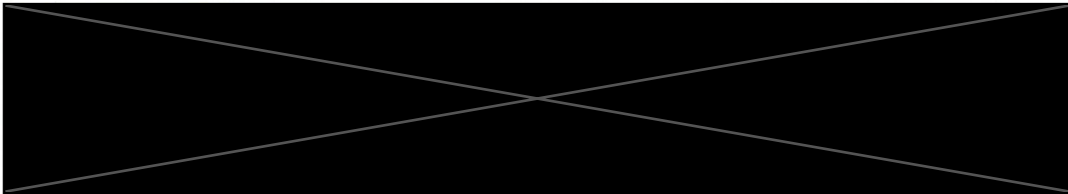

Cell	Date
	8/26/14
Engine	
Chassis	107

Qty	PART DESCRIPTION	Price	MB Services	C	#1	#2	#3	#3Z					
	FUEL LINE	8 ⁰⁰	Oper No.	INSTRUCTIONS								Labor	
				REPAIR FUEL LEAK									
				LEAK WAS FROM THE MAIN FUEL LINE AT FUEL TANK								171 ⁰⁰	
				HAD TO DRAIN THE TANK TO REPAIR.									
	PARTS NEEDED			READJUSTED STEERING BOX								N/C	
				WAS A LITTLE TO TIGHT-									
				Total									

Qty	FLUIDS ADDED	Price
	Qts. Oil	
	Qts. Transmission	
	Gal. Anti Freeze	
	Pts Brake Fluid	
	Qts. Washer Fluid	
	Pts. Gear Oil	
	Lbs. Freon	
	Pts. Hydraulic	
	Pts. Power Steering	
	Total	

C SERVICE	OK	Need	FLUIDS	OK	Added
Oil & Filter			Engine		
Brakes			Transmission		
Belts			Radiator		
Hoses			Washer		
Tires			Battery		
Lights			Rear End		
Alignments			Suspension		
			Power Steering		

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. Any express mechanic's lien is acknowledged on above vehicle to secure the amount or repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft accident or any other cause beyond your control. I agree to pay reasonable storage on vehicle left more than 48 hours after notification that repairs are completed.

Labor	171 ⁰⁰
Parts	8 ⁰⁰
Gas/Oil/Fluids	
Sublet	
Hazardous Waste	
Sub Total	179 ⁰⁰
Tax	16 ⁹¹
TOTAL	194⁹¹

Compression				Cylinder Leakage Test			
1		5		1		5	
2		6		2		6	
3		7		3		7	
4		8		4		8	

Authorized By _____




**For Your Next Battery Call: 1-800-AAA-HELP
To Join AAA Call: 1-800-JOIN-AAA**

12420760

This Invoice Must Be Retained for Limited Warranty

Professionally Installed by:

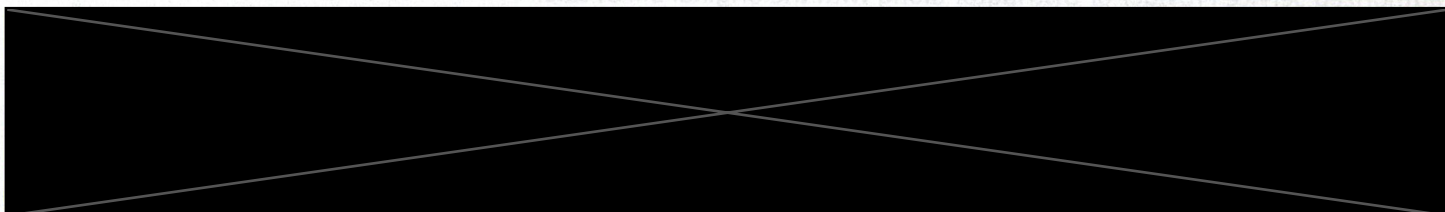

Phone #	Call Number 118471	Method Payment	Service Technician
Year 1978	Make Mercedes	Model 450 SL	27
License Plate	Vehicle VIN#	Odometer	

QUANTITY	PART NUMBER	DESCRIPTION OF LABOR AND PARTS - All parts are new unless otherwise stated	PARTS	LABOR
1	419	Battery Price with Exclusive Member Discount (Minimum of \$25)	\$176 ⁰⁰	
		Installation		\$ 0
		Battery and Charging System Analysis		\$ 0
		Disposal Fee		\$
		Battery Core Charge		\$
		Labor Intensive Install (If Applicable)	\$	\$
		Parts and Accessories	\$	\$
			\$	\$
			\$	\$
			\$	\$

Limited Warranty for Non-Commercial Passenger Vehicles - For limited warranty details see reverse side.

Limited Warranty Replacement

Original Part # _____ Original Purchase Date _____ Original Invoice # _____
 Original Battery Serial # _____ New Battery Serial # _____
 Failed Battery Test Code _____ New Battery Test Code _____

LIMITED WARRANTY ADJUSTMENT applies to products sold on or after January 1, 2016.
 36 Month Free Replacement + 36 Month Discount Period = 72 Month Total Limited Warranty

PRO RATA WARRANTY ADJUSTMENT applies to products purchased prior to January 1, 2016.
 36 Month Free Replacement + 36 Month Prorated Replacement Cost = 72 Month Total Limited Warranty
 Free Replacement Warranty Remaining _____ + 36 Months Prorated
 Prorated Warranty: Months Used _____ x Cost Per Month _____ = Replacement Cost*

*No member discount applied
 For commercial vehicle limited warranty coverage, see reverse side. If a core is not returned, a non-recycling fee will be charged.
 If a vehicle is fitted with two "like" batteries used for starting power, not just for auxiliary, both have to be replaced for best results. When a warranty event occurs and one battery has failed, both are to be replaced and credit will be issued for both, providing post installation tests are complete.

Subtotal Labor	\$ 0
Subtotal Parts	\$ 176 ⁰⁰
Sales Tax	\$ 17.78
Total	\$ 193.78

I understand and acknowledge that my battery may not require immediate replacement; however I am authorizing replacement of my battery at this time.

Comments _____

Please read carefully, check one of the statements below and sign:

I understand that, under state law, I am entitled to a written estimate, if my final bill will exceed \$ _____

- I request a written estimate
- I do not request a written estimate
- I do not request a written estimate as long as the repair costs do not exceed \$ _____

Signed _____ Date _____

Original Test Results	(For Internal Use Only)
Battery CCA _____ Condition _____ <input type="checkbox"/> Pass <input type="checkbox"/> Marginal <input type="checkbox"/> Fail Alternator - Charging Volts <input type="checkbox"/> Pass <input type="checkbox"/> Marginal <input type="checkbox"/> Fail	Drain - Drain Amps _____ <input type="checkbox"/> Pass <input type="checkbox"/> Suspect <input type="checkbox"/> Fail Prior Acid Damage _____ <input type="checkbox"/> Yes <input type="checkbox"/> No KAM Unit Used _____ <input type="checkbox"/> Yes <input type="checkbox"/> No Comment: _____ Performed by: _____ Date: _____

Schmitt Automotive

16450 SE 128th St
Renton, WA. 98059
Phone: 425-749-8423

INVOICE

408

Org. Est. # 000472

Date: 07/09/2021


1977 Mercedes-Benz - 450SL - 4.5L, V8 (276Cl) VIN(Not Availa

Lic # : Odometer In : 49031

Odometer Out : 49031

VIN # :

INVOICE

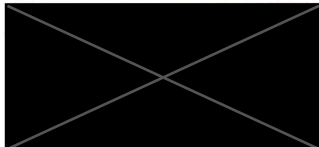

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
A/C Receiver Drier 107 830 12 83	1.00	179.00	179.00	Repair A/C	
A/C Temp. Switch 004 820 68 10	1.00	60.00	60.00	AIR CONDITIONING SYSTEM R134a RETROFIT - Complete Charge - [Includes: Air Conditioning system recover, evacuate and recharge.]	440.00
R134 Fitting Retrofit Kit 134rr	1.00	41.35	41.35		
R134 refrigerant r134	2.20	20.00	44.00		
A/C Pressure Switch 124 820 83 10	1.00	72.00	72.00		
A/C Flush INT CA1	1.00	28.80	28.80		
Shop Supplies			17.30		

Org. Estimate 959.22 Revisions 0.00 Current Estimate 959.22

Labor:	440.00
Parts:	442.45
SubTotal:	882.45
Tax:	76.77
Total:	959.22
Bal Due:	\$959.22

[Payments -]
Vehicle Received: 7/8/2021 Customer Number : 246

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____

Visit us on the web: www.Schmittautomotive.com

Email Address: Mark@Schmittautomotive.com

Service Advisor : Schmitt, Mark, Tech : Schmitt, Mark 001




BATTERY PURCHASE INVOICE

Date: 4/04/25 Invoice #: 60349307
Time: 14:13:28
Membership #: [Redacted]



Location: 6 STA: WA

MEMBER INFORMATION	VEHICLE INFORMATION
[Redacted]	1978 Mercedes-Benz 450 sl (None)


Item#	Description	Qty	SLIP PRINT
1624801	INTERSTATE BATTERIES GROUP H8(49) AGM 36MO PRORATED WARRANT Battery Core Fee Item	1 1	<p>SLIP PRINT RECEIPT</p> <p>MEMBER #: 111796376104</p> <p>TIRE SHOP ORDER # 60349307</p> <p>1624801-GR H8(49)AGM 179.99</p> <p>BATTERY CORE 15.00</p> <p>SUBTOTAL 194.99</p> <p>TAX 19.89</p> <p>*** TOTAL 214.88</p> <p>Visa 214.88</p> <p>CHANGE 0.00</p> <p>A 10.20% TAX 19.89</p> <p>TOTAL TAX 19.89</p> <p>TOTAL NUMBER OF ITEMS SOLD = 1</p> <p>CASHIER: Denoyan 04/04/2025 14:13 6 96 36 48</p>
	 9200000603493071		


SANDRA P
Sales Person

CORE FEE REFUND INVOICE



Location: 6 STA: WA

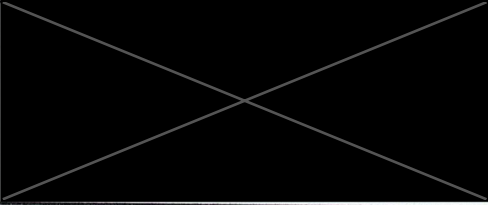MEMBER INFORMATION	VEHICLE INFORMATION
	NOT APPLICABLE

Item#	Description	Qty	SLIP PRINT
	Battery Core Fee Item	1-	<p>SLIP PRINT RECEIPT</p> <p>MEMBER #: 111796376104</p> <p>TIRE SHOP ORDER # 60349308</p> <p>VOID</p> <p>BATTERY DISP 15.00-</p> <p>SUBTOTAL 15.00-</p> <p>TAX 1.53-</p> <p>**** TOTAL 16.53-</p> <p>MGR OVR 892</p> <p>RF Visa 16.53-</p> <p>CHANGE 0.00</p> <p>A 10.20% TAX 1.53-</p> <p>TOTAL TAX 1.53-</p> <p>TOTAL NUMBER OF ITEMS SOLD = 0</p> <p>CASHIER: Donovan</p> <p>04/04/2025 14:15 6 96 37 48</p>
			 <p>9200000603493088</p>

SANDRA P
Sales Person



COSTCO BATTERY WARRANTY

Date: 4/04/25 Invoice #: 60349307
Time: 14:13:28
Membership #:



Costco Wholesale Limited Battery Warranty United States including Puerto Rico

Costco Wholesale provides this limited warranty to the original purchaser of automotive and specialty (i.e., recreational) batteries purchased directly from Costco Wholesale in the United States, including Puerto Rico. This battery, when used in accordance with the manufacturer's instructions and for its intended purpose in a personal automobile, is warranted to be free of defects in material and workmanship. This limited warranty is effective for the battery's designated warranty period, or for as long as it remains in the vehicle in which it was originally installed, whichever is shorter. The applicable time period for the limited warranty is indicated on the battery itself.

If there is a defect in material or workmanship (not merely the battery being discharged), this limited warranty provides that upon return of the battery to any United States or Puerto Rico Costco Wholesale warehouse, a pro-rata portion of the original purchase price and sales tax paid will be refunded.

YOUR EXCLUSIVE REMEDY, WITH RESPECT TO ALL LOSSES WHATSOEVER, SHALL BE AS SPECIFIED ABOVE. IN NO EVENT SHALL COSTCO WHOLESALE BE LIABLE FOR ANY CONSEQUENTIAL OR INCIDENTAL DAMAGES OF ANY KIND. TO THE EXTENT NOT PROHIBITED BY LAW IN YOUR STATE OR JURISDICTION, COSTCO WHOLESALE EXPRESSLY DISCLAIMS ANY OTHER EXPRESS WARRANTY, IMPLIED WARRANTY OF MERCHANTABILITY, IMPLIED WARRANTY OF FITNESS FOR A PARTICULAR PURPOSE, OR ANY OTHER IMPLIED WARRANTY.

Proof of purchase is required for all claims. The limited warranty is void if the date coding on the battery is removed or destroyed. If more than one date is indicated, the earliest date will be used.

Costco Wholesale Corporation
PO Box 34535
Seattle, WA 98124-1535
1 (800) 774-2678
www.costco.com

US including Puerto Rico July 11, 2022