



**Charleston Import Automotive**  
 3170-A Stanton Ct, North Charleston, SC 29418  
 (843) 552-6555  
 contact@charlestonimportauto.com

**Work Order #14208**

Page 1 of 10  
 03/11/2026 10:33 AM



**1990 Jaguar XJ6**  
 SAJFY1743LC623487  
 Engine: 4.0L L6 (7) GAS FI  
 Plate: 8777SE  
 Fleet #: 9  
 Odometer In: 16533  
 Odometer Out: 16537

**Advisor: Darryl Beech**  
 Technician: Bryan Storck

**GRAND TOTAL: \$1,662.25**

**PAID**

**Reason for Customer's Visit**

maintenance, verify AC works

**SERVICES**

**1 Vehicle Courtesy Inspection\***

\*verify A/C and heat still work

**SUBTOTAL: \$0.00**

**LABOR**

Visual Inspection

Labor: \$0.00  
 Parts: \$0.00  
 Fees: \$0.00  
 Sublet: \$0.00

**2 Change Engine Oil & Filter\***

**SUBTOTAL: \$322.57**

**LABOR**

Drain & Refill

R&R Engine Oil Filter

Labor: \$195.97  
 Parts: \$126.60  
 Fees: \$0.00  
 Sublet: \$0.00

PARTS	PART #	QTY	EACH	TOTAL
20W50 oil	F650	8.5	\$13.46	\$114.41
Oil Filter	5001-200186	1.0	\$12.19	\$12.19

**3 Remove & Install A/C Pressure Switch**

**SUBTOTAL: \$703.90**

**LABOR**

Remove & Install A/C Pressure Switch

Recover, Evacuate & Recharge A/C System - R134A

Labor: \$254.77  
 Parts: \$449.13  
 Fees: \$0.00  
 Sublet: \$0.00

PARTS	PART #	QTY	EACH	TOTAL
HVAC System Switch	35898	1.0	\$121.30	\$121.30
Freon R134A (sold by gram)	R134A-30	1247.0	\$0.24	\$299.28
Male to Male Connector, 10x1.0, Stainless Steel	X003UWGE47	1.0	\$28.55	\$28.55



**Charleston Import Automotive**  
 3170-A Stanton Ct, North Charleston, SC 29418  
 (843) 552-6555  
 contact@charlestonimportauto.com

**Work Order #14208**

Page 2 of 10  
 03/11/2026 10:33 AM

**4 Remove & Replace Front Shock Mountings\***

**SUBTOTAL: \$464.87**

**LABOR**

Remove & Replace Front Shock Mountings

Labor: \$352.75  
 Parts: \$112.12  
 Fees: \$0.00  
 Sublet: \$0.00

**PARTS**

PARTS	PART #	QTY	EACH	TOTAL
Strut Bellow	2702-32474	2.0	\$27.66	\$55.32
SHOCK BUSHING	MMD 2144AA	4.0	\$14.20	\$56.80

**5 Test Drive - 2.0 Miles**

**SUBTOTAL: \$0.00**

**LABOR**

Test Drive - 2.0 Miles

Labor: \$0.00  
 Parts: \$0.00  
 Fees: \$0.00  
 Sublet: \$0.00

SUBTOTAL: \$122.27

Labor: \$102.97  
 Parts: \$12.00  
 Fees: \$0.00  
 Sublet: \$0.00

PARTS	PART #	QTY	EACH	TOTAL
Oil Filter	5001-503188	1.0	\$15.18	\$15.18
5W/30 oil	1550	8.5	\$13.48	\$114.41

SUBTOTAL: \$703.90

Labor: \$224.77  
 Parts: \$449.13  
 Fees: \$0.00  
 Sublet: \$0.00

PARTS	PART #	QTY	EACH	TOTAL
Strut & Coil Spring	R134A 30	1.0	\$151.30	\$151.30
Shock Absorber	3838	1.0	\$151.30	\$151.30
Coil Spring	R134A 30	1.0	\$151.30	\$151.30
Shock Absorber	3838	1.0	\$151.30	\$151.30



**Charleston Import Automotive**

3170-A Stanton Ct, North Charleston, SC 29418  
(843) 552-6555  
contact@charlestonimportauto.com

**Work Order #14208**

Page 3 of 10  
03/11/2026 10:33 AM

**Terms of Service:**

**1. "YES, DO THIS WORK"**

I hereby authorize the corresponding service to be done along with the necessary materials.

**2. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"**

Charleston Import Automotive staff may operate my vehicle for the purpose of testing, inspection, and delivery.

**3. "NO PAYMENT, NO KEYS"**

An express lien is acknowledged on my vehicle to secure the amount of services thereto. Payment and pickup are required within 10 business days of completion of the last authorized action to the vehicle. After this time, storage charges will be applied at the rate of \$30 per day. Any vehicles not picked up within 30 days will be processed as abandoned.

**4. "PROPERTY LEFT IN VEHICLE"**

I understand that Charleston Import Automotive is not responsible for damage of articles left in vehicle in case of fire, theft, or any other cause beyond our control.

**5. "WE PROVIDE THE PARTS"**

It is Charleston Import Automotive's policy not to accept customer-provided parts, new or used.

**6. "WE STAND BY OUR WORK"**

The warranty on repairs is 24 months OR 24,000 miles unless otherwise specified in writing. The warranty on used parts provided and installed by Charleston Import Automotive is 6 months unless otherwise specified in writing.

**7. "ONLINE COMMUNICATION OK"**

I welcome email from Charleston Import Automotive as a means of receiving copies of my estimate, work order, and invoice.

**8. "HERE'S MY SIGNATURE"**

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to these eight terms. I understand by approving work to be done, my intent to do business with Charleston Import Automotive has been shown. All above terms listed will apply.

**GRAND TOTAL: \$1,662.25**

Total Labor: \$803.49

Total Parts: \$687.85

Total Fees: \$0.00

Total Sublets: \$0.00

Shop Supplies: \$100.00

Sales Tax: \$70.91

**✓ PAID**


03/11/2026 10:32 AM

Paid by Credit Card - Visa MC AmEx

Discover: **\$1,662.25**

Notes: "x0762"

**Authorization:**

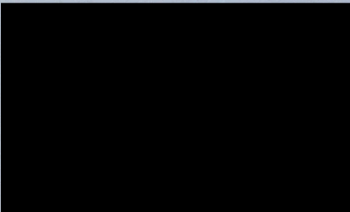

02/19/2026



### Charleston Import Automotive

3170-A Stanton Ct, North Charleston, SC 29418  
(843) 552-6555  
contact@charlestonimportauto.com

Work Order #14208

Page 4 of 10

03/11/2026 10:33 AM

## INSPECTION REPORT

### Vehicle Courtesy Inspection\*

- Dash Indications. Retrieve codes if CEL Illuminated or Customer Complaint warrants.
- Pedal Feel - Brake
- Pedal Feel - Clutch
- Pedal Feel - Accelerator
- Drive Train
- Emergency Brake
- Horn
- Air Conditioning**
- Heat
- Lighting - Headlamps
- Fog Lamp
- Lighting - Turn Signals/Marker/License/Reverse Lamps
- Lighting - Brake Lamps
- Body - Wiper Blades/Washer Operation
- Body - Panels
- Body - Glass
- Body - Mirrors
- Fluids - Brake
- Fluids - Oil
- Fluids - Antifreeze/Coolant
- Fluids - Transmission
- Fluids - Washer
- Fluids - Power Steering**
- Belts
- Cooling - Radiator Hoses
- Cooling - Heater Hoses
- Cooling - Radiator
- Cooling - Water Pump
- Battery
- Battery Cables
- Engine



### Charleston Import Automotive

3170-A Stanton Ct, North Charleston, SC 29418  
(843) 552-6555  
contact@charlestonimportauto.com

Work Order #14208

Page 5 of 10  
03/11/2026 10:33 AM

- Filters - Air
- Filters - Cabin
- Filters - Fuel
- Ignition - Plug Wires
- Ignition - Cap
- Exhaust
- Tire Condition, Pressures
- Suspension - Struts/Shocks**
- Suspension - Wheel Bearings
- Suspension - Ball Joints
- Suspension - Bushings
- Front Brakes - Friction
- Front Brakes - Hydraulics, Hose/Line condition.
- Rear Brakes - Friction
- Rear Brakes - Hydraulics Hose/Line condition
- Steering - Box/Rack
- Steering - Tie Rod Ends
- Drive Shaft - U-Joints/Couplings
- Drive Shaft - Supports
- Differential**

### Test Drive - 2.0 Miles

- Dash Indicators
- Service Aesthetics
- Fuel Gauge Level - 1/4 tank**



### Charleston Import Automotive

3170-A Stanton Ct, North Charleston, SC 29418  
(843) 552-6555  
contact@charlestonimportauto.com

Work Order #14208

Page 6 of 10  
03/11/2026 10:33 AM

#### FINDINGS

**Change Engine Oil & Filter \$322.57 +tax**

Approved in person, 9:48am 2/25/26

Written by Darryl Beech at 04/28/2025 10:01 AM

#### Air Conditioning

Blowing 62 degrees  
Pressure switch on rear of compressor leaking  
recovered 395g r134a

**Remove & Install AC Pressure Switch \$683.85 +tax**

Approved by phone, 1:16pm 2/26/26

Written by Bryan Storck at 02/25/2026 10:10 AM

#### Heat

Blowing 95 degrees

Written by Bryan Storck at 02/25/2026 10:14 AM

#### Front Brakes - Friction

5 mm

Written by Bryan Storck at 02/25/2026 10:33 AM

#### Rear Brakes - Friction

5 mm

Written by Bryan Storck at 02/25/2026 10:33 AM

#### Differential

Right output seal leaking

Written by Bryan Storck at 02/25/2026 10:33 AM



**Charleston Import Automotive**  
3170-A Stanton Ct, North Charleston, SC 29418  
(843) 552-6555  
contact@charlestonimportauto.com

**Work Order #14208**

Page 7 of 10  
03/11/2026 10:33 AM


**Suspension - Struts/Shocks**

Front mounts/bump stops disintegrated  
Rear shock mount foam cracking

**Remove & Replace Front Shock Mountings**    **\$482.51**  
+tax

Approved by phone, 1:16pm 2/26/26

Written by Bryan Storck at 02/25/2026 10:36 AM

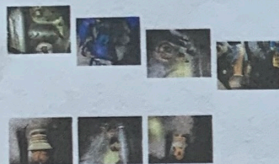

Written by Bryan Storck at 02/25/2026 10:37 AM

**Fluids - Power Steering**

Level at bottom of dipstick. Trail from reservoir hose connections. Tightened clamps, cleaned area, topped up system

Written by Bryan Storck at 02/25/2026 11:09 AM




**Charleston Import Automotive**  
3170-A Stanton Ct, North Charleston, SC 29418  
(843) 552-6555  
contact@charlestonimportauto.com

**Work Order #14208**

Page 8 of 10  
03/11/2026 10:33 AM

**Attached Images:**

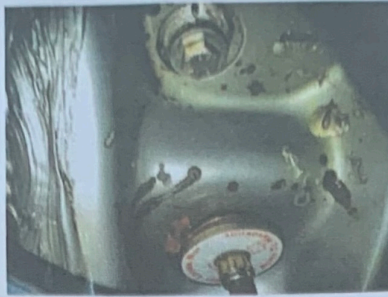



**Charleston Import Automotive**  
 3170-A Stanton Ct, North Charleston, SC 29418  
 (843) 552-6555  
 contact@charlestonimportauto.com

**Work Order #14208**

Page 9 of 10  
 03/11/2026 10:33 AM



**AUTORIZATION SUMMARY**

DESCRIPTION	AMOUNT
Vehicle Courtesy Inspection	\$0.00
By Electronic Authorization	\$0.00
Change Engine Oil & Filter	\$365.10
in Person	
Remove & Install AC Pressure Switch	\$143.00
By Phone	
Remove & Install Front End Bearings	\$135.00
By Phone Call	



**Charleston Import Automotive**  
 3170-A Stanton Ct, North Charleston, SC 29418  
 (843) 552-6555  
 contact@charlestonimportauto.com

**Work Order #14208**

Page 10 of 10  
 03/11/2026 10:33 AM

**AUTHORIZATION SUMMARY**

**AUTHORIZATION 001 - ORIGINAL ESTIMATE**

Date **02/19/2026** Time **12:49pm EST**

Description

**Vehicle Courtesy Inspection\***

Original Estimate

**\$0.00**

Approval Type

**By Electronic Authorization**

Approval By

Signature



**AUTHORIZATION 002 - REVISED ESTIMATE**

Date **02/25/2026** Time **09:48am EST**

Reason for revised estimate

**Change Engine Oil & Filter**

Additional Cost

**\$362.10**

Revised Estimate

**\$362.10**

Approval Type

**In Person**

Approval By

Signature

**AUTHORIZATION 003 - REVISED ESTIMATE**

Date **02/26/2026** Time **01:16pm EST**

Reason for revised estimate

**Remove & Install AC Pressure Switch**

Additional Cost

**\$780.95**

Revised Estimate

**\$1,143.05**

Approval Type

**By Phone Call**

Approval By

Phone Number

**AUTHORIZATION 004 - REVISED ESTIMATE**

Date **02/26/2026** Time **01:16pm EST**

Reason for revised estimate

**Remove & Replace Front Shock Mountings**

Additional Cost

**\$513.84**

Revised Estimate

**\$1,656.89**

Approval Type

**By Phone Call**

Approval By

Phone Number



Welcome to Charleston Import Automotive, [REDACTED]



RO#: 14208

•  
Work Order

•  
1990 Jaguar XJ6

•  
Plate: 8777SE

•  
Service Advisor: Darryl Beech

•  
Call Us: (843) 552-6555

Message Us



**Reason for Customer's Visit**

maintenance, verify AC works



1.

**Vehicle Courtesy Inspection\***

\*verify A/C and heat still work

\$0.00



**LABOR**

\$0.00

Visual Inspection



**INSPECTIONS**



**Dash Indications. Retrieve codes if CEL Illuminated or Customer Complaint warrants.**



**Pedal Feel - Brake**

- ✓ Pedal Feel - Clutch
- ✓ Pedal Feel - Accelerator
- ✓ Drive Train
- ✓ Emergency Brake
- ✓ Horn
- ✓ Air Conditioning
- ✓ Heat
- ✓ Lighting - Headlamps
- ✓ Fog Lamp
- ✓ Lighting - Turn Signals/Marker/License/Reverse Lamps
- ✓ Lighting - Brake Lamps
- ✓ Body - Wiper Blades/Washer Operation
- ✓ Body - Panels
- ✓ Body - Glass
- ✓ Body - Mirrors
- ✓ Fluids - Brake
- ✓ Fluids - Oil
- ✓ Fluids - Antifreeze/Coolant
- ✓ Fluids - Transmission
- ✓ Fluids - Washer
- ✓ Fluids - Power Steering
- ✓ Belts
- ✓ Cooling - Radiator Hoses
- ✓ Cooling - Heater Hoses
- ✓ Cooling - Radiator

- ✓ Cooling - Water Pump
- ✓ Battery
- ✓ Battery Cables

---

- ✓ Engine
- ✓ Filters - Air
- ✓ Filters - Cabin
- ✓ Filters - Fuel
- ✓ Ignition - Plug Wires
- ✓ Ignition - Cap
- ✓ Exhaust
- ✓ Tire Condition, Pressures
- ✓ Suspension - Struts/Shocks
- ✓ Suspension - Wheel Bearings
- ✓ Suspension - Ball Joints
- ✓ Suspension - Bushings
- ✓ Front Brakes - Friction
- ✓ Front Brakes - Hydraulics, Hose/Line condition.
- ✓ Rear Brakes - Friction
- ✓ Rear Brakes - Hydraulics Hose/Line condition
- ✓ Steering - Box/Rack
- ✓ Steering - Tie Rod Ends
- ✓ Drive Shaft - U-Joints/Couplings
- ✓ Drive Shaft - Supports
- ✓ Differential
- ✓

2.

Change Engine Oil & Filter\*

\$322.57



3.

Remove & Install A/C Pressure Switch

\$703.90



4.

Remove & Replace Front Shock Mountings\*

\$464.87



5.

Test Drive - 2.0 Miles

\$0.00



LABOR

\$0.00

Test Drive - 2.0 Miles



INSPECTIONS



Dash Indicators



Service Aesthetics



Fuel Gauge Level - 1/4 tank

Show Findings

Review the following findings from the shop

RECOMMENDED SERVICE

Change Engine Oil & Filter

\$322.57

Approved | 02/25/2026 9:48 AM

Darryl B.

04/28/2025 10:01 AM



Air Conditioning

Blowing 62 degrees Pressure switch on rear of compressor leaking recovered 395g r134a

RECOMMENDED SERVICE

Remove & Install AC Pressure Switch

\$683.85

Approved | 02/26/2026 1:16 PM

Bryan S.

02/25/2026 10:10 AM



Heat  
Blowing 95 degrees  
Bryan S.

02/25/2026 10:14 AM



Front Brakes - Friction  
5 mm  
Bryan S.

02/25/2026 10:33 AM



Rear Brakes - Friction  
5 mm  
Bryan S.

02/25/2026 10:33 AM



Differential  
Right output seal leaking  
Bryan S.

02/25/2026 10:33 AM



Suspension - Struts/Shocks  
Front mounts/bump stops disintegrated Rear shock mount foam cracking

RECOMMENDED SERVICE

Remove & Replace Front Shock Mountings

\$482.51

Approved | 02/26/2026 1:16 PM

Bryan S.


02/25/2026 10:36 AM



Preview



Preview




⊙Preview



⊙Preview



⊙Preview



⊙Preview



⊙Preview

Bryan S.

•  
02/25/2026 10:37 AM

✓  
Fluids - Power Steering  
Level at bottom of dipstick. Trail from reservoir hose connections. Tightened clamps, cleaned area, topped up system  
Bryan S.

•  
02/25/2026 11:09 AM

▼  
**Recommended Services Overview**  
Displayed by date created.

**Urgency:**  
High (2)  
Medium (0)  
Low (0)  
Not Set (1)

**CURRENT RECOMMENDATIONS (3)**

\*Required

Change Engine Oil & Filter  
\$322.57

✓ Approved | 02/25/2026 9:48 AM

Remove & Install AC Pressure Switch  
\$683.85

✔ Approved | 02/26/2026 1:16 PM



Show Findings

Remove & Replace Front Shock Mountings

\$482.51

✔ Approved | 02/26/2026 1:16 PM



Show Findings

#### Financials



Approved Amount:

\$1,491.34

Shop Supplies:

\$100.00

Sales Tax:

\$70.91



Terms of Service

Total:

\$1,662.25

# SERVICE HISTORY REPORT

**1990 Jaguar XJ6 8777SE 9**

**Date** 03/11/2026 09:30 AM  
**Vehicle** 1990 Jaguar XJ6 4.0L L6 (7) GAS FI  
**Vin** SAJFY1743LC623487  
**Plate** 8777SE  
**Fleet #** 9

RO# 14646



08/28/2025 Odo In 16439

## 1. Vehicle Courtesy Inspection

RO# 14646



08/28/2025 Odo In 16439


### LABOR

Visual Inspection

### INSPECTION SUMMARY


- ✓ Air Conditioning
- ✓ Dash Indications. Retrieve codes if CEL illuminated or Customer Complaint warrants.
- ✓ Pedal Feel - Brake
- ✓ Pedal Feel - Clutch
- ✓ Pedal Feel - Accelerator
- ✓ Drive Train
- ✓ Emergency Brake
- ✓ Horn
- ✓ Heat
- ✓ Lighting - Headlamps
- ✓ Fog Lamp
- ✓ Lighting - Turn Signals/Marker/License/Reverse Lamps
- ✓ Lighting - Brake Lamps
- ✓ Body - Wiper Blades/Washer Operation
- ✓ Body - Panels
- ✓ Body - Glass
- ✓ Body - Mirrors

08/28/2025 Odo In 16439

RO# 14646 - 

- ✓ Fluids - Brake
- ✓ Fluids - Oil
- ✓ Fluids - Antifreeze/Coolant
- ✓ Fluids - Transmission
- ✓ Fluids - Washer
- ✓ Fluids - Power Steering
- ✓ Belts
- ✓ Cooling - Radiator Hoses
- ✓ Cooling - Heater Hoses
- ✓ Cooling - Radiator
- ✓ Cooling - Water Pump
- ✓ Battery
- ✓ Battery Cables
- ✓ Engine
- ✓ Filters - Air
- ✓ Filters - Cabin
- ✓ Filters - Fuel
- ✓ Ignition - Plug Wires

08/28/2025 Odo In 16439

RO# 14646 - 

- ✓ Ignition - Cap
- ✓ Exhaust
- ✓ Tire Condition, Pressures
- ✓ Suspension - Struts/Shocks
- ✓ Suspension - Wheel Bearings
- ✓ Suspension - Ball Joints
- ✓ Suspension - Bushings
- ✓ Front Brakes - Friction
- ✓ Front Brakes - Hydraulics, Hose/Line condition.
- ✓ Rear Brakes - Friction
- ✓ Rear Brakes - Hydraulics Hose/Line condition
- ✓ Steering - Box/Rack
- ✓ Steering - Tie Rod Ends
- ✓ Drive Shaft - U-Joints/Couplings
- ✓ Drive Shaft - Supports
- ✓ Differential

2. Diagnose A/C System Operation

RO# 14646 - [REDACTED]

08/28/2025 Odo In 16439

**LABOR**

Diagnose AC System Operation

**INSPECTION SUMMARY**

- ✓ System Pressures
- ✓ Visible Leaks
- ✓ Control Operation
- ✓ Condenser Fan Operation
- ✓ Compressor Condition
- ✓ Belt Condition
- ✓ Hose/Line Condition

**3. Repair A/C (warranty)**

**LABOR**

Remove & Replace Air Conditioning Receiver Drier Assembly  
Evacuate & Recharge A/C  
Remove & Reseal A/C Expansion Valve

**PARTS**

0 Four Seasons A/C Receiver Drier 33497  
2 AIR A/C O-Ring AC 24615  
2 AIR A/C O-Ring 24608

RO# 14505 - [REDACTED]

05/02/2025 Odo In 16343

**1. Vehicle Courtesy Inspection**

RO# 14505 - [REDACTED]


05/02/2025 Odo In 16343

**LABOR**

Visual Inspection


**INSPECTION SUMMARY**

- ✓ Air Conditioning
- ✓ Dash Indications. Retrieve codes if CEL illuminated or Customer Complaint warrants.
- ✓ Pedal Feel - Brake
- ✓ Pedal Feel - Clutch
- ✓ Pedal Feel - Accelerator
- ✓ Drive Train
- ✓ Emergency Brake
- ✓ Horn
- ✓ Heat
- ✓ Lighting - Headlamps
- ✓ Fog Lamp
- ✓ Lighting - Turn Signals/Marker/License/Reverse Lamps
- ✓ Lighting - Brake Lamps
- ✓ Body - Wiper Blades/Washer Operation
- ✓ Body - Panels
- ✓ Body - Glass
- ✓ Body - Mirrors

RO# 14505 - 

05/02/2025 Odo In 16343

- ✓ Fluids - Brake
- ✓ Fluids - Oil
- ✓ Fluids - Antifreeze/Coolant
- ✓ Fluids - Transmission
- ✓ Fluids - Washer
- ✓ Fluids - Power Steering
- ✓ Belts
- ✓ Cooling - Radiator Hoses
- ✓ Cooling - Heater Hoses
- ✓ Cooling - Radiator
- ✓ Cooling - Water Pump
- ✓ Battery
- ✓ Battery Cables
- ✓ Engine
- ✓ Filters - Air
- ✓ Filters - Cabin
- ✓ Filters - Fuel
- ✓ Ignition - Plug Wires

RO# 14505 - 

05/02/2025 Odo In 16343

- ✓ Ignition - Cap
- ✓ Exhaust
- ✓ Tire Condition, Pressures
- ✓ Suspension - Struts/Shocks
- ✓ Suspension - Wheel Bearings
- ✓ Suspension - Ball Joints
- ✓ Suspension - Bushings
- ✓ Front Brakes - Friction
- ✓ Front Brakes - Hydraulics, Hose/Line condition.
- ✓ Rear Brakes - Friction
- ✓ Rear Brakes - Hydraulics Hose/Line condition
- ✓ Steering - Box/Rack
- ✓ Steering - Tie Rod Ends
- ✓ Drive Shaft - U-Joints/Couplings
- ✓ Drive Shaft - Supports
- ✓ Differential

**2. Diagnose A/C System Operation**

RO# 14444 - [REDACTED]

08/28/2025 Odo to 14429

**LABOR**

Diagnose A/C System Operation

**INSPECTED COMPONENT**

- ✓ System Pressure
- ✓ Valve Leaks
- ✓ Control Operation
- ✓ Condenser Fan Operation
- ✓ Compressor Condition
- ✓ Belt Condition
- ✓ Hose/Line Condition

**3. Repair A/C (warranty)**

**LABOR**

Remove & Replace Air  
Conditioning Receiver Drier  
Assembly  
Evacuate & Recharge A/C  
Remove & Repair A/C Expansion  
Valve

**PARTS**

- 0 Four Seasons A/C Receiver  
Drier 23407
- 2 All A/C O-Ring AC 24075
- 2 All A/C O-Ring 23408

RO# 14505 - [REDACTED]

05/02/2025 Odo to 14343

**1. Vehicle Courtesy Inspection**

RO# 14505 - [REDACTED]

05/02/2025 Odo to 14343

**LABOR**

Visual Inspection

**INSPECTED COMPONENT**

- ✓ Air Conditioning
- ✓ Dash Indicators, Retrieve codes if DTC, Illuminated or Customer  
Complaint symptoms.
- ✓ Pedal Feet - Brake
- ✓ Pedal Feet - Clutch
- ✓ Pedal Feet - Accelerator
- ✓ Drive Train
- ✓ Emergency Brake
- ✓ Horn
- ✓ Heat
- ✓ Lighting - Headlamps
- ✓ Fog Lamp
- ✓ Lighting - Turn Signals/Marker/License/Reverse Lamp
- ✓ Lighting - Brake Lamp
- ✓ Body - Mirror/Windows/Washer Operation
- ✓ Body - Panels
- ✓ Body - Glass
- ✓ Body - Mirrors

RO# 14505 -

05/02/2025 Odo In 16343

**LABOR**

Diagnose AC System Operation  
Recover, Evacuate & Recharge AC  
Remove & Reseal Expansion Valve

**PARTS**

2 BEH O-RING, A/C 24610  
2 AIR A/C O-Ring 24608  
800Chemours Freon R134A (sold  
by gram) R134A-30

**INSPECTION SUMMARY**

- ✓ Visible Leaks
- ✓ Control Operation
- ✓ System Pressures
- ✓ Condenser Fan Operation
- ✓ Compressor Condition
- ✓ Belt Condition
- ✓ Hose/Line Condition

**3. Test Drive - 2.0 Miles**

**LABOR**

Test Drive - 2.0 Miles

**INSPECTION SUMMARY**

- ✓ Dash Indicators
- ✓ Service Aesthetics
- ✓ Fuel Gauge Level

RO# 14096 -

07/15/2024 Odo In 16300

**1. Vehicle Courtesy Inspection**

RO# 14096 -


07/15/2024 Odo In 16300

**LABOR**

Visual Inspection


**INSPECTION SUMMARY**

- ✓ Air Conditioning
- ✓ Dash Indications. Retrieve codes if CEL illuminated or Customer Complaint warrants.
- ✓ Pedal Feel - Brake
- ✓ Pedal Feel - Clutch
- ✓ Pedal Feel - Accelerator
- ✓ Drive Train
- ✓ Emergency Brake
- ✓ Horn
- ✓ Heat
- ✓ Lighting - Headlamps
- ✓ Fog Lamp
- ✓ Lighting - Turn Signals/Marker/License/Reverse Lamps
- ✓ Lighting - Brake Lamps
- ✓ Body - Wiper Blades/Washer Operation
- ✓ Body - Panels
- ✓ Body - Glass
- ✓ Body - Mirrors

RO# 14096 - 

07/15/2024 Odo In 16300

- ✓ Fluids - Brake
- ✓ Fluids - Oil
- ✓ Fluids - Antifreeze/Coolant
- ✓ Fluids - Transmission
- ✓ Fluids - Washer
- ✓ Fluids - Power Steering
- ✓ Belts
- ✓ Cooling - Radiator Hoses
- ✓ Cooling - Heater Hoses
- ✓ Cooling - Radiator
- ✓ Cooling - Water Pump
- ✓ Battery
- ✓ Battery Cables
- ✓ Engine
- ✓ Filters - Air
- ✓ Filters - Cabin
- ✓ Filters - Fuel
- ✓ Ignition - Plug Wires

RO# 14096 - 

07/15/2024 Odo In 16300

- ✓ Ignition - Cap
- ✓ Exhaust
- ✓ Tire Condition, Pressures
- ✓ Suspension - Struts/Shocks
- ✓ Suspension - Wheel Bearings
- ✓ Suspension - Ball Joints
- ✓ Suspension - Bushings
- ✓ Front Brakes - Friction
- ✓ Front Brakes - Hydraulics, Hose/Line condition.
- ✓ Rear Brakes - Friction
- ✓ Rear Brakes - Hydraulics Hose/Line condition
- ✓ Steering - Box/Rack
- ✓ Steering - Tie Rod Ends
- ✓ Drive Shaft - U-Joints/Couplings
- ✓ Drive Shaft - Supports
- ✓ Differential

2. Diagnose A/C System Operation

RO# 14096 -

07/15/2024 Odo In 16300

**LABOR**

Diagnose AC System Operation

**INSPECTION SUMMARY**

- ✓ System Pressures
- ✓ Compressor Condition
- ✓ Hose/Line Condition
- ✓ Control Operation
- ✓ Condenser Fan Operation
- ✓ Belt Condition
- ✓ Visible Leaks

**3. Change Engine Oil & Filter**

**LABOR**

Drain & Refill  
R&R Engine Oil Filter

**PARTS**

8.5 Castrol Synthetic Blend Oil,  
20W50 159848  
1 NPN/ Protune/ API Oil Filter  
5001-200186

**4. Test Drive - 2.0 Miles**

RO# 14096 -

07/15/2024 Odo In 16300

**LABOR**

Test Drive - 2.0 Miles

**INSPECTION SUMMARY**

- ✓ Fuel Gauge Level
- ✓ Dash Indicators
- ✓ Service Aesthetics

**5. Remove & Replace A/C Compressor**

**LABOR**

Evacuate & Refill Refrigerant  
R&R Compressor  
R&R A/C Hose

**PARTS**

908 Chemours Freon R134A (sold  
by gram) R134A-30  
1 1990 XJ6 A/C Compressor  
60-01264NA  
1 Four Seasons A/C Receiver  
Drier 33497

**SUBLET**

A/C Hose Repair