


1994 SL500 Partial List of Expenditures				
2/24/2023	Schmitt Auto PP Insp	Seattle, WA	\$179.36	PrePurch Insp
3/21/2023	Schmitt Auto	Seattle, WA	\$6,538.28	Fluids, Rubber, Pulleys, ...
5/9/2023	Ben's Workshop	Austin, TX	\$2,673.99	Oil, Coolant, Mirror, Stalk...
2/1/2024	Becker AutoSound	Saddle Brook, NJ	\$514.00	Refurb Head and Amp
2/20/2024	Becker AutoSound	Saddle Brook, NJ	\$156.00	Replacement speaker
2/26/2024	Discount Tire	Cedar Park, TX	\$1,122.35	5 x Conti OEM spec
11/23/2024	Zak JustDublt	Flower Mound, TX	\$4,271.30	12 roof cyls, distr, wires, plugs, brake flush
			<u>\$15,455.28</u>	

10450 SE 128th St
Renton, WA. 98059
Phone: 425-749-8423

1505

INVOICE

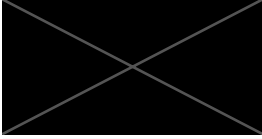

Printed Date: 02/24/2023

Work Completed: 02/24/2023

1994 Mercedes-Benz - SL500 - 5L, V8 (304CI) VIN(Not Available)

Lic # :

Odometer In : 0

VIN # : WDBFA67E7 RF091207

Part Description	Number	Qty	Sale	Ext	Labor Description	Ext
					Inspection	
					inspection	165.00
					-Engine Drive Belt	
					-Oil sub pan dented	
					-P/S pump leaking	
					-front lower fender panel missing	
					-oil leak at oil level sender	
					-valve cover gaskets leaking	
					-Front driveline flex disc cracked	
					-2x underbody plugs missing (1109870544)	
					-front brakes 75%, rear 40%	
					-trunk wet, leaking from 3rd brake light	
					-power antenna corrosion, running all the time	
					-trunk struts do not hold open trunk	
					-spark plug wires poor quality, run incorrectly	
					-Engine wiring harness is already updated design	
					-A/C low on charge, works slightly	

Org. Estimate 179.36 Revisions 0.00 Current Estimate 179.36

Labor:	165.00
Parts:	0.00
SubTotal:	165.00
Tax:	14.36
Total:	179.36
Bal Due:	\$179.36

[Payments -]

Vehicle Received: 2/24/2023

Customer Number : 609

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____

Schmitt Automotive
 16450 SE 128th St
 Renton, WA. 98059
 Phone: 425-749-8423

INVOICE

1511

INVOICE

Printed Date: 03/09/2023 Work Completed: 03/08/2023

1994 Mercedes-Benz - SL500 - 5L, V8 (304CI) VIN(Not Available)
 Lic # : Odometer In : 0
 Odometer Out : 84662
 VIN # : WDBFA67E7 RF091207

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
Spark Plug BKR5EGP 7090	8.00	7.88	63.04	CAMSHAFT OILER TUBE - Remove & Replace - All Four Camshafts -	990.00
Ignition Wire Set 119 159 01 18	1.00	385.27	385.27	Flex Disc - Remove & Replace	132.00
Cam Oil Line Fitting Aluminum, Viton o-rings 119 180 02 66-PRM	16.00	26.00	416.00	BRAKE FLUID FLUSH Mercedes Transmission Service Fluid flush W/ Filter	165.00 330.00
Drive Belt 011 997 29 92	1.00	66.00	66.00	HIGH MOUNT STOP LAMP - Remove & Replace	379.50
Oil Pressure Sender 009 542 08 17	1.00	115.00	115.00	WHEEL BOLT DRILL/ REPAIR	660.00
Antenna Mast 140 827 00 01	1.00	102.00	102.00	EVAPORATION CONTROL CANISTER - Remove & Replace	165.00
Driveshaft Flex Joint-Front 230 410 01 15	1.00	164.58	164.58		
Brake Fluid 1 Liter DOT4 1	2.00	24.29	48.58		
Cabin Air Filter 129 835 00 47	1.00	64.00	64.00		
Oil Filter Kit w/ O-Ring 119 180 00 09 67	1.00	13.50	13.50		
Conventional Engine Oil 15w40	8.50	9.45	80.33		
AT Filter Kit 126 270 02 98	1.00	39.36	39.36		
AUTO. TRANS. FLUID ATF134RED	10.00	16.65	166.50		
R134A Refrigerant R134ARef	2.00	40.00	80.00		
Third Brake Light 129 820 14 56	1.00	140.00	140.00		
Drill Bit 2000735	2.00	17.36	34.72		
Lug Bolt 000 990 48 07	20.00	7.29	145.80		
Acc. Belt Tension Pulley 119 200 14 70	1.00	85.00	85.00		
Breather Hose 119 094 28 82	1.00	43.15	43.15		
Breather Hose 119 094 31 82	1.00	28.95	28.95		
Breather Hose	1.00	27.50	27.50		

Visit us on the web: www.Schmittautomotive.com
 Tech: Sanchez, Joseph 003

Email Address: Mark@Schmittautomotive.com

Schmitt Automotive
 16450 SE 128th St
 Renton, WA. 98059
 Phone: 425-749-8423



INVOICE

Printed Date: 03/09/2023 Work Completed: 03/08/2023



1994 Mercedes-Benz - SL500 - 5L, V8 (304CI) VIN(Not Available)
 Lic # : Odometer In : 0
 Odometer Out : 84662

VIN # : WDBFA67E7 RF091207

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
119 094 44 82 Breather Hose	1.00	35.11	35.11		
119 094 55 82 Breather Hose	1.00	33.50	33.50		
119 094 71 82 Thermostat	1.00	65.96	65.96		
119 200 00 15 Air Distribution Hose	1.00	17.50	17.50		
119 094 40 82 Air Dist. Hose Connector	3.00	2.50	7.50		
117 990 15 78 Timing Guide Rail	1.00	24.38	24.38		
119 050 02 16 Timing Guide Rail	2.00	35.00	70.00		
119 052 09 16 Timing Guide Rail	1.00	26.25	26.25		
119 050 03 16 Cooling Hose	1.00	21.00	21.00		
119 203 02 82 Air Dist. Hose Connector	1.00	11.50	11.50		
119 094 03 12 Air Distribution Hose	1.00	17.50	17.50		
119 094 40 82 Air Distribution Hose	1.00	20.00	20.00		
119 094 27 82 Air Distribution Hose	1.00	13.50	13.50		
119 094 26 82 Charcoal Canister	1.00	153.50	153.50		
1294701259 Turn Signal Bulb Socket	1.00	42.00	42.00		
000 826 95 82 r129 Blinker Relay	1.00	300.00	300.00		
1298201026 Shop Supplies			25.00		

Visit us on the web: www.Schmittautomotive.com

Service Advisor : Schmitt, Mark, Tech : Sanchez, Joseph 003

Email Address: Mark@Schmittautomotive.com

Schmitt Automotive
 16450 SE 128th St
 Renton, WA. 98059
 Phone: 425-749-8423

INVOICE

1511

INVOICE

Printed Date: 03/09/2023 Work Completed: 03/08/2023

1994 Mercedes-Benz - SL500 - 5L, V8 (304CI) VIN(Not Available)

Lic # : Odometer In : 0

Odometer Out : 84662

VIN # : WDBFA67E7 RF091207

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
---------------------------	-----	------	-----	-------------------	-----

SCHMITT AUTOMOTIVE
 16540 SE 128TH ST
 RENTON, WA 98059
 4257498423
<http://www.schmittautomotive.com>

Transaction 001092

Total

\$6,538.28

\$6,538.28

CREDIT CARD SALE
 MASTERCARD 6021

Retain this copy for statement validation

8887

ATHNWKNm: MASTERCARD

Payment 1JWVCWFM70PW0

Clover Privacy Policy

<https://clover.com/privacy>

Org. Estimate 0.00 Revisions 2,301.27 Current Estimate 2,301.27

Revision # 1, Previous Estimate Amount: 0.00, Additional Cost: 884.52, Revised Estimate: 884.52, Parts: \$385.27 Labor: \$412.50 Sublet: \$0.00 Taxes & Fees: \$86.75 Authorized by - Brevard, Laurence. Date - 2/27/2023. Time - 1:33 PM. Initiated By - Shop. Written By - Schmitt, Mark

Revision # 2, Previous Estimate Amount: 884.52, Additional Cost: 73.18, Revised Estimate: 957.70, Parts: \$66.00 Labor: \$0.00 Sublet: \$0.00 Taxes & Fees: \$7.18 Authorized by - Brevard, Laurence. Date - 2/27/2023. Time - 1:35 PM. Initiated By - Shop. Written By - Schmitt, Mark

Revision # 3, Previous Estimate Amount: 957.70, Additional Cost: 420.21, Revised Estimate: 1377.91, Parts: \$115.00 Labor: \$264.00 Sublet: \$0.00 Taxes & Fees: \$412.11 Authorized by - Brevard, Laurence. Date - 2/27/2023. Time - 1:35 PM. Initiated By - Shop. Written By - Schmitt, Mark

Revision # 5, Previous Estimate Amount: 1770.24, Additional Cost: 523.33, Revised Estimate: 2293.57, Parts: \$340.00 Labor: \$132.00 Sublet: \$0.00 Taxes & Fees: \$513.33 Authorized by - Brevard, Laurence. Date - 2/27/2023. Time - 1:36 PM. Initiated By - Shop. Written By - Schmitt, Mark

Labor:	2,821.50
Parts:	3,193.48
SubTotal:	6,014.98
Tax:	523.30
Total:	6,538.28
Bal Due:	\$6,538.28

[Payments -]

Vehicle Received: 3/8/2023

Customer Number : 609

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one year or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.
 Any vehicles not retrieved within 4 days of repair work completed and customer notified are subject to a \$40 per day storage fee.

Signature _____

Date _____

Visit us on the web: www.Schmittautomotive.com

Email Address: Mark@Schmittautomotive.com

Service Advisor : Schmitt, Mark. Tech : Sanchez, Joseph 003

BEN'S WORKSHOP

2109 S. Congress Ave.

Austin, TX 78704

(512) 472-5555

MERCEDES-BENZ SERVICE & REPAIR SINCE 1979

Repair Order #0105586

Date: 5/9/2023

Page 1 of 1

Orig Est #:

Center: 1

VEHICLE: 1994 *MER *SL500
 LICENSE: SWY4617

COLR: TEAL

V.I.N.: WDBFA67E7RF091207

Fleet #:

ENGINE: *119.972

TRANS: 722.364

MILEAGE: 87576

Mod: 129.067

Parts				Labor				
Quan	Part Number	Description	Price	Op	Tech	Description	Time	Charge
1.00	119-180-00-09	FILTER OIL	16.30	00	00	03	CUSTOMER REQUEST WE INSTALL CUSTOMER PROVIDED REAR VIEW MIRROR.	165.00
	Location:	R1B3B						
9.00	CASTROL ENGINE OIL	20W-50 GTX	97.74	00	00	03	CUSTOMER REQUESTS WE REPLACE LEFT STALK-TURN SIGNAL, WIPER CONTROL- CHECK PART PROVIDED BY CUSTOMER TO SEE IF CORRECT.	375.00
	Location:	R5EE						
1.00	018-997-60-47	SEAL P/S PUMP SHFT	18.00				ACCESS AND REMOVE ORIGINAL PART AND FOUND CORROSION AT SOME OF THE MAIN CONNECTION. CLEAN ORIGINAL CONNECTIONS BEFORE INSTALLING CUSTOMER PROVIDED PART. TEST FOR PROPER OPERATION.	
	Location:	ORDER						
1.00	022-997-19-48	P/S RES GASKET	5.60					
1.00	129-680-20-25	HOOD PAD	150.86					
	Location:	ORDER						
1.00	8090	3M SUPER TRIM ADHES	44.05					
1.00	010-997-45-92	BELT 21.36X2535	74.01	PM	001	03	CHANGE OIL AND FILTER.	59.50
1.00	129-997-61-82	P/S RETURN HOSE	0.00					
2.00	#3 HOSE CLAMP		8.64	00	00	03	CHECK FLUID LEVELS & SET TIRE PRESSURES.	
	Location:	R6B2D						
1.00	ANTIFREEZE ZEREX	COOLANT GREEN	27.20				CUSTOMER REPORTS ROLL BAR OPERATION INOP. CHECK AND REPORT. VERIFIED CUSTOMER COMPLAINT. FOUND LEAK IN HYDRAULIC SYSTEM THAT CONTROLS HYDRAULIC TOP AND ROLL BAR. THIS WILL NEED TO BE ADDRESSED BEFORE THE ROLL BAR WILL HAVE PROPER FUNCTION.	82.50
	Location:	R5WEC						
1.00	CAS DMQ6	CASTROL DEXMERC	11.80					
	Location:	R5EEA						
2.00	#1 HOSE CLAMP		11.60					
	Location:	R6B2C						
2.00	BRAKE CLEANER		15.40	00	00	03	INSPECTION OF VEHICLE FOUND THE DRIVE BELT TO BE SHOWING CRACKS. ACCESS AND REPLACE DRIVE BELT.	165.00
	Location:	R2END						
2.00	006-997-09-82	HOSE P/S 14MM	14.00	00	00	03	ACCESS AND REPLACE HOOD PAD.	310.00
	Location:	HOSE		ST	009	03	M119- RESEAL POWER STEERING PUMP: REMOVE POWER STEERING PUMP/RESEVOIR ASSEMBLY TO RESEAL. REINSTALL & REFILL SYSTEM. CLEAN AREA AFTER REPAIR.	812.50
				SU	080		LOCKSMITH: NEW KEY	128.42
				MS	001		HAZ-MAT WASTE DISPOSAL	0.00

WARRANTY ON REPAIRS IS 12 MONTHS OR 12,000 MILES WHICHEVER OCCURS FIRST.

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. NOT RESPONSIBLE FOR DAMAGE OR ARTICLES LEFT IN CAR IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE BEYOND OUR CONTROL.

Labor:	\$1,969.50
Parts:	\$495.20
Sublet:	\$128.42
Other Fees:	\$0.00
Supplies:	\$36.97
Subtotal:	\$2,630.09
Sales Tax:	\$43.90
Total:	\$2,673.99
Paid:	\$0.00
Due:	\$2,673.99


Signature X _____

Becker AutoSound, LLC
 101 US Highway 46W / 2nd Floor
 Saddle Brook, NJ 07663
 201-773-0976


Invoice

Date 1/22/2024
 Invoice # 36713

Bill To

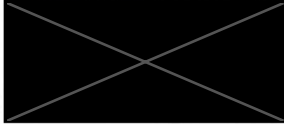

Ship To



P.O. #
 Terms Prepaid

Ship Date 1/22/2024
 Due Date 1/22/2024
 Other

Item	Description	Qty	Price	Amount
BAS-1692.AWE	Radio model 1692 with faceplate / serial S1062476 with security code 14332	1	475.00	475.00
BAS-BOSE 1...	Reconditioned BOSE Amplifier model 129 820 03 89 (SL 94 up) with serial 017078 (this amplifier was shipped in advance to help isolate potential audio issue - we did not charge and are giving you 30-days to determine if needed or not. If used, it will be billed @ \$400. If not needed, simply return and we will close open invoice.	1	400.00	400.00
UPS Ground	UPS Shipping and special packaging of product - UPS Ground	1	29.40	29.40
INSURANCE ...	Insurance to cover customer in case of loss or damage by shipping provider.	1	9.60	9.60
			Subtotal	\$914.00
			Sales Tax (6.875%)	\$0.00
			Total	\$914.00
			Payments/Credits	-\$514.00
			Balance Due	\$400.00

service@beckerautosound.com
 www.BeckerAutoSound.com

201-773-0976

34 788 330 333 3700

Becker AutoSound, LLC
101 US Highway 46W / 2nd Floor
Saddle Brook, NJ 07663
201-773-0976

01/22/2024

SALE

Total: \$514.00

Visa

xxxxxxxxxxxx8690

Exp. Date:


Entry Mode:

Name:

Auth. Code:

Trans. ID:

Terminal ID:

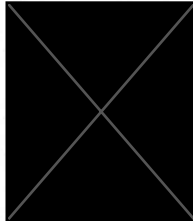

QuickBooks Trans. No:

Merchant No.:

AID

5247710001912070

-

No additional transfer fees or taxes apply

Thank you for your business

Intuit Payments Inc (IPI) processes payments as an agent of the business. Payment processed by IPI constitutes payment to the business and satisfies your obligation to pay the business, including in connection with any dispute or case, in law or equity. Money movement services are provided by IPI pursuant to IPI's licenses (NMLS #1098819). IPI is located at 2700 Coast Avenue, Mountain View, CA 94043, 1-888-536-4801.


CUSTOMER COPY


Becker AutoSound, LLC
 101 US Highway 46W / 2nd Floor
 Saddle Brook, NJ 07663
 201-773-0976

Invoice

Date 2/14/2024
 Invoice # 36826

PAID
 02/14/2024

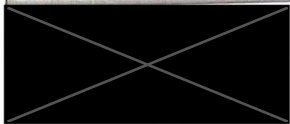Bill To

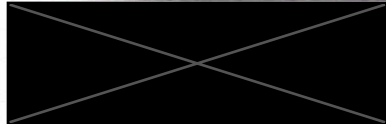
Ship To


P.O. #
 Terms Prepaid

Ship Date 2/14/2024
 Due Date 2/14/2024
 Other

Item	Description	Qty	Price	Amount
SPK-129 Woo...	Used door Woffer set	1	129.00	129.00
UPS Ground	UPS Shipping and special packaging of product - UPS Ground	1	25.40	25.40
INSURANCE ...	Insurance to cover customer in case of loss or damage by shipping provider.	1	1.60	1.60
			Subtotal	\$156.00
			Sales Tax (6.875%)	\$0.00
			Total	\$156.00
			Payments/Credits	-\$156.00
			Balance Due	\$0.00

service@beckerautosound.com
 www.BeckerAutoSound.com

201-773-0976

Becker AutoSound, LLC
101 US Highway 46W / 2nd Floor
Saddle Brook, NJ 07663
201-773-0976

02/14/2024


SALE

Total: \$156.00

Visa



Exp. Date:
Entry Mode:
Name:
Auth. Code:
Trans. ID:
Terminal ID:

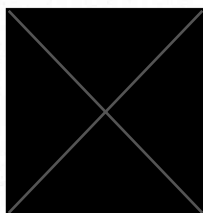

QuickBooks Trans. No:
Merchant No.: 5247710001912070
AID -

No additional transfer fees or taxes apply


Thank you for your business

Intuit Payments Inc (IPI) processes payments as an agent of the business. Payment processed by IPI constitutes payment to the business and satisfies your obligation to pay the business, including in connection with any dispute or case, in law or equity. Money movement services are provided by IPI pursuant to IPI's licenses (NMLS #1098819). IPI is located at 2700 Coast Avenue, Mountain View, CA 94043, 1-888-536-4801.

CUSTOMER COPY


VIEW SALES INVOICE
DISCOUNT TIRE

4/26/2024
4:56 PM

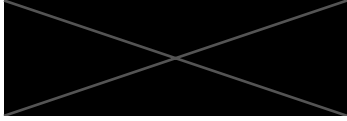

1994 MERCEDES BENZ
SL500
ALL 129 CHASIS

Plate#: SWY4617
Mileage Unknown
Torque Specs: 80



Invoice #
8202369

Salesperson 81
DANIEL B

Estimated Completion Time: 05:13 PM

Article	Qty	Description	FET	Price	Amount
91211	1	CONTINENTAL \$80 INSTANT SAVINGS! NRM SPRING SAVINGS ON SELECT LINES!!!		-80.00	-80.00
BOLT PATTERN: 5-112					
32031	5	225 /55 R16 95W SL BSW NRM CON EXTREME CONTACT DWS06 PLUS		169.00	845.00
TIRE MILEAGE WARRANTY: 50000					
INFLATION F:030 R:033					
80017	5	CERTIFICATES FOR NRM REFUND, REPLACEMENT		33.60	168.00
For tire certificate details, see www.discounttire.com/customer-service/certificates					
80224	5	WASTE TIRE NRM DISPOSAL FEE		3.00	15.00
80219	5	INSTALLATION & NRM LIFE OF TIRE MAINTENANCE		22.00	110.00

Terms and Conditions can be found at
www.discounttire.com/customer-service/invoice-terms

REPLACE ALL 5 TIRE

BRINKER

APPOINTMENT: 04-26-2024 4:15 PM

The tire and/or wheel you have chosen is different from the original equipment provided with your vehicle and may change its handling or stability characteristics. Further information is available from your Discount Tire salesperson.



Sub Total: 1,058.00
Sales Tax: 64.35
Sales Total: 1,122.35
Tendered: 1,122.35 (MSC)



Tendered Today: 1,122.35
Tendered Total: 1,122.35

•
•
•

Just Dub It, LLC

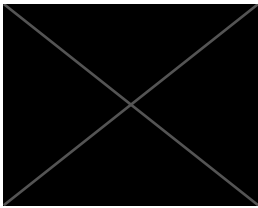

Invoice

DOCUMENT NUMBER
0091

DATE OF ISSUE
03/24

VEHICLE
04 MB SL500
<

PAYMENT STATUS
paid in cash

DESCRIPTION	UNIT COST	QTY/HR RATE	AMOUNT
R129 Top Hydraulics Complete Care Package	\$3,000/hr	1	\$3,000L
OctoClassic R129 no SOS Mushroom dome light cover	\$174.60	1	\$175
Shipping to Cedar Park	\$150/hr	0.1	\$15L
M119 spark plug replacement	\$150/hr	1	\$150L
Bosch F8DC4 spark plugs x8	\$5.95	8	\$48
M119.960/972 Ignition overhaul 2.5hr	\$150/hr	2.5	\$375L
Bosch OEM distributor cap M119.972 x2	\$100.98	2	\$202
Bosch OEM distributor rotor M119.972 x2	\$49.90	2	\$100

M119 distributor dust seal x2	\$5.99	2	\$12
R129 brake fluid flush	\$150/hr	1	\$150L
Motul 5.1 racing brake fluid 0.5L x2	\$14.49	0	\$0

**SUBTOTAL
LABOR** \$3,690

**SUBTOTAL
PARTS** \$537

Tax Rate 8.25%

Tax Value \$44.30

INVOICE TOTAL

\$4,271.30

TES:

1. Distributor caps worn, rotors too, have pitting on terminals. Replacement recommended soon. PERFORMED
2. Spark plugs incorrect, has resistor type NGK, recommended replacement immediately. PERFORMED
3. Oil leak from somewhere dripping down, most likely valve covers as they have silicone all over.
4. F control arms blown out, tie rods too, recommended replacement soon.
5. Brake fluid very dirty, need flush and fill. PERFORMED
6. Trans pan leaking, either pan gasket old or pan bent and not sealing.
7. Driver side distributor has 1 bolt stripped in timing cover with small crack possibly. Badly damaged aluminum thread, extraction not easily possible, left alone.

I hereby authorize *Just Dub It, LLC*, to perform the work outlined in the estimate above without question and guarantee payment for said services provided or the vehicle said repairs are being performed on may be kept as collateral until the invoice amount is paid in full.

Reference: Texas Property Code 70.001

Authorization Method: email text in person

Signature: _____

Date: _____

Authorized By: _____

