


N.Y.S. REGISTER #7075176  
9200 TRANSIT ROAD  
EAST AMHERST, NY 14051  
Phone: 716-688-0402 FAX: 716-639-7560

360609008

Order Date 06/09/26 11:41 am Page 1  
Paid: 06/15/26 10:15 am  
Ref: MON PM

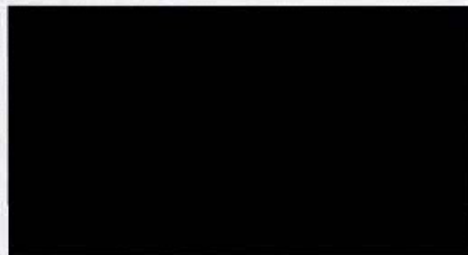

**79 MAZDA RX-7 BRONZE**

5271 Mi.Last in 4/20/2026  
Lic: LNT6353/NY R2Cyl 1.1 Eng  
Vin: SA22C516124  
Eq: AC

Quotes

1 06/09/26 11:42am 345.02

JIM in person.

2 06/11/26 02:45pm 593.59

**A/C RECLAIM WITH SEALER**

**Job01 INITIAL A/C DIAG EVAC,CHRG -R134 Labor: 1.00 hrs@\$214.88/hr=\$214.88**

RF-89	REFRIGERANT DYE/OIL-N	1.0 @	8.78 =\$	8.78	
134-A	AUTOMOTIVE REFRIGERANT-N	1.7 @	37.95 =\$	64.52	73.30

OPERATED CLIMATE CONTROL SYSTEM, CHECK HEATER OPERATIONS, CHECK AIR OUTLET CONTROL OPERATION, INSPECT DRIVE BELTS, COOLANT LEVEL AND CONDITION, CONNECT AIR CONDITIONING SYSTEM TO OUR AIR CONDITIONING EQUIPMENT, CHECK SYSTEM HIGH SIDE AND LOW SIDE PRESSURES, REMOVE AND MEASURE REFRIGERANT, EVACUATE AND RECHARGE SYSTEM ASS OIL AS NEEDED, PERFORMANCE TEST SYSTEM, PERFORM BASIC LEAK TESTING, AND CHECK INSIDE VENT TEMPERATURE. REVIEW TECHNICAL SERVICE BULLETINS AND OTHER VEHICLE SPECIFIC INFORMATION THEN ADVISE OF FINDINGS AND RECOMMENDATIONS.  
IF SYSTEM STOPS WORKING PROPERLY WITH IN 30 DAYS WE WILL RECHECK AT NO CHARGE BLOWS WARM, LAST SERVICE WE ADDED DYE TO SYSTEM TO HELP TRACE A LEAK IF NEEDED. SYSTEM WAS EMPTY OF FREON, COMPRESSOR WORKS ADDED FREON TO TEST SYSTEM. USED THE TEST EQUIPMENT TO FIND A LEAK. NO LEAK PRESENT THAT CAN BE SEEN THERE IS A MINOR OIL TRACE BY CONDENSER NO LEAK. RECOMMEND USING A SEALER AND RECHARGE

Status: Completed Tech: TECH 1

Job Subtotal: \$288.18

**Job02 ADVISE ON HEADLIGHT Labor: 0.00 hrs@\$199.88/hr=\$0.00**

PERFORM VISUAL INSPECTION OF A SYSTEM OR COMPONENT, THEN ADVISE OF REPAIR OR POSSIBLE INITIAL DIAGNOSTIC SERVICES TO ADDRESS CONCERN.  
DOES NOT OPEN ALL THE TIME, PASSENGER SIDE, CUSTOMER PUT THEM BACK DOWN THEN UP AND IT WORKED.  
OPERATED LIGHTS A FEW TIMES AND WORKED EACH TIME. IF ISSUE CONTINUES DIAGNOSTICS WILL BE ADVISED

Status: Completed Tech: JOE D

Job Subtotal: \$0.00

**Job03 A/C SEALER SERVICE W/EVAC & CHRG Labor: 0.80 hrs@\$199.88/hr=\$159.90**

----->----->----->---Continued on the next page--->----->----->----->

**GERRY'S SERVICE**  
 N.Y.S. REGISTER #7075176  
 9200 TRANSIT ROAD  
 EAST AMHERST, NY 14051  
 Phone: 716-688-0402 FAX: 716-639-7560

**INVOICE NO.**  
**360609008**

Order Date 06/09/26 11:41 am **Page 2**  
 Paid: 06/15/26 10:15 am  
 Ref: MON PM

**Job03 A/C SEALER SERVICE W/EVAC & CHRG**

325                      A/C SUPER SEALER-N                      1.0 @                      93.58 =\$                      93.58                      93.58

THIS SERVICE IS ONLY DONE WITH ANY OF THE EVACUATION AND RECHARGE SERVICES, ONCE SYSTEM IS RECLAIMED AND EVACUATED AND PASSES A 20 MINUTE VACUUM LEAK DOWN TEST, ONCE DONE, AFTER REFRIGERANT CHARGE, OIL AND DYE ARE ADDED, THEN THE A/ SUPER SEALER IS INSTALLED. THE A/C SUPER SEALER WILL STOP MOST SMALL LEAKS THERE IS NOT A GUARANTEE IT WILL STOP A LEAK, LEAKS THAT BECOME LARGE MAY STILL LEAK, ADDITIONAL DIAGNOSIS AND REPAIRS WOULD BE NEEDED AT ADDITIONAL COSTS.

Status: Completed Tech: PETE S

**Job Subtotal: \$253.48**

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control. Any estimates written will be honored 90 days from the date written.

(Signature) \_\_\_\_\_

Payments to GERRY'S SERVICE	Cost Summary	
Status: Paid Work Order	Labor	374.78
	Parts	166.88
Payments: \$589.05	Subtotal	541.66
1 06/15/26 589.05 Visa	Tax	47.39
	Total	\$589.05
	Payments	589.05
	Bal Due	0.00

**Thank you for choosing GERRY'S SERVICE**

**GERKY'S SERVICE**

N.Y.S. REGISTER #7075176  
9200 TRANSIT ROAD  
EAST AMHERST, NY 14051  
Phone: 716-688-0402 FAX: 716-639-7560

**INVOICE NO.**

**351103003**

Order Date 11/03/25 09:18 am **Page 1**  
Paid: 02/18/26 12:23 pm



**79 MAZDA RX-7 BRONZE**  
4849 Mi.  
Lic: LNT6353/NY R2Cyl 1.1 Eng  
Vin: SA22C516124  
Eq: AC

Quotes

- 1 08/20/25 02:52pm 1110.00  
JIM in person.
- 2 11/03/25 09:19am 1155.69  
JIM in person.  
ADD NYSI
- 3 11/12/25 02:10pm 9000.00  
JIM in person.  
BRAKES, A/C,FLUIDS, IDLER
- 4 11/17/25 03:54pm 13659.36  
JIM in person.  
CARB POINTS, CAP ROTOR, TUNE

TOWED IN ON MONDAY 11/3

ORIGINAL OWNER, CAR HAS BEEN OFF ROAD 20 YEARS,  
\$5000.00 deposit 11/12/25 visa

1. EVALUATE AND DIAGNOSE REVERSE LIGHTS AND FUEL  
SYSTEM BEFORE DOING ANY OTHER WORK JOBS 6 & 7

NEED PICTURES OF IDLER ARM 3 - WHOLE PART, THE MOUNTING  
TO THE FRAME AND CONNECTION TO DRAG LINK THEN TEXT TO  
BRUCE

<b>Job01 INITIAL NO START-NO CRANK DIAG</b>		<b>Labor: 1.60 hrs@\$239.88/hr=\$383.81</b>			
00369	TOP POST BAT. TERM.-N	1.0 @	21.45 =\$	21.45	21.45

VERIFY CONCERN, VISUALLY INSPECT ALL ELECTRICAL CONNECTION, TEST THE BATTERY, CHARGING SYSTEM AND STARTING SYSTEM, REVIEW BULLETINS AND OTHER VEHICLE SPECIFIC INFORMATION THEN ADVISE OF FINDINGS AND RECOMMENDATIONS

CAR HAD GONE TO A SHOP TO HAVE CARPETING REPLACED, ON THE WAY HOME FROM THAT SHOP THE CAR DIED, IT WAS TOWED TO THE OWNERS HOUSE, A FRIEND LOOKED AT THE CAR AND FELT THE STARTER WAS A PROBLEM BECAUSE IT JUST CLICKED, ORIGINAL STARTER WAS REMOVED BY THE FRIEND AND SENT FOR REBUILD, WHEN RE-INSTALLED CAR STILL CLICKS AND DOES NOT START

VERIFIED NO START, TESTED TO FIND BATTERY TESTED GOOD, INSPECTION FOUND POSITIVE BATTERY CABLE LOOSE AND A MISSING NUT, CABLE END IS FRAID, INSTALL A NEW BATTERY TERMINAL, CLEANED WIRES, RE-ASSEMBLY THEN CHECKED CAR CRANKS NORMALLY.

WE WERE ABLE TO GET CAR STARTED BUT FOUND IT WILL ONLY RUN WITH CHOKE ON, AND WHEN ACCELERATED THE CAR STALLS. REMOVED AIR FILTER ASSEMBLY, INSPECTED TO FIND NO ACCELERATOR PUMP ACTION SUSPECT PROBLEM INTERNALLY WITH CARBURATOR YET SOME TESTING SHOULD BE DONE TO DIAGNOSE CONCERN

THERE ARE A NUMBER OF WIRES HANGING BY THE STARTER AND THE WIRING GOING TO THE STARTER DOES NOT LOOK LIKE IT IS ROUTED PROPERLY

----->----->----->---Continued on the next page--->----->----->----->



**GERRY'S SERVICE**  
N.Y.S. REGISTER #7075176  
9200 TRANSIT ROAD  
EAST AMHERST, NY 14051  
Phone: 716-688-0402 FAX: 716-639-7560

**INVOICE NO.**  
**351103003**

**Page 3**  
Order Date 11/03/25 09:18 am  
Paid: 02/18/26 12:23 pm

**Job04 NYS SAFETY INSPECTION**

Status: Completed Tech: TECH 1

Job Subtotal: \$10.00

**Job05 INITIAL FUEL SYSTEM DIAGNOSIS** Labor: 1.20 hrs@ $\$239.88/\text{hr}=\$287.86$

CAR STALLS WHEN ACCELERATED  
VERIFIED CONCERN, REMOVED AIR FILTER HOUSING AND ASSEMBLY, INSPECTED TO FIND FUEL LEAKS AT THE BOTTOM OF THE CARBURATOR, REVIEWED TECHNICAL INFORMATION, REVIEWED WIRING DIAGRAMS AND VAPOR HOSE ROUTING TO FIND A CONNECTOR UNPLUGGED NEAR THE DISTRIBUTOR, ONCE RECONNECTED WE FOUND CAR WOULD IDLE AND ACCELERATE BATTER BUT FUEL LEAKS ALSO WORSE THE LONGER IT RAN.  
RECOMMEND REPLACING THE CARBURATOR

Status: Completed Tech: PETE S

Job Subtotal: \$287.86

**Job06 INITIAL ELECTRICAL DIAGNOSIS** Labor: 0.70 hrs@ $\$239.88/\text{hr}=\$167.92$

NO REVERSE LIGHTS  
SEE IF RIGHT HEADLIGHT WILL MECHANICALLY OPEN-HEADLIGHT WILL OPEN AND CLOSE MANUALLY  
REVERSE LIGHT REVIEWED WIRING DIAGRAM, THEN IDENTIFIED WIRING UNDER CAR TO FIND REVERSE LIGHT SWITCH WAS UNPLUGGED, PLUGGED IN, CHECK LIGHT TO FIND RIGHT WORKS BUT LEFT SIDE DID NOT, FURTHER TESTING FOUND THE LIGHT SOCKET WAS BAD AND SHOULD BE REPLACED

Status: Completed Tech: PETE S

Job Subtotal: \$167.92

**Job07 STEERING-IDLER ARM BUSHINGS** Labor: 1.00 hrs@ $\$219.88/\text{hr}=\$219.88$

48544H1000	IDLER BUSHING-N	1.0 @	12.36 =\$	12.36	
SHIPPING	FRIEGHT-N	1.0 @	19.68 =\$	19.68	32.04

PREPARE THE VEHICLE,RAISE, AS PER THE MANUFACTURE'S RECOMMENDED PROCEDURE AND SPECIFICATIONS, DO DISASSEMBLY AS NEEDED TO REMOVE THE IDLER ARM. CLEAN ALL PARTS AND SURFACES, INSTALL NEW IDLER ARM RE-BUILD KIT, RE-ASSEMBLE, INSPECT, GREASE FRONT END, AFTER THE ADJUSTMENTS ROAD TEST WHEN DONE  
OWNER SUPPLIED ONE BUSHING WE LOCATED THE SECOND ONE NEEDED

----->----->----->----->----->----->----->----->

**GERKY'S SERVICE**  
 N.Y.S. REGISTER #7075176  
 9200 TRANSIT ROAD  
 EAST AMHERST, NY 14051  
 Phone: 716-688-0402 FAX: 716-639-7560

INVOICE NO.  
**351103003**

Order Date 11/03/25 09:18 am **Page 4**  
 Paid: 02/18/26 12:23 pm

**Job07 STEERING-IDLER ARM BUSHINGS**

Status: Completed Tech: PETE S

Job Subtotal: \$251.92

**Job08 BRAKE FLUID MAINT. FLUSH DOT3 Labor: 0.80 hrs@\$219.88/hr=\$175.90**

BRF3	BRAKE FLUID DOT 3-N	4.0 @	12.35 =\$	49.40	
BRK-1	DEGREASER\CLEANER-N	1.0 @	15.45 =\$	15.45	64.85

RAISE THE VEHICLE, DISASSEMBLE AND REMOVE ALL FOUR WHEELS, OPEN ALL THE BRAKE BLEEDERS, FILL MASTER CYLINDER WITH FLUID, FIRST GRAVITY BLEED THE BRAKE SYSTEM, PRESSURE BLEED THE BRAKE SYSTEM, CLEAN EXCESS BRAKE FLUID, INSPECT FOR LEAKS, REASSEMBLE AND ROAD TEST WHEN DONE.

Status: Completed Tech: PETE S

Job Subtotal: \$240.75

**Job09 CLUTCH FLUID SERVICE Labor: 0.60 hrs@\$219.88/hr=\$131.93**

BRF	BRAKE FLUID-N	2.0 @	12.35 =\$	24.70	
BRK-1	DEGREASER\CLEANER-N	0.5 @	15.45 =\$	7.73	32.43

RAISE VEHICLE, INSPECT HYDRAULIC PORTION OF CLUTCH, OPEN CLUTCH BLEEDER, FILL CLUTCH MASTER CYLINDER, FLUSH FLUIDS THROUGH SYSTEM, FILL WITH APPROVED FLUID, BLEED SYSTEM, REASSEMBLE, AND INSPECT FOR PROPER OPERATION

Status: Completed Tech: PETE S

Job Subtotal: \$164.36

**Job10 BRAKE-REAR DRUM SERV, HARD, CYL Labor: 2.40 hrs@\$219.88/hr=\$527.71**

37566	LR WHEEL CYLINDER ASSM-S	1.0 @	66.45 =\$	66.45	
BRK-1	DEGREASER\CLEANER-N	2.0 @	15.45 =\$	30.90	
33817	RR WHEEL CYLINDER ASSM-S	1.0 @	66.45 =\$	66.45	
FRIEGHT	SHIPPING-S	1.0 @	35.00 =\$	35.00	
11104290	BRAKE SHOE SET-S	1.0 @	59.65 =\$	59.65	258.45

RAISE THE VEHICLE DISASSEMBLE AND REMOVE THE WHEELS, THE DRUMS THE BRAKE SHOES, THE HARDWARE. WORK TO REMOVE BRAKE LINES FROM EACH OF THE REAR WHEEL CYLINDERS, CLEAN ALL LINES, INSTALL BOTH REAR NEW WHEEL CYLINDERS. CLEAN AND LUBRICATE THE BACKING PLATES, INSTALL NEW BRAKE SHOES, CLEAN AND LUBRICATE SELF ADJUSTER HARDWARE ON BOTH SIDES, CLEAN SURFACE ON BRAKE BOTH DRUMS, REASSEMBLE, ADJUST BRAKES, INSPECT FOR PROPER OPERATION, AND ROAD TEST WHEN DONE.

----->----->----->---Continued on the next page--->----->----->----->

**GERKY'S SERVICE**  
 N.Y.S. REGISTER #7075176  
 9200 TRANSIT ROAD  
 EAST AMHERST, NY 14051  
 Phone: 716-688-0402 FAX: 716-639-7560

**INVOICE NO.**  
**351103003**

**Page 5**  
 Order Date 11/03/25 09:18 am  
 Paid: 02/18/26 12:23 pm

**Job10 BRAKE-REAR DRUM SERV, HARD, CYL**

Status: Completed Tech: PETE S

Job Subtotal: \$786.16

**Job11 BRAKE-FRONT SERVICE, ROTORS Labor: 2.70 hrs@\$219.88/hr=\$593.68**

WS1213N	OG WHEEL SEAL-S	2.0 @	10.36 =\$	20.72	
WTA32	IN WHEEL BEARING-S	2.0 @	26.54 =\$	53.08	
WTA1	OUT WHEEL BEARING-S	2.0 @	11.95 =\$	23.90	
6000800001	BRAKE ROTOR ASSM-N	2.0 @	116.05 =\$	232.10	
BRK-1	DEGREASER\CLEANER-N	1.0 @	15.45 =\$	15.45	
BRK-1	DEGREASER\CLEANER-N	1.0 @	15.45 =\$	15.45	
1551007600	BRAKE PAD SET-N	1.0 @	63.35 =\$	63.35	
34080010	BRAKE HARDWARE KIT-N	1.0 @	19.68 =\$	19.68	443.73

RAISE THE VEHICLE, DISASSEMBLE AND REMOVE BOTH WHEELS, THE BRAKE CALIPERS, THE BRAKE PADS, THE BRAKE ROTORS, THE WHEEL BEARINGS.  
 REPLACE THE WHEEL BEARINGS PRESS NEW RACES IN TO THE NEW ROTORS, GREASE AND PACK THE BEARINGS, INSTALL THE BEARINGS NEW SEALS.  
 CLEAN SPINDLE AND RELATED PARTS  
 INSTALL NEW FRONT BRAKE PADS, NEW BRAKE HARDWARE, NEW BRAKE ROTORS, CLEAN AND LUBRICATE SLIDERS AND ALL CONTACT POINTS, REASSEMBLE, INSPECT FOR PROPER OPERATION AND ROAD TEST WHEN DONE.

Status: Completed Tech: ABBY S

Job Subtotal: \$1,037.41

**Job12 ALIGN- FRONT END -SPECIALTY Labor: 1.20 hrs@\$219.88/hr=\$263.86**

ROAD TEST VEHICLE, INSPECT THE FRONT STEERING AND SUSPENSION, SET THE VEHICLE UP ON THE ALIGNMENT EQUIPMENT, SET TIRE PRESSURES, MEASURE CASTER, CAMBER, FRONT TOE AND THRUST ANGLE RESET ALL ADJUSTABLE ANGLES AS NEEDED TO MANUFACTURES SPECIFICATIONS THEN ROAD TEST WHEN DONE.

Status: Completed Tech: PETE S

Job Subtotal: \$263.86

**Job13 DRIVE LINE-AXLE SEALS BOTH REAR Labor: 1.80 hrs@\$219.88/hr=\$395.78**

41791004	AXLE SEAL-S	2.0 @	13.90 =\$	27.80	
80W-90	GEAR OIL-N	1.5 @	28.60 =\$	42.90	

----->----->----->-----Continued on the next page----->----->----->----->

**GERRY'S SERVICE**  
 N.Y.S. REGISTER #7075176  
 9200 TRANSIT ROAD  
 EAST AMHERST, NY 14051  
 Phone: 716-688-0402 FAX: 716-639-7560

**INVOICE NO.**  
**351103003**

**Page 6**  
 Order Date 11/03/25 09:18 am  
 Paid: 02/18/26 12:23 pm

**Job13 DRIVE LINE-AXLE SEALS BOTH REAR**

BRK-1	DEGREASER\CLEANER-N	3.0 @	15.45 =\$	46.35	
WBWRW102R	WHEEL BEARING/SPACER-N	1.0 @	39.68 =\$	39.68	156.73

BOTH REAR AXLE SEALS WERE LEAKING.  
 WITH REAR BRAKES DISASSEMBLED, DISASSEMBLE AND REMOVE THE MOUNTINGS AND RELATED THEN REMOVE THE LEFT REAR AXLE, INSPECTION FOUND ONLY THE OIL SEAL FAILED, REMOVE AND REPLACE THE LEFT AXLE SEAL, THEN RE-ASSEMBLE.  
 DISASSEMBLE AND REMOVE THE RIGHT REAR AXLE THEN INSPECT TO FIND THE RIGHT REAR BEARING AND SPACER SHOP SIGNS OF WEAR, LOCATED THE CORRECT PARTS, SET AXLE UP IN THE PRESS REMOVE THE OLD BEARING AND SPACER, CLEAN AXLE, PRESS ON A NEW AXLE SEAL ND SPACER, INSTALL THE NEW SELLA, RE-ASSEMBLED FILL DIFFERENTIAL, INSPECT FOR PROPPER OPERATION

Status: Completed Tech: PETE S

Job Subtotal: \$552.51

**Job14 A/C EVAC AND RETRO-FIT A/C 134A Labor: 1.10 hrs@\$219.88/hr=\$241.87**

LXVC12NPN	OF RETRO FIT KIT-S	1.0 @	19.68 =\$	19.68	
134-A	AUTOMOTIVE REFRIGERANT-N	1.3 @	36.95 =\$	48.04	
RF-89	REFRIGERANT DYE/OIL-N	1.5 @	8.78 =\$	13.17	80.89

WITH THE SYSTEM ALREADY EMPTY REMOVE BOTH SERVICE PORT VALVES, CONVERT SYSTEM, INSTALL NEW VALVES, RETRO-FIT ADAPTER, EVACUATE THE AIR CONDITIONING SYSTEM, RECHARGE WITH R-134, ADD REFRIGERANT DYE/OIL, LEAK TEST, PRESSURE TEST, AND PERFORMANCE TEST.  
 WE FOUND THAT EVERYTHING IS WORKING NORMALLY, THE SYSTEM IS OPERATING AT 45 DEG. ON THE ROAD TEST AND THERE ARE NO DETECTABLE LEAKS.  
 NOTE: WITH R-134A INSTALLED, THE SYSTEM MAY NOT COOL AS GOOD AS R-12, AND THERE IS A SLIGHT CHANCE OF SYSTEM OR COMPONENT FAILURE.

Status: Completed Tech: PETE S

Job Subtotal: \$322.76

**Job15 COOLANT- SYSTEM MAINT-EXT YEL Labor: 0.80 hrs@\$219.88/hr=\$175.90**

EXT-LIFE YELLOW	ANTIFREEZE/COOLANT-N	2.5 @	26.45 =\$	66.13	66.13
-----------------	----------------------	-------	-----------	-------	-------

ACCESS COOLING SYSTEM, REMOVE ANY COVERS NEEDED, RAISE VEHICLE, DISASSEMBLE SYSTEM AS NEEDED TO DRAIN COOLING SYSTEM, FLUSH OUT COOLING SYSTEM, REASSEMBLE COOLING SYSTEM, FILL WITH COOLANT, BLEED AIR FROM SYSTEM, TOP OFF COOLANT, INSPECT FOR LAKES AND ROAD TEST AS NEEDED

----->----->----->---Continued on the next page--->----->----->----->

**GERRY'S SERVICE**  
N.Y.S. REGISTER #7075176  
9200 TRANSIT ROAD  
EAST AMHERST, NY 14051  
Phone: 716-688-0402 FAX: 716-639-7560

**INVOICE NO.**  
**351103003**

Order Date 11/03/25 09:18 am **Page 7**  
Paid: 02/18/26 12:23 pm

**Job15 COOLANT- SYSTEM MAINT-EXT YEL**

Status: Completed Tech: PETE S

Job Subtotal: \$242.03

**Job16 OIL CHANGE SERVICE CLASSIC/SPEC Labor: 0.70 hrs@\$125.88/hr=\$88.12**

10W-40	SYN BLEND MOTOR OIL-N	5.0 @	11.95 =\$	59.75	
M4612	OIL FILTER-N	1.0 @	16.90 =\$	16.90	76.65

RAISE THE VEHICLE, DRAIN THE ENGINE OIL, REMOVE AND REPLACE THE OIL FILTER, REFILL ENGINE OIL, ADJUST TIRE PRESSURES, PERFORM UNDER HOOD AND CHASSIS CHECK UP, TOP OFF FLUIDS, CHECK OIL LEVEL, LUBE CHASSIS AND STEERING AS NEEDED AND INSPECT FOR LEAKS WHEN DONE.

Status: Completed Tech: PETE S

Job Subtotal: \$164.77

**Job17 TRANS-MANUAL SERVICE 80W90 Labor: 0.60 hrs@\$219.88/hr=\$131.93**

80W-90	GEAR OIL-N	2.0 @	32.70 =\$	65.40	
BRK-1	DEGREASER/CLEANER-N	0.5 @	15.45 =\$	7.73	73.13

RAISE THE VEHICLE, INSPECT TRANSMISSION, REMOVE THE TRANSMISSION DRAIN PLUG, DRAIN THE FLUID THEN REINSTALL THE DRAIN PLUG.  
LOWER THE VEHICLE, FILL THE TRANSMISSION WITH TRANSMISSION FLUID, CHECK FOR PROPER LEVEL AND ROAD TEST WHEN DONE.

Status: Completed Tech: PETE S

Job Subtotal: \$205.06

**Job18 DIFFERENTIAL SERVICE REAR 80W90 Labor: 0.50 hrs@\$189.88/hr=\$94.94**

80W-90	GEAR OIL-N	1.5 @	32.70 =\$	49.05	
BRK-1	DEGREASER/CLEANER-N	1.0 @	15.45 =\$	15.45	64.50

DISASSEMBLE AND REMOVE THE PLUG, DRAIN THE FLUID, INSTALL DRAIN PLUG, FILL WITH APPROVED FLUID, REASSEMBLE, AND INSPECT FOR PROPER OPERATION

Status: Completed Tech: PETE S

Job Subtotal: \$159.44

----->----->----->---Continued on the next page--->----->----->----->

**Job19 FUEL SYS-CARBURATOR REPLACE Labor: 5.60 hrs@\$239.88/hr=\$1,343.33**

SHIPPING	FRIEGHT-S	1.0 @	45.00 =\$	45.00	
REMAN	CARBURATOR 4BL IMP-S	1.0 @	1333.35 =\$	1333.35	
CBN-6	PREM. CARBON CLEANER-N	1.0 @	11.23 =\$	11.23	
BRK-1	DEGREASER\CLEANER-N	1.0 @	15.45 =\$	15.45	
203125	5/16 FUEL\VAPOR HOSE-N	1.0 @	10.95 =\$	10.95	
10	SMALL HOSE CLAMPS-N	2.0 @	4.30 =\$	8.60	1424.58

DISASSEMBLE AND REMOVE THE AIR FILTER ASSEMBLY, MULTIPLE LINKAGES, MULTIPLE VACUUM LINES, THE MOUNTINGS AND REMOVE THE CARBURETOR.  
SEND CARBURATOR OUT FOR REBUILD  
REPLACED FUEL HOSE FROM THE FIREWALL TO THE INLET OF THE CARBURATOR  
INSTALL NEW GASKETS, THE REBUILT CARBURATOR RE-ASSEMBLE, INSPECT, START ENGINE ADJUST CURB IDLE, FASH IDLE, CHOKE THEN MAKE ALL THE RUNNING ADJUSTMENTS, AND TEST DRIVE WHEN DONE.

Status: Completed Tech: PETE S

Job Subtotal: \$2,767.91

**Job20 REPAIR LEFT REVERSE LIGHT Labor: 1.20 hrs@\$219.88/hr=\$263.86**

411-07	ELEC PIG TAIL SOCKET-N	1.0 @	11.25 =\$	11.25	
STP130HC	INSULATED RED CONNECT-N	2.0 @	3.10 =\$	6.20	
89	BULB-N	1.0 @	4.85 =\$	4.85	22.30

THE LEFT REVERSE LIGHT DID NOT WORK, TESTED TO FIND GOOD POWER TO THE SOCKET AND GOOD GROUND BUT SOCKET IS CORRODED  
ATTEMPTS TO LOCATE THE SOCKET FAILED, LOCATED A UNIVERSAL SOCKET PIGTAIL THAT WE FABRICATED TO WORK IN THE ORIGINAL SOCKET, RE-ASSEMBLED, TESTED TO FIND REVERSE LIGHTS NOW WORK PROPERLY

Status: Completed Tech: PETE S

Job Subtotal: \$286.16

**Job21 IGNITION-CAP, ROTOR, POINTS, WIRES Labor: 1.80 hrs@\$219.88/hr=\$395.78**

8172	OG IGNITION CABLE SET-S	1.0 @	104.30 =\$	104.30	
RCG293	IGNITION TUNE SET-N	1.0 @	166.60 =\$	166.60	270.90

DISASSEMBLE AND REMOVE THE IGNITION WIRES, THE DISTRIBUTOR CAP AND ROTOR, THEN REMOVE BOTH SETS OF POINTS AND CONDENSER.  
CLEAN THE INSIDE OF THE DISTRIBUTOR, TEST AND CHECK BOTH COILS, INSTALL THE FIRST SET OF POINTS, THEN THE SECOND ADJUST BOTH TO SPECIFICATIONS, INSTALL TWO CONDENSER, CRANKS

----->----->----->----->----->----->----->----->



N.Y.S. REGISTER #7075176

351103003

Order Date 11/03/25 09:18 am

9200 TRANSIT ROAD

Paid: 02/18/26 12:23 pm

EAST AMHERST, NY 14051

Phone: 716-688-0402 FAX: 716-639-7560

**Job24 RIGHT HEADLIGHT MOTOR REPAIR**

RE-INSTALLED THE HEADLIGHT MOTOR, RE-ASSEMBLED THEN TESTED TO FIND INTERMITTENTLY THE MOTOR WOULD NOT WORK, TESTED FURTHER TO FIND ANOTHER BAD CONNECTION AT ONE OF THE RELAYS, DISASSEMBLED, CLEANED CONNECTION, RE-ASSEMBLED THEN TESTED TO FIND SYSTEM WORKING NORMALLY, TRIED ABOUT 20 TIMES TO FIND IT IS WORKING NORMALLY IF PROBLEM CONTINEUS FURTHER DIAGNOSIS AND REPAIRS WILL BE NEEDED

Status: Completed Tech: TECH 1

Job Subtotal: \$479.90

**Job25 ADVISE ON SUSPENSION-NPF**

Labor: 0.00 hrs@\$239.88/hr=\$0.00

CAR RIDES HARD OVER BUMPS, FELT THROUGH OUT THE WHOLE CAR ONCE REPAIRS WERE COMPLETED AND WE COULD TEST DRIVE CAR, WE COULDNT VERIFY CONCERN, VEHICLE SEEMED TO DRIVE NORMAL IF PROBLEM CONTINUES FURTHER DIAGNOSIS WILL BE NEEDED

Status: Completed Tech: PETE S

Job Subtotal: \$0.00

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control. Any estimaes written will be honered 90 days from the date written.

(Signature) \_\_\_\_\_

**Payments to GERRY'S SERVICE**

**Cost Summary**

Status: Paid Work Order


Labor	6857.54
Parts	3196.35
Subtotal	10053.89
Tax	878.82
Total	\$10932.71
Payments	10932.71
Bal Due	0.00

Payments: \$10,932.71

1 02/18/26 5000.00 Visa DEP 11/25/26

2 02/18/26 5932.71 Visa

**Thank you for choosing GERRY'S SERVICE**

 Outlook

---

Stock Interiors Order 1020057504

---

From Stock Interiors <sales@stockinteriors.com>

Date Tue 7/8/2025 8:31 AM

To 



**StockInteriors.com**  
"Your custom molded auto carpet source"

---

**Order: 1020057504 - Date: 7/8/2025 7:30:29 AM**

---



**Payment Method: Credit Card**

**ORDER DETAILS:**

Item Number: 8162

Quantity: 1.00

Description: 79-85 Mazda RX7 Carpet Complete Kit; Color:825-Maroon Plush Cut Pile

Price: +\$275.95

---

Subtotal: \$275.95

Shipping (Standard Shipping): +\$34.90

Sales Tax: +\$0.00

Discount: -\$0.00

Grand Total: \$310.85

---


Comments: this is for a 1979 Mazda RX-7. It is a standard transmission

Thank you for your order. Please remember that most items are custom made in the USA. This process typically takes about 3 business days for molded carpet, 15 business days for cut and sewn carpets, 15 business days for custom headliners, 40 business days for sun visors, 40 business days for custom seat upholstery, and 60 business days for ABS Headliner Boards, During the busy seasons (holidays/show season) this could take a few days longer.

[Click Here To Check Order Status](#)

We recommend that when your carpet item is received, you remove the item from the box ASAP and lay it on top of your old carpet in room temperature or above for 12-24

Packing Slip - Order 140031120



Shipping Address:



Your Order of 5/10/2026: (140031120)

QTY	Brand Name	Part No
2	Bosch DirectConnect 40517 Wiper Blade - 17" (Pack of 1)	BOS:40517

PARTSGEEK.COM  
1-800-541-9352

WARNING: Parts Geek, LLC does not manufacture, modify or take possession of any products. The component contents of the products are unknown to Parts Geek, LLC. , but may contain components that could be injurious to your health or safety. California residents are encouraged to visit [www.p65warnings.ca.gov](http://www.p65warnings.ca.gov) for further information.



### Order information

Buyer [REDACTED]  
Seller car-jp.sushi  
Placed on May 24, 2026  
Payment method PayPal  
Paid on May 24, 2026

### Shipping address

[REDACTED]

### Order total

1 item \$168.20  
Shipping \$34.99  
Tax\* \$16.26

---

**Order total** \$219.45

\*We're required by law to collect sales tax and applicable fees for certain tax authorities.

[Learn more](#)

### Items bought from car-jp.sushi

Order number: 08-14681-30343

Quantity	Item name	Shipping service	Item price
1	MAZDA Genuine 1979-1985 RX-7 RX7 SA22C Door Weatherstrip Lh & Rh Rubber Seal OEM (166643010392)	eBay SpeedPAK Expedited	\$168.20