

Road Service Express Lube Phone (201) 447-4635

WALDWICK AUTO SERVICE CENTER

WANAMAKER ENTERPRISES, INC. T/A
 25 West Prospect St. • Waldwick, NJ 07463
 Wheel Alignment • Air Conditioning • Towing
 State Inspections • Repairs and Accessories
 Most Major Credit Cards Accepted

No 95125

DATE 10-5-23

YEAR AND MAKE OF CAR - TYPE OR MODEL

1956 T. Bird

L/P # SS2 PTH

MILEAGE 1901

WRITTEN BY R

QUAN.	PART NO.	NAME OF PART	SALE AMT.
1		Fuel Pump	
		Gasbat	4.95
		Clamp	15.-
TOTAL PARTS			19.95

DESCRIPTION OF WORK

AMOUNT

✓ Fuel pump clean
 Clean + Repl Fuel
 Pump + Repl Gas
 Gasbat + Repl Gas
 Send unit to
 front arm Bess as
 possible ✓ T/S R+P
 Starting wheel +
 ✓ CANSEL SWITCH 400-

NRDS T/S
 SWITCH ASSEMBLY

LUBRICATE

CHANGE ENGINE OIL

TOTAL SERVICE

TRANS.

DIFF.

LABOR ONLY 400-

GAS, OIL & GREASE

AUTHORIZED BY

X

I HEREBY WAIVE MY RIGHT TO RECEIVE A WRITTEN ESTIMATE OF THE PRICE TO COMPLETE THE REQUESTED REPAIRS

PARTS 15.95

ENV. CH. 5-

SUB TOTAL 424.95

TAX 28.15

TOTAL 453.10

REPAIR ORDER

I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE ALONG WITH NECESSARY MATERIALS. YOU AND YOUR EMPLOYER MAY OPERATE ABOVE VEHICLE FOR PURPOSE OF TESTING, INSPECTION OR DELIVERY AT MY RISK. AN EXPRESS MECHANIC'S LIEN IS ACKNOWLEDGED ON ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS THERETO.
 It is understood that the company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for storage, sale, repair or while road testing.

D&M Diagnostic, Inc.

36 Central Ave.

Tenafly, NJ. 07670

Phone: 201-871-9218 Fax: 201-871-9207

Automotive & Truck Service & Repair


16433

Org. Est. # 022209

PIF 011865

ERF 000853

INVOICE

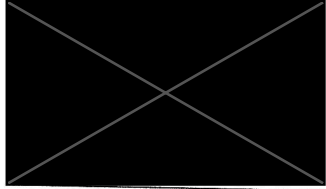

Print Date: 06/26/2023 **Work Completed: 06/26/2023**

1956 FORD - THUNDERBIRD

312 C.I.D. / V8, 4 WHEEL DRUM

Lic #: S52PTH - NJ

Odometer In : 1,691

Odometer Out :

VIN #: YEXA6HL2644

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
OIL FILTER	1.00	5.00	5.00	LUBE OIL FILTER	6.00
OIL FILTER				CHANGED MOTOR OIL OIL FILTER ADDED OIL ADDITIVE	
DEKA 29NF BATTERY	1.00	340.00	340.00	CHECKED ALL BELTS HOSES FLUIDS AND TIRE PRESSURES	
DEKA 29NF				MOUNT NEW TIRES / OWNER SUPPLIED	240.00
OIL	6.00	5.00	30.00	REMOVED WHEELS , DISMOUNTED ALL FOUR TIRES .	
OIL				MOUNTED NEW TIRES. BALANCED.	
OIL ADDITIVE	1.00	6.00	6.00	INSTALL GENERATOR	270.00
OIL ADDITIVE				INSTALLED GENERATOR / REBUILT UNIT OWNER SUPPLIED .	
				POLARIZED GENERATOR . TESTED CHARGING SYSTEM	
				OUTPUT O.K.	
				INSTALLED NEW BATTERY .	
				TOWING	140.00
				TOWED CAR FROM HOUSE TO SHOP	
				Hazardous Materials	5.00

[Technicians : Cianci, Danny; CIANCI, VINNY]

Org. Estimate \$ 1,111.03 Revisions \$ 0.00 Current Estimate \$ 1,111.03 Additional Cost Revised Estimate

Labor:	656.00
Parts:	381.00
Sub:	1,037.00
Tax:	69.03
HazMat:	5.00
Total:	\$1,111.03
Bal Due:	\$1,111.03

GENUINE WESTERN SNOWPLOW SALES, SERVICE & PARTS

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature.....

Date.....

Written By: Cianci, Danny

D&M Diagnostic, Inc.

36 Central Ave.

Tenafly, NJ. 07670

Phone: 201-871-9218 Fax: 201-871-9207

Automotive & Truck Service & Repair


15336

Org. Est. # 021108

PIF 011865

ERF 000853

INVOICE

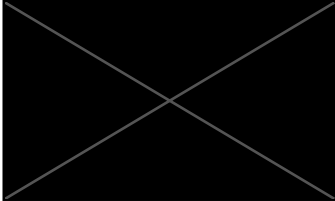

Print Date: 06/06/2022 **Work Completed: 06/06/2022**

1956 FORD - THUNDERBIRD

312 C.I.D. / V8, 4 WHEEL DRUM

Lic #: - NJ

Odometer In : 790

Odometer Out :

VIN #: YEXA6HL2644

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
OIL FILTER	1.00	5.00	5.00	LUBE OIL FILTER	6.00
OIL FILTER				CHANGED MOTOR OIL OIL FILTER ADDED OIL ADDITIVE	
OIL	5.00	3.50	17.50	CHECKED ALL BELTS HOSES FLUIDS AND TIRE PRESSURES	
OIL				LOAD TEST BATTERY, CHECK ALTERNATOR	42.00
OIL ADDITIVE	1.00	6.00	6.00	OUTPUT AND TEST STARTER CURRENT DRAW	
OIL ADDITIVE				LOAD TEST BATTERY, CHECK ALTERNATOR OUTPUT AND	
AUTOLITE SPARK PLUGS	8.00	5.00	40.00	TEST STARTER CURRENT DRAW	
AUT46				ADJUST BRAKES	52.50
DISTRIBUTOR CAP	1.00	28.00	28.00	ADJUSTED BRAKES ON ALL 4 WHEELS	
12106-A				REPLACE SPARK PLUGS	105.00
CONDENSER	1.00	14.00	14.00	REMOVED SPARK PLUGS & REPLACED WITH AUTOLITE 46	
12300A				SPARK PLUGS / SAME NUMBER WE REMOVED	
IGNITION ROTOR	1.00	12.00	12.00	GREASED	52.50
12200A				GREASED FRONT END	
IGNITION POINT SET	1.00	12.00	12.00	ROAD SERVICE	105.00
12200A				REMOVED & REPLACED GASKET AT FUEL FILTER ASSEMBLY	
ANTI-FREEZE COOLANT	3.00	20.00	60.00	/ LEAKING FUEL	
AF-3				TUNE UP	325.00
ASSEMBLY / ALUMINUM	1.00	450.00	450.00	REMOVE & REPLACE SPARK PLUGS, DISTRIBUTOR CAP &	
8005J				ROTOR, POINTS & CONDENSER. MAKE ALL ADJUSTMENTS.	
OIL FILL CAP	1.00	30.00	30.00	TUNE -UP	325.00
6766A				REPLACED SPARK PLUGS POINTS & CONDENSER .	
FITTINGS / TRANS LINES	2.00	6.00	12.00	DISTRIBUTOR CAP & ROTOR. SET DWELL & IGNITION TIMING	
1/8"X1/8NPT				. REPLACE COMPLETE IGNITION WIRE SET.	
359279S				REMOVE & REPLACE RADIATOR WITH NEW /	520.00
IGNITION WIRE SET	1.00	90.00	90.00	LEAKING LOWER TANK	
1259A				REMOVED RADIATOR . INSTALLED NEW ALUMINUM	
CARBURETOR REBUILD KIT	1.00	25.00	25.00	REPLACEMENT UNIT.	
9510B				REBUILD CARBURETOR	520.00
				REMOVE & REBUILD CARBURETOR	
				Hazardous Materials	5.00

Palloccel
Post
 6/7/2022
 845

D&M Diagnostic, Inc.

36 Central Ave.

Tenafly, NJ. 07670

Phone: 201-871-9218 Fax: 201-871-9207

Automotive & Truck Service & Repair


15336

Org. Est. # 021108

PIF 011865

ERF 000853

INVOICE

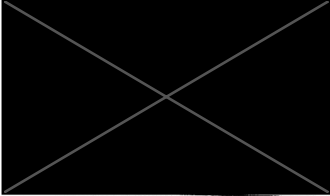

Print Date: 06/06/2022 **Work Completed: 06/06/2022**

1956 FORD - THUNDERBIRD

312 C.I.D. / V8, 4 WHEEL DRUM

Lic #: - NJ

Odometer In : 790

Odometer Out :

VIN #: YEXA6HL2644

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
---------------------------	-----	------	-----	-------------------	----------

[Technicians : Please Select, Technician; Cianci, Danny; CIANCI, VINNY]					
---	--	--	--	--	--

Org. Estimate	\$ 465.42	Revisions	\$ 1,993.89	Current Estimate	\$ 2,459.31	Additional Cost	Revised Estimate
---------------	-----------	-----------	-------------	------------------	-------------	-----------------	------------------

Revision # 1, Previous Estimate Amount: 465.42, Additional Cost: 1993.89, Revised Estimate: 2459.31

Parts: \$500.00 Labor: \$1365.00 Sublet: \$0.00 Taxes & Fees: \$128.89

Authorized by - REITZENSTEIN, LEON, Date - 6/6/2022, Time - 1:43 PM, Initiated By - Shop

\$1,993.89	\$2,459.31
------------	------------

Labor:	2,053.00
Parts:	801.50
Sub:	2,854.50
Tax:	189.44
HazMat:	5.00
Total:	\$3,048.94
Bal Due:	\$3,048.94

[Payments -]

GENUINE WESTERN SNOWPLOW SALES, SERVICE & PARTS



I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature..... Date.....

Written By: Cianci, Danny



Invoice

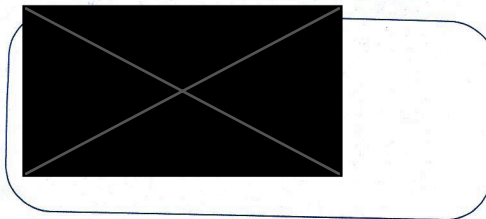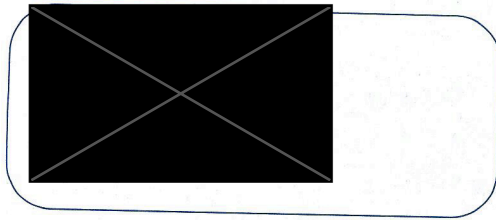

CUSTOMER NO: 01-REIT004
 INVOICE NO: 1074337-IN
 INVOICE DATE: 6/20/2025
 PAGE NO: 1

CUSTOMER P.O.	ORDER NO	ORDER DATE	SALESPERSON
	0776588	6/20/2025	MJ
TELEPHONE NO.	FAX NO.	SHIP VIA	PAYMENT METHOD
		FEDX HOME DELIV AC EL EL	MC/V 9376


ITEM NUMBER	DESCRIPTION	ORDERED	SHIPPED	BACK ORDERED	UNIT PRICE	TOTAL
B11654G	HEADLIGHT SWITCH, 12 VOLT	1.00	1.00	0.00	59.95	59.95
B13853A	HORN RELAY, 12 VOLT	1.00	1.00	0.00	20.65	20.65
B18574A	HEATER LOWER CONTROL ARM	1.00	1.00	0.00	17.03	17.03
B18575A	HEATER UPPER CONTROL ARM	1.00	1.00	0.00	14.01	14.01
B20330A	DOOR PILLAR WEATHERSTRIP	2.00	2.00	0.00	3.09	6.18
	THANK YOU FOR CHOOSING LARRYS TBIRD AND MUSTANG THANK YOU FOR YOUR ORDER -- MARK XT 121 ***** PLEASE SEE PARTSMAN CONCERNING ANY BACK ORDERED PARTS.					

Thank You!

Guarantee: All new reproduced products are guaranteed against defects in workmanship and materials. **Liability of Larry's Thunderbird & Mustang Parts is limited to the replacement of defective parts.** If you are not satisfied with a purchase and wish to make an exchange or return for refund, we ask that this be done within 30 days of purchase. If it is our error, we will reimburse you for shipping costs. However, all parts must be returned prepaid, via least expensive transportation. Returns will not be accepted on the following items: electrical parts, books, or items with which installation has been attempted. All returns must have a copy of the invoice and may be subject to a restocking charge.


Merchandise Damaged and / or Shorted: Inspect your parts immediately upon receipt. If you should receive parts that are damaged and/or missing due to a broken box, contact the carrier (i.e. FED EX, UPS, Post Office, or freight lines). They will process your claim. If you find a shortage in your order, you must advise us of that shortage within 7 days. We will only accept responsibility for shortages reported within 7 days. Do not ship the parts back to us! We will do everything we can to see that your claim is taken care of as quickly as possible.


NET INVOICE	117.82
DISCOUNT	
SALES TAX	0.00
FREIGHT	0.00
INVOICE TOTAL	13.80
LESS DEPOSIT	131.62
INVOICE BALANCE	0.00
	131.62

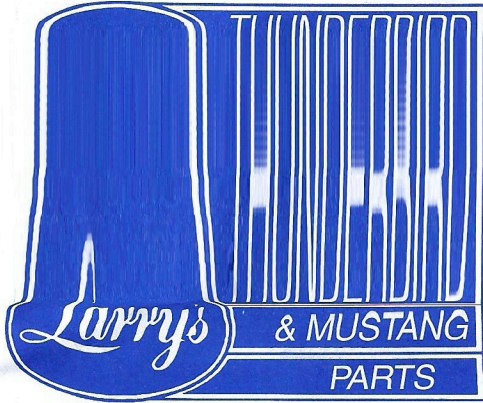

Invoice

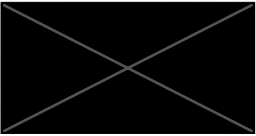

SOLD TO:

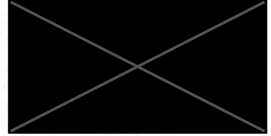
SHIP TO:


CUSTOMER NO: 01-REIT004
INVOICE NO: 1074036-IN
INVOICE DATE: 6/13/2025
PAGE NO: 1

CUSTOMER P.O.	ORDER NO	ORDER DATE	SALESPERSON
	0776341	6/13/2025	CC
TELEPHONE NO.	FAX NO.	SHIP VIA	PAYMENT METHOD
		FEDX 2DAY CC EL CC EL	MC/V 9376

ITEM NUMBER	DESCRIPTION	ORDERED	SHIPPED	BACK ORDERED	UNIT PRICE	TOTAL
B13304B	TURN SIGNAL CANCEL PLATE	1.00	1.00	0.00	38.95	38.95

Thank You!

Guarantee: All new reproduced products are guaranteed against defects in workmanship and materials. **Liability of Larry's Thunderbird & Mustang Parts is limited to the replacement of defective parts.** If you are not satisfied with a purchase and wish to make an exchange or return for refund, we ask that this be done within 30 days of purchase. If it is our error, we will reimburse you for shipping costs. However, all parts must be returned prepaid, via least expensive transportation. Returns will not be accepted on the following items: electrical parts, books, or items with which installation has been attempted. All returns must have a copy of the invoice and may be subject to a restocking charge.

Merchandise Damaged and / or Shorted: Inspect your parts immediately upon receipt. If you should receive parts that are damaged and/or missing due to a broken box, contact the carrier (i.e. FED EX, UPS, Post Office, or freight lines). They will process your claim. If you find a shortage in



NET INVOICE	38.95
DISCOUNT	
SALES TAX	0.00
FREIGHT	0.00
INVOICE TOTAL	13.80
LESS DEPOSIT	52.75
	0.00



Invoice



CUSTOMER NO: 01-REIT004
 INVOICE NO: 1073735-IN
 INVOICE DATE: 6/5/2025
 PAGE NO: 1

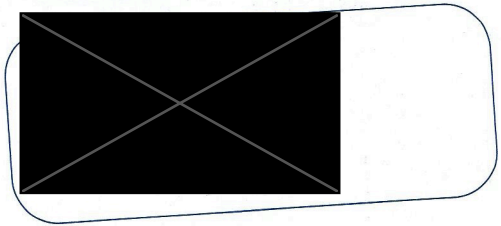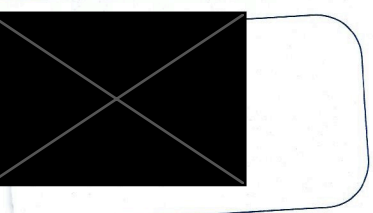

CUSTOMER P.O.	ORDER NO	ORDER DATE	SALESPERSON
	0776088	6/5/2025	CC
TELEPHONE NO.	FAX NO.	SHIP VIA	PAYMENT METHOD
		UPS GROUND CC EL CC EL	MC/V 9376

QUANTITY	DESCRIPTION	ORDERED	SHIPPED	BACK ORDERED	UNIT PRICE	TOTAL	
1.00	TURN SIGNAL SWITCH CAM	1.00	1.00	0.00	9.43	9.43	
						NET INVOICE	9.43
						DISCOUNT	0.00
						SALES TAX	0.00
						FREIGHT	15.97
						INVOICE TOTAL	25.40
						LESS DEPOSIT	0.00
						INVOICE BALANCE	25.40

You!

new reproduced products are guaranteed against defects in workmanship and materials. **Liability of Larry's Thunderbird & Mustang**
 the replacement of defective parts. If you are not satisfied with a purchase and wish to make an exchange or return for refund, we ask
 within 30 days of purchase. If it is our error, we will reimburse you for shipping costs. However, all parts must be returned prepaid, via least
 attention. Returns will not be accepted on the following items: electrical parts, books, or items with which installation has been attempted. All
 copy of the invoice and may be subject to a restocking charge.

Damaged and / or Shorted: Inspect your parts immediately upon receipt. If you should receive parts that are damaged and/or
 broken box, contact the carrier (i.e. FED EX, UPS, Post Office, or freight lines). They will process your claim. If you find a shortage in
 it advise us of that shortage within 7 days. We will only accept responsibility for shortages reported within 7 days. Do not ship the parts
 to everything we can to see that your claim is taken care of as quickly as possible.