

QTY.	MATERIAL/PARTS	PRICE	AMOUNT
2	3/8 tube		
1	520400 plunger seal		
1	697-250 Pitt gasket		
1	Shipping		
1	Monza 88282 exhaust		
1	50500 Down pipe		
2	Resurface drum		
2	Resurface rotor		
4	0-196 Tierod boot		
1	5096 Steering bush		
1	5-553 U Joint		
2	7-870 Bleed screw		
2	7-875 Brake adjuster		
2	7-7535 Tab washer		
1	12-3181 Gasket		
1	12-5341 Brake pin		
6	12-8510 Pipe clip		
1	6-516 Brake sheave		
2	7-7534 Handbrake lever		
4	12-58145 Caliper bolt		
1	Shipping on above		
6	3-5945 Grammet		
1	7-640 Caliper kit		
2	7-954 Wheel cylinder		
4	1-513 Intake valve		
16	1-942 Rocker bush		
4	1-5636 Exhaust valve		
4	1-9011 Intake seat		
4	1-9031 Ex seat		
TOTAL MATERIAL/PARTS			



SPORTS CAR FACTORY

RICHARD BENNETT P.O. BOX 95
 (440) 298-9735 THOMPSON, OHIO 44086

277

JOB INFORMATION	
ORDER DATE	JOB PHONE
WORK ORDERED BY	
JOB NAME/LOCATION TR3B	
CONTACT	DATE PROMISED
PHONE	ORDER TAKEN BY

ADDRESS
 [REDACTED]

CITY STATE ZIP

DESCRIPTION OF WORK	AMOUNT

LABOR	HOURS	RATE	AMOUNT	TOTAL MATERIAL/PARTS
				TOTAL LABOR
				5% SHOP SUPPLIES
				Tax
TERMS	TOTAL LABOR →			TOTAL
DATE COMPLETED	SIGNATURE (I hereby acknowledge the satisfactory completion of the above described work.)			

QTY. MATERIAL/PARTS PRICE AMOUNT




277

SPORTS CAR FACTORY

RICHARD BENNETT P.O. BOX 95
(440) 298-9735 THOMPSON, OHIO 44086

JOB INFORMATION	
ORDER DATE	JOB PHONE
WORK ORDERED BY	
JOB NAME/LOCATION TR3B	
CONTACT	DATE PROMISED
PHONE	ORDER TAKEN BY



CITY STATE ZIP PHONE ORDER TAKEN BY

DESCRIPTION OF WORK AMOUNT


- 1) Rebuild gearbox, new synchros, bearings, seals, gaskets, layshaft and gear, thrust washers 10.0
- 2) Rebuild engine, new pistons/cylinders, bearings, grind crank, regrind cam, new lifters, guides, valves, hard seats, rebuild oil pump, new water pump, chain, tensioner, clean, blast and paint engine, modify mount 30.0
- 3) Assemble chassis, rebuild calipers, turn drums & discs, pack bearings, clean out and reseat diff, new brake fuel lines, install shocks, repair body mount, install engine and gearbox, install exhaust, straighten steering box, rebuild idler rod, install new rear rear brakes, install E-brake, install radote from 30.0
- 4) Rebuild carbs, glasshead, install kits 8.0

LABOR	HOURS	RATE	AMOUNT	TOTAL MATERIAL/PARTS
# 1	10.0			TOTAL LABOR
2	30.0			5% SHOP SUPPLIES
3	30.0			
4	8.0			
TERMS	TOTAL LABOR →			TOTAL

TOTAL MATERIAL/PARTS

DATE COMPLETED SIGNATURE (I hereby acknowledge the satisfactory completion of the above described work)

QTY.	MATERIAL/PARTS	PRICE	AMOUNT
------	----------------	-------	--------

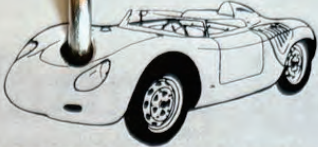

277

SPORTS CAR FACTORY

RICHARD BENNETT (440) 298-9735 P.O. BOX 95 THOMPSON, OHIO 44086

JOB INFORMATION

ORDER DATE	JOB PHONE
WORK ORDERED BY	
JOB NAME/LOCATION TR3B	
CONTACT	DATE PROMISED
PHONE	ORDER TAKEN BY

[Redacted Address] CITY STATE ZIP

DESCRIPTION OF WORK	AMOUNT
---------------------	--------

5) Final assembly - install wiring, pedal box, master cylinders, bleed brakes & clutch, install dash, gauges, oil lines, cables, repair - paint heater, repair wiper motor, install wiper pivots, install scuttle vent, install front bumper, install carbs, carb linkage, rebuild distributor, install vacuum line, install heater hoses, install fuel lines to carb, fuel filter, install tunnel cover, clean out fuel tank, install sender, install tank, fuel cap, install steering column, install carpet, recover seats, install door and dogleg panels, cover cockpit combing, install windshield, install top & side curtains, top up all fluids, install battery & check electronics, test run sync carbs, align front end

LABOR	HOURS	RATE	AMOUNT	TOTAL MATERIAL/PARTS
# 5	160.0			TOTAL LABOR
				5% SHOP SUPPLIES
TERMS	TOTAL LABOR →		TOTAL	

TOTAL MATERIAL/PARTS

DATE COMPLETED SIGNATURE (I hereby acknowledge the satisfactory completion of the above described work.)



The Roadster Factory

POST OFFICE BOX 332, ARMAGH, PENNSYLVANIA 15920-0332, U.S.A.
LEVEL I SALES (800) 678-8764 • LEVEL II SALES (800) 234-1104
CUSTOMER SERVICE (800) 283-3723 • FAX ORDERING (814) 446-6729

INVOICE NO. 03-033728

PAGE NO. 1

INVOICE DATE 10/20/03

CUSTOMER NO. 112726

CUST. P.O. NO.

NO. OF PKGS. 1


SHIP VIA

SALESPERSON LA

SOLD TO



SHIP TO

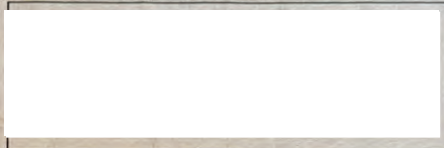

LN. NO.	PART NO.	BIN LOC.	DESCRIPTION	QTY. ORDERED	QTY. SHIPPED	QTY. BK.ORD.	UNIT PRICE	EXTENDED PRICE
01	GRH453	3N55	T24 HOSE, TOP, RADIATOR	1	1			
02	LUG4012	3Z15	T24S13M5 GENERATOR, REBUILT	1	1			
03	LUG4012		REFUNDABLE CORE DEPOSIT (MUST BE ASSEMBLED)	1	1			
			SUB TOTAL					
			SHIPPING AND HANDLING CHARGES					
			INVOICE TOTAL					

Please check all items listed on your invoice. For our mutual protection, all claims must be filed within FIVE days of receipt of merchandise. Please see 2002 red price list for details. All starter or alternator cores must be returned in the original boxes from the manufacturer. Refunds for core charges will not be issued if returned without the manufacturer box.

GOD BLESS AMERICA

The amount of this invoice has been charged to your credit card per your instructions. Watch for Volume Two, Quick Reference Catalogue. Sale prices on electrical components, body panels, body hardware, fittings, tops, tonneaus, and Magic Carpet items.

****Please read all new policies listed in the 2002 price list****
All backorders will be shipped automatically upon receipt of merchandise. Please be sure to cancel any items that you do not need or do not wish to have shipped when available.
Thank you for your order with our company. ****ALL ELECTRICAL PARTS ARE NON-RETURNABLE.****

Arthur Nagasaki
11405 Whitaker Road
Fenton, MI 48430
810-629-8627

The Roadster Factory
P.O. Box 332
Armagh, PA 15920
1-800-678-8764

March 6, 1998

Dear Sirs,

I would like to have the following engine rebuilt as described in your Quick Reference Catalog.

CF 28625 UE

If you have any questions regarding this request I can be contacted by phone between the hours of 7:30 am and 5:00 pm on 248-696-1110.

Sincerely,

Arthur Nagasaki
Customer Number RF103698/T6



